



PT. SMART CAKRAWALA AVIATION

## WORK ORDER

Form: SCA/MTC/030

Subject : <b>Propeller Assy Replacement</b>	No.	WO/047-SNH/VI/2023
	Date	26 Jun 2023
	A/C Reg.	PK-SNH - C208B 5587
Reference : MP C208B Issued 01 EI NO. 003/EO/TEK-TS/VI/2023	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
<b>Description :</b>  1. Perform Propeller Assy Replacement 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC.  #If any finding, please close the routine card, and transferred to inspection card.		
<b>Additional Work :</b>  N/C		
Compliance Statement  CARRIED OUT	Sign & Date Company Lic. No.: 05-July-2023 SCA.36 (Engineer In Charge)	Signature  (Technical Manager)

**AIRCRAFT CHECK WORK SUMMARY**  
(Form: SCA/MTC/051)

DATE OF ISSUED	JOWO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
26 Jun 2023	WO/047-SNH/VI/2023	Propeller Assy Replacement	05-July-2023		
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5587	PK-SNH		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0662	3696:36/5517		
	#2	-			
Propeller/Rotor	#1	190837	1998:14		
	#2	-			
Landing Gear	NLG		3696:36/5517		
	LH MLG		3696:36/5517		
	RH MLG		3696:36/5517		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	1	✓		
2	Inspection Card				
3	Work Order	1	✓		
4	Summary Inspection List	1	✓		
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1	✓		
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
<u>IC-001</u>					
<u>IC-002</u>					
<u>IC-003</u>					
<u>IC-004</u>					
<u>IC-005</u>					
<u>IC-006</u>					



<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :  
Technical Support



.....

Hani

Checked by :  
Chief Maintenance



.....

Dodit

Verified by :  
Chief Inspector



.....

Yanuar

Approved by :  
Technical Manager



.....

Istiono



**SUMMARY INSPECTION ITEMS**  
(Form: SCA/MTC/050)

WO Ref: WO/047-SNH/VI/2023

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	NRC-001	REPLACEMENT OF PROPELLER ASSY 4HFR34C778 REF EO NO. 003/EO/TEK-TS/VI/2023	05/ 07-2023		CEP NANA	





PT. SMART CAKRAWALA AVIATION

**CERTIFICATE RETURN TO SERVICE**  
SCHEDULED MAINTENANCE INSPECTION  
(CRS-SMI)

A/C TYPE : CESSNA 208B TTSN : 1998:19  
A/C REG : PK-SNH TCSN : 5517  
MSN : C208B-5587 DATE : 05-july-2023

TYPE OF INSPECTION : PROPELLER ASSY REPLACEMENT



DUE AT  
REF : EO NO. 003/EO/TEK-TS/IV/2023

EXCEPTION

- NO EXCEPTION -

**AUTHORIZED PERSON**


I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.  
Aircraft safe and airworthy for flight

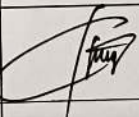NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
CEP NAWA P	AIRFRAME & POWER PLANT	15114 / SCA.36	 	05/07.2023
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : PROPELLER ASSY REPLACEMENT

DUE AT : 3500

Form: SCA/MTC/049

	TECHNICAL SUPPORT TECHNICAL DEPARTMENT <b>ENGINEERING ORDER</b>		003/TEK-TS/VI/2023	
			Rev. No	Original
			Rev. Date	26 Jun 2023

## ENGINEERING ORDER

003/TEK-TS/VI/2023

**REMOVAL & INSTALLATION OF PROPELLER MCCAULEY MODEL  
4HFR34C778 Series ON CESSNA 208B GRAND CARAVAN**

**PT. SMART CAKRAWALA AVIATION**

Prepared	Checked	Approved
Technical Support	Technical Manager	Chief Inspector
Signature: 	Signature: 	Signature: 
Name: Dwi M	Name: Istiono	Name: Yanuar A. F.
Date: 26 Jun 2023	Date: 26 Jun 2023	Date: 26 Jun 2023





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No


Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

Aircraft Reg.: <b>PK-SNH (208B5587)</b>	Make/Model: <b>C208B</b>	No. EO: <b>003/TEK-TS/VI/2023</b>	Rev. No. : <b>Original</b>
Total Flight Hours: 3696 : 36	Total Flight Cycle: 5517	Date Issued : <b>26 Jun 2023</b>	
Task Description :		Technical Data Reference :	
<b>REMOVAL &amp; INSTALLATION OF PROPELLER MCCAULEY MODEL 4HFR34C778 Series ON CESSNA 208B GRAND CARAVAN</b>		<b><u>MCCAULEY PROPELLER SYSTEMS Propeller Owner/Operator Information Manual C700/C750/C1000 Propeller Removal/Installation</u></b>	
Effectivity :  <b>CESSNA 208B EQUIPPED WITH PROPELLER MCCAULEY MODEL 4HFR34C778 Series</b>			

	TECHNICAL SUPPORT TECHNICAL DEPARTMENT <b>ENGINEERING ORDER</b>		003/TEK-TS/VI/2023	
			Rev. No	Original
			Rev. Date	26 Jun 2023

<div>SMART AVIATION ENGINEERING ORDER</div>															
<div>1. Description.</div> <p>This EO is issued, to perform removal &amp; installation checklist Propeller Assembly maintenance practices the 4HFR34C778 Series Propeller on Cessna 208B Grand Caravan.</p>															
<div>2. Aircraft Effectivity.</div> <table border="1"> <tr> <td>REGISTRATION</td> <td>SERIAL NUMBER</td> </tr> <tr> <td>PK-SNH</td> <td>208B5587</td> </tr> </table>				REGISTRATION	SERIAL NUMBER	PK-SNH	208B5587								
REGISTRATION	SERIAL NUMBER														
PK-SNH	208B5587														
<div>3. Distribution :</div> <table> <tr> <td>TECHNICAL MANAGER</td> <td>[ √ ]</td> <td>MATERIAL SUPPORT</td> <td>[ √ ]</td> </tr> <tr> <td>SAFETY &amp; QUALITY MANAGER</td> <td>[ √ ]</td> <td>TECHNICAL SUPPORT</td> <td>[ √ ]</td> </tr> <tr> <td>CHIEF INSPECTOR</td> <td>[ √ ]</td> <td>FILE</td> <td>[ √ ]</td> </tr> </table>				TECHNICAL MANAGER	[ √ ]	MATERIAL SUPPORT	[ √ ]	SAFETY & QUALITY MANAGER	[ √ ]	TECHNICAL SUPPORT	[ √ ]	CHIEF INSPECTOR	[ √ ]	FILE	[ √ ]
TECHNICAL MANAGER	[ √ ]	MATERIAL SUPPORT	[ √ ]												
SAFETY & QUALITY MANAGER	[ √ ]	TECHNICAL SUPPORT	[ √ ]												
CHIEF INSPECTOR	[ √ ]	FILE	[ √ ]												
<div>4. Man Hours</div> <p>18.0 man-hour to do the inspection</p>															
<div>5. Material</div> <p>A1633-72 Packing A1639-32 Nut, Propeller</p>															
<div>6. Special Tool Required</div> <p>Tracking, Propeller Adapter, Torque Wrench Start Lock Release</p>															
<div>7. Compliance</div> <p>The Propeller model 4HFR34C778 Series have 4 of Blades, do a removal the propeller installed on Engine refer to accomplishment instruction task card, and install the Serviceable/New Propeller on the aircraft refer to accomplishment instruction task card.</p>															
<div>8. Publications Affected.</div> <p>None.</p>															





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

**9. Accomplishment Instructions.**

**PROPELLER REMOVAL**

Date : 09-July-2023 WO Number : WO/097-SNH/VI/2023  
Part No. Propeller : 4HFR34C778- A/C Total Hours : 3696:36  
Serial No. Propeller : ~~210140~~ 190837 A/C Total : 5517  
Propeller Time : TSN: 3696:36 TSO: Landing  
Removed from A/C Reg. : PK-SNH

Description	Eng.	RII	Remarks
<b>A. REMOVE PROPELLER (Refer to Figure 01 to 04)</b>			
1. Make sure the airplane propeller control lever has the FEATHER position selected and the propeller blades are in feather.			
<b>NOTE: If the propeller control lever is not in the FEATHER position or the propeller blades are not in feather, consult the Pilot's Operating Handbook for instructions to put the propeller control in the feather position and to feather the propeller.</b>			
2. Place a drip pan under the propeller mounting surface to catch any spilled engine oil when the propeller is removed.			
3. Remove the feedback bearing assembly from the feedback collar groove. Refer to the aircraft or engine manual for procedure.			
4. Remove the cowling as required for access to the mounting nuts.			
5. Remove the cowling as required for access to the mounting nuts.			
<b>NOTE: Make sure the rods are inserted through the correct holes of the tool. The beta rods must be pulled directly forward.</b>			
<b>CAUTION: Do not draw the feedback collar too far forward as the beta rods will be damaged</b>			
6. Turn the large threaded rod of the retractor tool clockwise to draw the feedback collar forward to allow access to the propeller mounting nuts.			
7. Break the torque on the propeller mounting nuts. (McCauley Torque Wrench Adapter part number B-5588 may be used to gain easier access to mounting nuts.)			
8. Install propeller sling and attach to hoist. If hoist is unavailable, propeller may be supported and lifted by hand. This will require			





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

additional personnel.

**CAUTION: The C700 propellers weigh approximately 120 pounds (54 kg), the C750 propellers approximately 140 pounds (64 kg). CI000 series propellers weigh 180 pounds (83 kg) or more**

A. Hoist straps must be a minimum of 4 inches (100 mm) wide

B. The sling and hoist should have a weight limit rating at least twice the weight of the propeller that is to be removed.

C. The straps of the propeller sling should be placed on two of the propeller blades at least 6 inches (152 mm) outboard of the propeller hub. Make sure you protect the deice boots or anti-ice shoes from potential propeller sling abrasion damage, if installed.

9. Take up the slack on the propeller sling and hoist, or have additional personnel support the propeller, and remove the nuts.

10. Carefully slide the propeller forward and remove from the engine

11. Place the propeller on a suitable support or propeller stand  
a. Do not let the propeller be supported by the tips of the propeller blades or "stand" the propeller on the propeller blade tips  
b. The stand should be able to hold the propeller securely and have a weight limit rating at least twice that of the removed propeller.  
c. Make sure the propeller is protected from damaged while in the stand. All areas of the stand that come in contact with the propeller should be padded sufficiently to prevent abrasion damage to the propeller.

12. Install a protective cover over the propeller hub mounting flange.

13. Install a protective cover over the open end of the engine propeller flange.

14. Remove the D-5945 feedback collar retractor tool from the propeller.

**\*\*\* END OF THE TASK \*\*\***





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

**PROPELLER INSTALLATION**

Date : 05-July-2023 WO Number : 50/047-SWH/VI/2023  
Part No. Propeller : 4HFR34C778- A/C Total Hours : 3696 : 36  
Serial No. Propeller : 210190 A/C Total : 5517  
Landing  
Propeller Time : TSN: 1998:19 TSO:  
Install to A/C Reg. : PK-SWH

Description	Eng.	RII	Remarks
<b>B. INSTALL PROPELLER (Refer to Figure 01 to 04).</b>			
<b>NOTE: McCauley recommends that the propeller mounting nuts (McCauley part number A-1639-32) be replaced at each propeller installation, whenever possible. However, nuts may be reused if the locking material prevents turning of the nut on the stud by hand.</b>			
1. Install the D-5945 feedback collar retractor tool on the propeller.			
2. Remove protective cover from the end of engine propeller flange.			
3. Make sure the flange is clean and free of nicks and burrs.			
4. Make mounting sure stud that the holes are engine clean, propeller dry, and flange, free of dowels, nicks and and burrs.			
5. Remove protective cover from the propeller hub mounting the flange.			
6. Make sure and that the propeller studs hub mounting flange, dowel pin holes, are clean mounting and, undamaged.,			
7. Make sure that a new O-ring is installed in the groove of the propeller hub mounting flange. Lubricate the O-ring with engine oil prior to installation of the propeller. NOTE: Refer to the Installation Parts For Turbine Engine Propellers, Table 1002 for the O-ring part number. NOTE: In the past, new propeller assemblies shipped from McCauley, the propeller hub/engine O-ring was installed in the O-ring groove of new propellers and hub assemblies. This practice has been discontinued. The O-ring is now included in the propeller unattached parts kit, which is included in the box with the propeller or hub assembly. Install the O-ring according to the assembly instructions in this Owner/Operator Manual.			
8. Use a propeller sling and hoist, or additional personnel, to position the propeller close to the engine propeller flange and align engine			





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

flange dowel pins with the dowel pin holes on the propeller hub mounting flange. Rotate engine propeller mounting flange as required to align the dowel pin holes.




A. Hoist straps must be a minimum of 4 inches (100 mm) wide



B. The sling and hoist should have a weight limit rating at least twice the weight of the propeller that is to be installed.

 


C. The straps of the propeller sling should be placed on two of the propeller blades at least 6 inches (152 mm) outboard of the propeller hub. Make sure you protect the deice boots or anti-ice shoes from potential propeller sling abrasion damage, if installed.

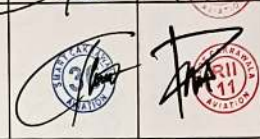

**CAUTION: Propeller must be installed straight onto the engine flange. Any rocking of the propeller with respect to the flange could result in damage to the engine/propeller flange mating surfaces.**

9. Mount the propeller on the engine propeller shaft.



10. Make sure the alignment mark on the spinner aft bulkhead and the propeller blade with are in alignment.



11. Ensure threads of nuts and studs are free of burrs, nicks, and similar damage, and clean of foreign material.



**CAUTION: Do not use oil as a substitute for approved lubricant. It is imperative that the correct specification of lubricant be used during installation. Substitution of the approved grease with an unapproved lubricant { or no lubricant} could result in undertorquing or severe over-torquing of propeller attaching parts.**

12. Lubricate the threads of studs and nuts and the faces of nuts, spacers, or washers with MIL-PRF-83483 (McCauley part number A-1637-16) grease.



13. Install mounting nuts on mounting studs.



14. Torque the mounting nuts in an alternating sequence to prevent the hub rocking on the engine flange.



15. When the hub is seated fully on the engine flange, torque to the specification called out in the mounting decal located on propeller hub at the number 1 socket.



**NOTE: If the decal containing the propeller installation instructions is missing or illegible, install a new decal. All Pratt & Whitney engine installations, use a part number A- 2230-7 decal. The A-2230-7 decal specifies a lubricated 68 to 72 foot-pounds (92.196 to 97.619 N-m) torque.**



16. After you apply the final torque, apply torque seal to nut and stud threads.



17. If required, install the deice leads.



N/A

18. McCauley Torque Wrench Adapter:







TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

**CAUTION:** If an adaptor or extension (such as McCauley part number B-5588) is attached to torque wrench drive end and this adds to its length, then the actual applied torque will be greater than the dial reading. The following formula should be used to find what the dial should read in order to obtain the correct applied torque:

$$\text{Dial Reading} = \frac{\text{Torque Wrench Length} \times \text{Desired Torque}}{\text{Torque Wrench Length} + \text{Extension Length}}$$

19. Remove the D-5945 feedback collar retractor tool from the propeller

20. Make sure of proper rigging of engine controls. Refer to aircraft maintenance manual or STC maintenance manual supplement.

a. Feather, reverse, and low blade angles are set during assembly or overhaul. These angles are NOT adjustable in the field.

**CAUTION:** Do not operate the propeller below the minimum propeller idle speed operating restriction. The minimum propeller idle speed operating restriction is the result of a specific vibratory resonant condition known as "reactionless mode". Ground operation, at or near a reactionless mode vibratory resonance speed, can cause very high stresses in the propeller blades and hubs. These high stresses are more severe when operating in a tail-wind condition. If the propeller is operated within a restricted RPM range or below a minimum RPM restriction for an extended period of time, the propeller blades and hubs may become unairworthy due to fatigue. Hub or blade failure has the potential of causing a catastrophic event due to blade separation. The propeller RPM restriction is often placed below the minimum idle RPM; however, certain aircraft have a restriction that is above the propeller idle RPM setting. Either restriction is important. The propeller operating restrictions or limitations may be found in the Airplane Flight Manual (AFM) or Airplane Flight Manual Supplement (AFMS). The propeller installations may be controlled by the various airframe manufacturers Type Certificate (TC) or by Supplemental Type Certificate (STC).

21. Install Propeller Spinner

22. Start engine I.A.W Pilots Operating Handbook and FAA

23. Perform propeller dynamic balancing ref. C208B MM chapter 61-11-00 Dynamic balancing (McCauley) - Adjustment test. Refer also to related balancer tools manual.

24. Make an appropriate entry in Work Order and Aircraft Flight & Maintenance Log (AFML).

**\*\*\* END OF THE TASK \*\*\***





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
**ENGINEERING ORDER**

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

**SMART AVIATION  
ENGINEERING ORDER**

**MAINTENANCE RELEASE**

I hereby certify that the above stated maintenance and/or inspection was performed in accordance with the approved Aircraft Maintenance Manual and meets requirements of Civil Aviation Safety Regulations.

Name : CEP NANA

Stamp :



Signature : [Signature]

Place/Date : 05 July 2023

- END -





**NON ROUTINE CARD**  
(Form: SCA/MTC/047)

 
1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/047-SNH/VI/2023		REPLACEMENT	PK-SNH
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	61		
9. ZONE	10. PANEL		
FRONT			

11. DESCRIPTION			
PERFORM PROPELLER ASSY REPLACEMENT MODEL 4hFR34C778 REF EO NO. 003/EO/TEK-TS/VI/2023  S/N OFF:190837			
REFERENCE	<input checked="" type="checkbox"/> 002/EO/TEK-TS/VI/2023	<input checked="" type="checkbox"/> MCCAULEY MPC 700/750	<input type="checkbox"/> OTHER
RII (*)	<input checked="" type="checkbox"/> Y	<input type="checkbox"/> N	MHR :

12. RESULT		MECH	ENG	INSP (*)
PERFORMED PROPELLER ASSY REPLACEMENT MODEL 4hFR34C778 REF EO NO. 003/EO/TEK-TS/VI/2023 FOUND GOOD  Performed at A/C TT : ...3696:36..... A/C TC /LDG : ...5517.....				
FINDING	<input type="checkbox"/> Y	<input type="checkbox"/> N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		05	07	2023

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
PROPELLER ASSY	P7785550-01	1 SET		✓

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	10268891	SEP-2023	GOOD
TORQUE WRENCH	BPS01NMPRMH	AUG-2023	GOOD
GENERAL TOOLS	NPJ	O/C	GOOD



## Parts Used Sheet

[illegible]





## Additional Work Sheet

### Propeller Assy Replacement

Aircraft Registration: **PK-SNH**

WO# Nr: **WO/047-SNH/VI/2023**

## Parts Used Sheet

### Part Used

[illegible]





MAINTENANCE PROGRAM  
CESSNA 208/208B

Appendix E06.7 – OOP61001 / Propeller Dynamic Balance

Reg. Mark : PK- BHH  
MSN : C208B-5587  
TSN / CSN : 3696:36 / 5517


Date : 05-JULY-2023  
Station : MALINAU  
WO No. : WO/097-SWH/VI/2023

NO.	ZONE	TASK	SIGNATURE	
			ENGINEER SIGN&STAMP	RII SIGN&STAMP
01	211 212	Perform propeller dynamic balancing refer to Cessna Maintenance Manual 61-11-00.		
*** End of OOP61001 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

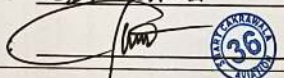Name : CEP NANA Place/Date : LNU/05-JULY-2023  
Sign & Stamp 





TECHNICAL SUPPORT  
TECHNICAL DEPARTMENT  
ENGINEERING ORDER

003/TEK-TS/VI/2023

Rev. No

Original

Rev. Date

26 Jun 2023

PROPELLER CHANGE – Component Inventory Record




Registration	: PK-SNH	Work Order Number	: 40/097-SNH/VI/2023
Airframe Time	: 3696:36	Airframe Landing	: 8517
Propeller Time	: 1998:14	Propeller Cycle	:

Propeller OFF				Propeller ON		
Description	Part Number	Serial Number	Time Remaining	Part Number	Serial Number	Time Remaining
Propeller Hub	4HRT39C778-1	190837		4HRT39C778-1	210140	
Blade#1	102BHA-O	ANH-30063		102BHA-O	APB-30105	
Blade#2	102BHA-O	ANH-30096		102BHA-O	APB-30075	
Blade#3	102BHA-O	ANH-30105		102BHA-O	APB-30108	
Blade#4	102BHA-O	ANH-30097		<sup>a</sup> 102BHA-O	APB-30080	

NOTE: ANY OTHER COMPONENT CHANGES MUST BE FILLED ON ADDITIONAL WORKSHEET (SCA-MTC 030)



# SERVICEABLE TAG

Part Number: <b>P7785550-01</b>		Description: <b>PROPELLER EX PK-SNJ</b>					
Serial Number: <b>210140</b>	Qty.: <b>1 SET</b>	<input type="checkbox"/> Form 8130-4 For Class 1 Product	<input type="checkbox"/> Form 8130-3/JAA Form 1 For Class II/III Product	<input type="checkbox"/> C of C For Class II Product Only			
Order Number: <b>W0/041-SNJ/VV</b> <del>W0/041-SNJ/VV</del> <b>2023</b>	Receipt Date: <b>N/A</b>	<div>The Part Identified has been :  <input type="checkbox"/> Inspected only    <input type="checkbox"/> Repaired    <input checked="" type="checkbox"/> Other  <b>CERTIFICATE OF RELEASE TO SERVICE</b>  <i>I hereby certify that the work recorded above have been carried out in accordance with the requirements of the Indonesia Civil Aviation Safety Regulations applicable thereto and is airworthy</i>  <table border="1"><tr><td>Sign/Stamp </td><td>Authority</td><td>Date : <b>26/06/2023</b></td></tr></table></div>			Sign/Stamp 	Authority	Date : <b>26/06/2023</b>
Sign/Stamp 	Authority				Date : <b>26/06/2023</b>		
Mfg. Date: <b>N/A</b>	Vendor / Approved Shop: <b>N/A</b>						
TSN: <b>1998 : 14 Hrs</b>	Shelf Life Expiry Date: <b>N/A</b>						
Remarks: <b>FOR SUPPORTING PK-SNH</b>	TSO: <b>N/A</b>						
	Store Inspector:						
	Main Store:      Outstation Store						
Condition							

Form: SCA/MTC/022