



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 12 & Add Task Due at 1600 Hours.	No.	WO/031-SNW/II/2022
	Date	10-Feb-2022
	A/C Reg.	PK-SNW C208B-5579
Reference : MP C208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		

Description :

1. Perform Inspection Document 12 & Add Task Due at 1600 Hours.
2. Make an entry in Maintenance Log.
3. Return the Completed Work Order and Form to PPC.

#If any finding, please close the routine card, and transferred to inspection card.

Additional Work :

REFER TO FORM SCA/MTC/051
INSPECTION CARD LIST.

Compliance Statement CARRIED OUT	Sign & Date Company/Lic. No.: 08 / MARCH / 2022 9657 (Engineer In Charge)	Signature (Technical Manager)
---	---	--------------------------------------

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED	
11-Feb-2022	WO/031-SNW/III/2022	Inspection Doc. 12 & Add Task	08 MARCH 2022	
A/C Type		Mfg. Serial Number	A/C Registration	
C208B		C208B-5579	PK-SNW	
AIRCRAFT DATA				
Subject	Pos #	Serial Number (SN)	TTSN/TCSN	
Engine	#1	PCE-VA0651	1601:07 / 2463	
	#2	-		
Propeller/Rotor	#1	190815	1601:07 / 2463	
	#2	-		
Landing Gear	NLG		1601:07 / 2463	
	LH MLG		1601:07 / 2463	
	RH MLG		1601:07 / 2463	
PACKAGE COVERED				
No	Subject	Qty	Remark	
1	Non-Routine Card	2	#001, #002	
2	Inspection Card	-		
3	Work Order	1		
4	Summary Inspection List	1		
5	Material and Tool List	-		
6	Escalation form	-		
7	CRS (SMI / Unscheduled Maintenance)	1		
INSPECTION CARD (IC) LIST (Finding during maintenance)				
No	Taskcard Ref	Subject	Status Open Close	Name/ Sign & Stamp
IC-001	F74 2002	RH SIDE IGNITER WORN OUT	☒	ARIS-K
IC-002	A322001	MD1 BOLT NOSE LANDING GEAR NEED TO BE REPLACE	☒	Prava
IC-003	D121001	LEAK AT BRAKE PISTON NO #1 & #2 RH SIDE	☒	Prava
IC-004	A122101	ROLLER WEAR & DISCREPANCY AT BEARING PLAT LH SIDE	☒	Prava
IC-005				
IC-006				

<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager

SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/031-SNW/II/2022

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	08/03/2022		Devin Prun	
3	CHAPTER 12	INSPECTION DOCUMENT 06	05/03/2022		Devin Prun	
4	CHAPTER 13	INSPECTION DOCUMENT 07	06/03/2022		Devin Prun	
5	CHAPTER 14	INSPECTION DOCUMENT 08	06/03/2022		Devin Prun	
6	CHAPTER 15	INSPECTION DOCUMENT 09	07/03/2022		Devin Prun	
7	CHAPTER 16	INSPECTION DOCUMENT 10	07/03/2022		Devin Prun	
8	CHAPTER 17	INSPECTION DOCUMENT 11	07/03/2022		Devin Prun	
9	CHAPTER 18	INSPECTION DOCUMENT 12	07/03/2022		Devin Prun	
10	CHAPTER 32	INSPECTION DOCUMENT 26 (BATTERY CAPACITY CHECK)	05/03/2022		Devin Prun	
11	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	05/03/2022		Devin Prun	
12	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	06/03/2022		Devin Prun	
13	CHAPTER 53	ENGINE PT6A-140 200 HOUR / 6 MONTHS INSPECTION	06/03/2022		Devin Prun	
14	CHAPTER 54	ENGINE PT6A-140 400 HOUR INSPECTION	08/03/2022		Devin Prun	
15	370102	REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD	05/03/2022		Devin Prun	

16	370103	REPLACE VACUUM RELIEF VALVE FILTER DISCARD	05/ 03/2022		Don Pratt	
17	SCA/MTC/ 023	EMERGENCY EQUIPMENT CHECK	06/ 03/2022		Don Pratt	

MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix B03 – PT6A-140 Engine Run Performance Sheet

Reg. Mark : PK - 5NW

WO/FML No. : WO 1031-SN1/II/2022.

PRE – INSPECTION	
Location	NAB/PE
Date	08 MARCH 2022
Cycle	
Filed Barometric	1009
OAT	36°C
Altitude	30 ft.

POST – INSPECTION	
Location	NAB/PE
Date	08 MARCH 2022
Cycle	
Filed Barometric	1009
OAT	33°C
Altitude	30 ft

PRE – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	842 °C	834 °C
Ng	102.6 %	100.8 %
Wf	565	529
Oil Press		90 PSI
Oil Temp		74° °C
Start Temp		732 °C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	841 °C	827 °C
Ng	102.7 %	100.5 %
Wf	578	533
Oil Press		90 PSI
Oil Temp		73° °C
Start Temp		670 °C

Engine Run Up Checks					
Inertial	☒	EPL	☒	OVG	☒
Stby Alt	☒	BOV	☒	Brake	☒
Random	☒				

NOTE:

1. Brake system at Torque 2000 ft-lbs.
2. Inertial Separator at Torque 400 ft-lbs.
3. EPL check can't exceed 4% Ng per second.
4. Standby Alt at 80% Ng.
5. Low idle at 55.5 - 57% 40Amps.
6. High idle at 64 - 66% Ng 40Amps

Engine Performance Target Table (Cessna C208B EX)

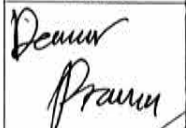
OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

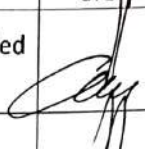
NIL -

PERFORMED BY			
Name	Sign & Stamp	Date	Location
Dennis Braun		08 / March 2022	NAB/PE

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 12 – Inspection Document 06

Reg. Mark : PK - SNW Date : 05 MARCH 2022
MSN : C208B 5579 Station : NABUKE
TSN / CSN : 1601:07/ 2463 WO No. : W01031-SNW/II/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611 — NOT AVAILABLE —		
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 12 – Inspection Document 06

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				


PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Denyar Praura	Engineer		9687.
Aris Kurniawan	ENGINEER		9523
Firman Toti H.	MEKANIK.		-
PETER AGARA	MEKANIK		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : 

Stamp : 

Signature : 


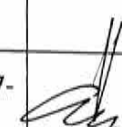
Place/Date : MADIRE / 05 MARCH 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07

Reg. Mark : PK - SNW
MSN : C208B - 5539
TSN / CSN : 1601 : 07 / 2463


Date : 06 MARCH 2022
Station : NABIRE
WO No. : WO/031-SNW/II/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610	N/A	
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720	N/A	
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221		

MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 13 – Inspection Document 07

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720		
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220		
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220		
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72		
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220 P/N ON: 300561452	N / A	
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Danar Prama	Engineer		9687
ARIS KURNIAWAN	ENGINEER		9523
Firman Tji H.	MEKANIK -		-
PETER AGARA	MEKANIK		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Danar Prama

Stamp : 


Signature : 


Place/Date : LEAP/06 MARCH 2022

MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection


Reg. Mark : PK - SNW Date : 06 MARCH 2022
 MSN : C208B - 5579 Station : NAORPE
 TSN / CSN : 1601:07 / 2963 WO No. : W01031-SNW / II / 2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A- 140 200 Hours or 6 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
ARIS KARMAWAN	ENGINEER		3523
Purnan Tori H.	MEKANIK.		-

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.



Name : ARIS KARMAWAN Stamp : 
 Signature :  Place/Date : NAORPE / 06 MARCH 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 54 – Engine PT6A-140 400 Hours Inspection


Reg. Mark : PK-SNC Date : 08 MARCH 2022
MSN : C208B-5579 Station : MADRE
TSN / CSN : 1601:07 / 2463 WO No. : 60/031-SN/H/2022.

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F724000	130	Do borescope inspection of hot section components.		
F731004	130	Do a leak test and a functional test of the fuel manifold adapter and nozzle assemblies. Note: Engines ON fuel nozzle in-situ cleaning program (Ref. Task 71-00-00-160-808). Test fuel nozzles and refurbish as necessary.		
F741001	130	Do a visual inspection of the ignition exciter.		
F741011	130	Do a visual inspection of the ignition cables.		
F742001	130	Do a functional check of the ignition cable.		
F742002	130	Do a visual inspection of the spark igniter/glow plugs. Note: Examine initially at 200 Hours.		
*** End of Engine PT6A-140 400 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Denny Pranny	Engineer		9687.
ARIS KURNIAWAN	ENGINEER		8523
Andriyan Ton H.	MECHANIC		

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 
Signature :  Place/Date : MADRE / 08 MARCH 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 14 – Inspection Document 08


Reg. Mark : PK-SNW Date : 06 MARCH 2022
MSN : 0208B-5579 Station : NABIRE
TSN / CSN : 1601:07/2463 WO No. : WO/031-SNW/II/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-720		
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
ARIS KURNIAWAN	ENGINEER		3523
Purpan Tori H.	MECHANIC		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : ARIS KURNIAWAN Stamp : 
Signature :  Place/Date : NABIRE / 06 MARCH 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 15 – Inspection Document 09

Reg. Mark : PK - SNW

Date : 07 MARCH 2022


MSN : C208B 5579

Station : NABIDE

TSN / CSN : 1601 : 07 / 2463


WO No. : WO/031-SNW/II/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B212401	211 212	Avionics Cooling Fan Operational Check Task 21-24-00-710		
B221201	226 232	Garmin Autopilot (GFC 700) Functional Check Task 22-12-00-720		
B221203	226 232	Garmin Autopilot (GFC 700) Slip Clutch Override Operational Check Task 22-12-00-710		
C273030	213 214	Elevator Bellcrank Lubrication Task 12-21-02-640		
A275001	231 232	Flap Actuator Mount Bracket Detailed Inspection Task 27-50-00-220		
A275003	251 252 511 611 525 625	Flap Bellcrank Detailed Inspection Task 27-50-00-221		
*** End of Inspection Document 09 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Firman Tan H.	MECHANIC		-
Deaur Pranon	ENGINEER		9687

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : 

Stamp :



Signature :



Place/Date :

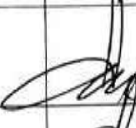
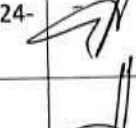
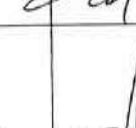
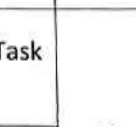

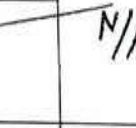


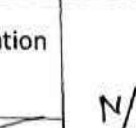
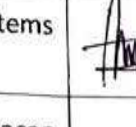
NABIDE / 07 MARCH 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 16 – Inspection Document 10


Reg. Mark : PK - SNW
MSN : C208B - 5579
TSN / CSN : 1601:07/2463

Date : 07 MAR 2022
Station : NABME
WO No. : WO/031-SNW/II/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
C221201	226 232	Autopilot Servos Lubrication Task 22-12-00-640		
A245001	121 122	Power Distribution Boxes Detailed Inspection Task 24-50-00-220		
A251001	231 232	Crew Seats Detailed Inspection Task 25-10-00-220		
A251003	231 232	Passenger Seats Detailed Inspection Task 25-21-00-220		
B271001	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Spoiler System Functional Check Task 27-10-00-720		
C271003 RII	551 571 651 671	Aileron Trim Tab Actuator (2660044-1) Lubrication Task 27-10-02-641 ON A/C 2661615-13		
		RII Sign:  RII Stamp: 		
C273001 RII	371 372 375 376	Elevator Trim Tab Actuator (2660017-1) Lubrication Task 27-30-02-640 ON A/C 2661215-9		
		RII Sign:  RII Stamp: 		
B284103	AUX	Fuel Quantity and Low Fuel Warning Systems Functional Check Task 28-41-00-720		
B313103	312	Flight Data Recorder Underwater Locator Beacon Functional Check Task 31-31-00-721		
B324001	ENG	Brakes Operational Check Task 32-40-00-710		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 16 – Inspection Document 10

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B332001	AUX	Passenger/Cargo Compartment Lighting Operational Check Task 33-20-00-710		
A520001	801 802	Crew Doors Detailed Inspection Task 52-00-00-220		
A520003	255 256 257 258 803 804	Passenger/Cargo Doors and Door Frames Detailed Inspection Task 52-00-00-221		
A781001	130	Primary and Secondary Exhaust Duct General Visual Inspection Task 78-10-00-211		
*** End of Inspection Document 10 Items ***				


PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Denny Pranny	Engineer		9687
Aris Kurniawan	ENGINEER		8523
Gampurna H	ENGINEER		4870
Purpana Toni H.	MECHANIK		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Denny Pranny

Stamp : 

Signature : 


Place/Date : PARIRE / 07 MARCH 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 17 – Inspection Document 11

Reg. Mark : PK - SNW
MSN : C208B - 5579
TSN / CSN : 1601:07 / 2463

Date : 07 MAR 2022
Station : NABIR
WO No. : WO/031-SNW/II/2022.

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B271003	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Aileron System Functional Check Task 27-10-00-721		
C272001	211 212 213 214	Rudder Bar Bearings and Rudder Pedals Lubrication Task 27-20-00-640		
B272001	211 212 213 214 217 218 233 234 253 254 257 258 311 312 320 341	Rudder System Functional Check (Standard Rudder Installation) Task 27-20-00-720		
A273000	373 374	Left and Right Elevator Torque Tube Attach Points (Borescope) Special Detailed Inspection Task 27-30-00-290		
B273001	211 212 213 214 217 218 233 234 253 254 257 258 311 312 320 373 374 375 376	Elevator System Functional Check Task 27-30-00-720		
B275001	251 252 511 611 525 625	Flap System Functional Check Task 27-50-00-720		
B277001	330	Rudder Gust Lock Detailed Inspection (Airplanes 20800237 and On, Airplanes 208B0382 and On and Airplanes equipped with Aero Twin STC SA3649NM) Task 27-70-01-221		
*** End of Inspection Document 11 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Dennis Prunty	Engineer		8657
Simon H.	MECHANIC		—
1			

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Dennis Prunty

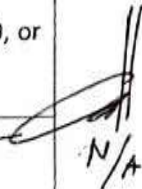
Stamp : 


Signature : 

Place/Date : NABIDE / 07 MARCH 2020

Reg. Mark : PK- SNW
MSN : C208B-5579
TSN / CSN : 1601:07 / 2463.

Date : 07 MARCH 2022
Station : NAB/PA
WO No. : WO/031-SNW/21/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE		
			SIGN	STAMP	
C271005 RII	551	Aileron Trim Tab Actuator (2661615-1, 2661615- 9, or 2661615-10) Lubrication Task 27-10-02-642 ON A/C 2661615-13		 N/A	
	571				
	651				
	671				
C273003 RII	371	Elevator Trim Tab Actuator (2661215-1 & 2661215-9) Lubrication Task 27-30-02-641 ON A/C 2661215-9			
	372				
	375				
	376				
*** End of Inspection Document 12 Items ***					

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Dennis Prana	Forger		9657.
Simon TOR H	MECHANIC		-
PETER AGARA	MECHANIC		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Dennis Prana Stamp : 
Signature :  Place/Date : NAB/PA / 07 MARCH 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 32 – Inspection Document 26

Reg. Mark : PK - SNW

Date : 05 March 2021



MSN : C208B - 5579

Station : NABIRE

TSN / CSN : 1601:07/2963

WO No. : WO/031-SNW/II/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B243301	122	Concord Sealed Lead Acid Battery Functional Check (Capacity Check) EPV Voltage : 20 Volt Result : 108.0 % NOTE: The inspections schedule may be adjusted after the useful battery life is established, based on operations." Task 24-33-00-720		
*** End of Inspection Document 26 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Dany Pauw	Engineer		9687
Firmin Tosi H.	MECANIK		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Dany Pauw

Stamp : 

Signature : 

Place/Date : NABIRE / 05 March 2021

Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

Reg. Mark : PK - SNW

MSN : C208B-5579

TSN / CSN : 1601:07 / 2463


Date : 05 MARCH 2022



Station : NABIR

WO No. : 020/021-SNW/II/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds.		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to-fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235-3A</u> P/N ON: <u>AN 6235-3A</u>		

Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731006	130	Do a check of the drain valve for installation and leaks		
F731007	130	Do a check of the flow divider for installation and leaks.		
F731008	130	Do a visual inspection of the P3 filter and drain valve.		
F731015	130	Do a visual inspection of Fuel Pump outlet filter. (CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235-3A</u> P/N ON: <u>AN 6235-3A</u>		
F731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
F732001	130	Do a check of the FCU for installation, linkages and pneumatic tubes.		
F792000	130	Inspect and clean oil filter for debris.		
*** End of Engine PT6A-140 100 Hours Inspection Items ***				

PERSONNEL PRITICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Aris KURNIAWAN	ENGINEER		9623
Sampurna H.	Engineer		4870
Firman TPR H.	MEKANIK		—
Denny Praman	ENGINEER		9617

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Denny Praman Stamp : 
Signature :  Place/Date : MEABIRE / 05 MARCH 2020

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 52 – Engine PT6A-140 200 Hours Inspection

Reg. Mark : PK - SAW Date : 06 MARCH 2022
MSN : C208B - 5579 Station : NABIRA
TSN / CSN : 1601 : 07 / 2969 WO No. : 440/031-NEW / II / 2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Sampurna H.	Engineer		4870
Simon for H	Technician		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Sampurna H Stamp : 
Signature :  Place/Date : NBX / 06 MARCH 2022



Additional Work Sheet

PK-SNW

WO# Nr:

WO/031-SNW/II/2022

Parts Used Sheet

2

Date	Part Nr.	Serial Nr.	Part Used	Description	Quantity	Engineer
03/03/2022	AN 6235-3A	NSN		FILTER ELEMENT	2ea	SAMPURNA
03/03/2022	AS 3209-126	NSN		PACKING.	1ea	SAMPURNA
—	MS 9385-09	NSN		—	—	—
—	AS 3209-014	NSN		—	1ea	SAMPURNA
—	AS 3209-015	NSN		—	1ea	SAMPURNA
—	AS 3209-011	NSN		—	1ea	SAMPURNA
—	AS 3209-143	NSN		—	1ea	SAMPURNA
—	AS 3209-140	NSN		—	1ea	SAMPURNA
—	AS 3209-224	NSN		—	1ea	SAMPURNA
—	M 83485 FI-904	NSN		—	1ea	SAMPURNA
—	M 83485 / 1-138	NSN		—	1ea	SAMPURNA
—	M 83485 / 1-212	NSN		—	1ea	SAMPURNA
—	AAD9-18-1	NSN		—	1ea	SAMPURNA
—	B3-5-1	NSN		FILTER VCF	1ea	DENIAH
—	AS 3209-009	NSN		FILTER VPUP	1ea	DENIAH
—	3029566	NSN		PACKING	58ea	APIES
05/03/2022	53461-80	NSN		GASKET	14ea	APIES
05/03/2022	214-00400	NSN		PIPE BOLT	2ea	APIES
05/03/2022	M 28980 / 1-212	NSN		CONE BEARING M/G	1ea	DENIAH
05/03/2022	M 28980 / 1-916	NSN		PACKING	1ea	SAMPURNA
05/03/2022	M 28980 / 1-928	NSN		—	1ea	SAMPURNA
05/03/2022	M 28980 / 1-962	NSN		COTTER PIN	2ea	SAMPURNA
05/03/2022	M 28980 / 1-965	NSN		COTTER PIN	1ea	DENIAH
05/03/2022	M 28980 / 1-985	NSN		COTTER PIN	4ea	DENIAH
05/03/2022	M 28980 / 1-989	NSN		TURBUCKLE CHIP	4ea	DENIAH
05/03/2022	M 28980 / 1-992	NSN		POPEL	—	—

[illegible]

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-001	uo/031-SNW/IT/2022		F792002	08 MARCH 2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PE-SNW	G20813 EX	ENGINE			
9. ZONE	10. STA	11. MTC TYPE			
ENGINE	NABIDE	REPLACEMENT.			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
PH SIDE IGNITER WORN OUT.		08/03/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED IGNITER WITH NEW PARTS REFF AMM CH.7A-21-00. Performed at A/C TT : 1601:07 A/C TC /LDG : 2463		 3523	08/03/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

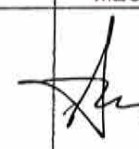
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
IGNITER .	CH 34055	1ea	-	-		

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	N/A	o/c	Good

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
--	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
K-002	W0101-SNU/II/2022		A322001	07/03/2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
10-SNU	C208B EX	HAFFAMR			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NABUR	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
TAPI BOLT NOS. LANDING GEAR YOKE NEED TO BE REPLACE  #966 		07/03/2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED TAPI BOLT WITH NEW PEFF ARAM CH 32-20-00 Performed at A/C TT : 1601:07 A/C TC /LDG : 2463		 #966 	07/03/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
TAPI BOLT	53461-88.	2ea.	-	-	☒	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
General Tools	NPH	O/C	Good.

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-003	W/O 1031-SNW/11/2022		D121001	07/03/2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PE-311W	C20813 BA	KIRKPATRICK			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NAB122	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
FOUND LEAKING AT RH SIDE BRAKE PISTON NO 1 & 2.	  #9602	07/03/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG, LIC	DATE
REPLACED WITH NEW O-RING. PISTON BRASS REPACKING BLEEDING FOUND SATISFACTORILY PERF AFTER CH. 32-40-00 Performed at A/C TT: 1601:07 A/C TC /LDG: 2463.		  #9602	07/03/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	MSL8975-22A	1ea	-	-	☒	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	N/A	O/C	Good.



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-004	WO/031-SNI/II/2022		C122101	05 APRIL 2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PA-SNW	CROSS-BK	AIRPLANE		
9. ZONE	10. STA	11. MTC TYPE		
LANDING GEAR	NOBIS	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
LH SIDE BEARING MAIN LANDING GEAR ROLLER WEAR & DISTORTION	 #9657	05/03/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED BEARING WITH NEW PRFF ATAM LH. 32-40-00 Performed at A/C TT : 1601:07 A/C TC /LDG : 2963.		 #9657	05/03/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
CONR BEARING	214-00400	1ea	-	-	☒	☒

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPN	O/C	Good

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/031-SNW/II/2022	11-Feb-2022	REPLACEMENT COMPONENT	PK-SNW
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	37	MPF DAMEK	NEBBER
9. ZONE	10. PANEL		
CABIN			

11. DESCRIPTION			
PERFORM VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT P/N: AAD9-18-1 / C294502-0201			
REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
PERFORMED REPLACEMENT VACUUM CENTRAL AIR FILTER REF AMM CH. 37-10-00. Performed at A/C TT : 1601:07 A/C TC/LDG : 2263				
FINDING	☐ Y ☐ N	ACT MHR :		DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		05	03	2022

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT	AAD9-18-1 / C294502-0201	1	☒	☒

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPN	O/C	GOOD

NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/031-SNW/II/2022	11-Feb-2022	REPLACEMENT COMPONENT	PK-SNW
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#002	37	AIRFRAME	REPAIR.
9. ZONE	10. PANEL		
CADAM			

11. DESCRIPTION

PERFORM VACUUM RELIEF VALVE FILTER REPLACEMENT
P/N: B3-5-1 / C482001-0202

REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR:

12. RESULT

PERFORMED REPLACEMENT. VACUUM RELIEF VALVE
FILTER. P/N: B3-5-1 / C482001-0202

Performed at A/C TT: 1601:07 A/C TC/LDG: 2463

FINDING	☐ Y	☐ N	ACT MHR:	MECH	ENG	INSP (*)
INSPECTION CARD (IC) #				05	03	2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT	B3-5-1 / C482001-0202	1		

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPM	G/C	Good



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

**PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023**

DATE : 06 MARCH 2022

A/C REG : PK-SNW

A/C TYPE : B737 MAX 8

CHECKER : PETER A

SIGN:

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	PO1201-201	20080980025	DEC 2024	SATISFY
2	Co-Pilot Life Vest	PO1202-201	20080980050	DEC 2024	SATISFY
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	FIRST AID KIT	0920-1690	SEPT 2022	SATISFY
14	Crash Axe Installed	LOCAL TOSITA	-	O/C	SATISFY
15	Fire Extinguisher	FIREX C352	F 75060951	NOV 2022	SATISFY
16	Life Raft (If Installed)	-	-	-	-
17	Survival Kit (If Installed)	LSK-1-5	A79287	NOV 2022	SATISFY
OTHERS					
18	FLASH LIGHT	LOCAL LIFE GEAR	-	-	SATISFY



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION

(CRS-SMI)

A/C TYPE : CESSNA 208B

TTSN : 1601:07

A/C REG : PK-SNW

TCSN : 2463

MSN : C208B-5579

DATE : 08 MARCH 2022

TYPE OF INSPECTION : INSPECTION DOC 12 & ADD TASK

DUE AT : 1600 HOURS

REFF : MP 208/208B REV. 10

EXCEPTION

- NIL -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN & STAMP	DATE
<i>Donna Brown</i>	AIRFRAME & POWER PLANT	<i>9657</i>	<i>[Signature]</i> 	<i>08 / MARCH</i>
-	EIRA	-	-	<i>2022</i>

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS INSPECTION

DUE AT : 1700 FH.

Form: SCA/MTC/049

AIRCRAFT FLIGHT MAINTENANCE LOG

[illegible][illegible][illegible]

No	COMPONENT CHANGE (Description)	POS	P/N On:	P/N Off:	S/N On:	S/N Off:	LIC NO. & SIGN
1.	PLEASE SEE WO/03151NW/11/2022	-	-	-	-	-	9657

ECTM Manual Entry (if required)	
Time	:
Altitude	:
IAS	:
TQ/ EPR	:
ITT/EGT	:
NG/N2	:
NP/N1	:
F/F	:
Oil Temp.	:
Oil Press	:
OAT	:
Last Compressor Wash C/O	
Date	: 08 MAR-CH 2022
PERIODIC INSPECTION	
Last Insp C/O at	: 1601:07
Type of Insp	: 1600
Next Inspection	
Type Insp.	: 1600
Due at	: 1700

APPLICATION AND APPROVAL FORM SHORT TERM ESCALATION AND DEFERRED RECTIFICATION INTERVAL (D76)

Form: SCA/MTC/007

Applicant No.	: 004/STE/TM/III/2021	Date	: 01 March 2022
Aircraft Type	: C208B	Aircraft Registration	: PK-SNW
Component / Inspection - Technical Directive / Work Requiring Escalation: Inspection Doc. 12 & Add Task (1600 Hours/ 60 Months) Ref WO-031-SNW-II-2022			
Part Name / Subject	: Cessna Grand Caravan	Position	: Nabire
Part No. / Models	: C208B	TSN/TSO	: 1590:17 Hrs
Serial No.	: 208B5579	CSN/CSO	: 2449 Cyc
Total Time	: 1590:17 Hrs	Approved TBO	: 1600 Hours
Escalation	: I / H	Approved Deferment Interval	: 10 FH / 30 Days
		Due at	: 1600 FH
Escalation Required: 10 Hours Due at 1610 FH			
Reason for Escalation: Awaiting Space of Hangar Facility			
Special Action / Attention / Instruction Incorporated: N/A			
Enclosed:		 GUSTUL PARDE Escalation Requestor: Name & Sign	
APPROVAL NO. ...001... / CI / STE / SCA/.../ 2022			
Remark:			
I hereby certify that aircraft / component / part bearing this escalation has been inspected and safe for flight			
Date:	Preparation by:	Reviewed & Approved by:	Escalation II - Approved by
01 MAR 2022	 Istiono Technical Manager	 Yanuar Abdul Fatah Chief Inspector	 PAI / DGCA Inspector
ESCALATION CLOSING - Close / Accomplishment Date : 08 MARCH 2022 - At Aircraft Total Time : 1601:07 / 2463 - Short Brief / Explanation of Closure : INSPECTION DOCUMENT 12 & ADD TASK @ 1600 FH PERFORMED.		 DENISA PRATIWA (Name & Sign)	

Rev. 00, August 2020