



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 06 & Add. Task	No.	WO/057-SNH/VIII/2022
	Date	31 August 2022
	A/C Reg.	PK-SNH C208B-5587
Reference : MP C208B REV. 12	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Document 06 & Add Task due at 2600 Hours. 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work :		
Compliance Statement Carried out	Sign & Date Company Lic. No.: SCA 27 05 / 2022 Sept (Engineer In Charge)	Signature (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED		JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED	
31 August 2022		WO/057-SNH/VIII/2022	Insp. Doc.06 & Add Task	05 Sept 2022	
A/C Type		Mfg. Serial Number		A/C Registration	
C208B		C208B-5587		PK-SNH	
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0662	2594:03 / 3957		
	#2	-			
Propeller/Rotor	#1	190837	2594:03 / 3957		
	#2	-			
Landing Gear	NLG		2594:03 / 3957		
	LH MLG				
	RH MLG				
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	-			
2	Inspection Card	1	✓		
3	Work Order	1	✓		
4	Summary Inspection List	1	✓		
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1	✓		
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
<u>IC-001</u>	D121001	BRAKE DISC LH SIDE OUT OF LIMIT.		✓	<i>Deniff</i> 
<u>IC-002</u>	D121001	BRAKE LINING LH SIDE AT BACK PLATE OUT OF LIMIT.		✓	<i>Deniff</i> 
<u>IC-003</u>	D121001	BRAKE LINING RH SIDE AT BACK & PRESSURE PLATE OUT OF LIMIT		✓	<i>Deniff</i> 
<u>IC-004</u>	D121001	FOUND LEAKING ON BRAKE CALIPER RH SIDE AT PISTON BRAKE NO 1, 2, 3, 4		✓	<i>Deniff</i> 
<u>IC-005</u>					
<u>IC-006</u>					


<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager


.....
Dwi M.


.....
Dodit


.....
Yanuar


.....
Istiono



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE SCHEDULED MAINTENANCE INSPECTION (CRS-SMI)

A/C TYPE : CESSNA	TTSN : 2594:03
A/C REG C208B : PK-SNH	TCSN : 3957
MSN : C208B-5587	DATE : 05 SEPT 2022


TYPE OF INSPECTION : INSPECTION DOCUMENT 06 & ADD TASK
DUE AT : 2600 HOURS
REF : MP C208B REV. 12

EXCEPTION

NO EXCEPTION

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
WATTYONO	AIRFRAME & POWER PLANT	5702/5A27		05 / 2022
	EIRA			SEPT

THE NEXT DUE TYPE OF INSPECTION : 100 hrs
DUE AT : 2700hrs.

Form: SCA/MTC/049

MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix B03 – PT6A-140 Engine Run Performance Sheet

Reg. Mark : PK - SNH WO/FML No. : WO/057-SNH/VIII/2022

PRE – INSPECTION	
Location	
Date	
Cycle	
Filed Barometric	
OAT	
Altitude	

POST – INSPECTION	
Location	Nbx
Date	05 Sept 2022
Cycle	1
Filed Barometric	2992 hftg
OAT	32°C
Altitude	70 ft

PRE – INSPECTION		
	Target	Actual
Tq		
Np		
ITT	°C	°C
Ng	%	%
Wf		
Oil Press		°C
Oil Temp		°C
Start Temp		°C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1890
ITT	841 °C	827 °C
Ng	102.7 %	100.5 %
Wf	578	542
Oil Press		90 °C
Oil Temp		67 °C
Start Temp		715 °C

Engine Run Up Checks							
Inertial	☒	EPL	☒	OVG	☒	Stby Alt	☒
BOV	☒	Brake	☒	Randomn	☒		

NOTE:

1. Brake system at Torque 2000 ft-lbs.
2. Inertial Separator at Torque 400 ft-lbs.
3. EPL check can't exceed 4% Ng per second.
4. Standby Alt at 80% Ng.
5. Low idle at 55.5 - 57% 40Amps.
6. High idle at 64 - 66% Ng 40Amps

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

6009.

PERFORMED BY			
Name	Sign & Stamp	Date	Location
Wahyono		05/09/2022	NBX

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06

Reg. Mark : PK - SNH



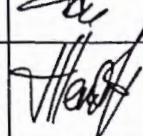
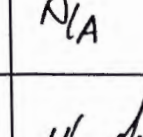
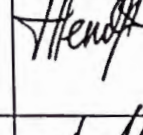
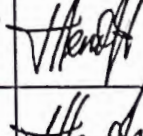
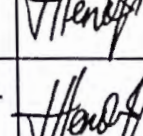
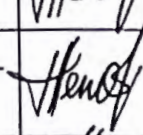
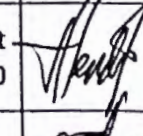
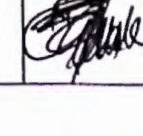
Date : 05 SEPT 22

MSN : C208B-5587

Station : XIABIRE




TSN / CSN : 2594:03/3957




WO No. WO/057-SNH/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 12 – Inspection Document 06



ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
	ENGINEER		5583
	ENGINEER		9657

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 

Signature :  Place/Date :  105 SEPT 22



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

Reg. Mark : PK-SNH

Date : 05 Sept 2022

MSN : C208B-5587

Station : NBX

TSN / CSN : 5794-03 / 3957



WO No. : WO/057-SNH/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to-fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235-3A</u> P/N ON: <u>AN 6235-3A</u>		

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731006	130	Do a check of the drain valve for installation and leaks		
		NOTE: There is no need to remove the drain valve if there is no leaks.		
F731007	130	Do a check of the flow divider for installation and leaks.		
F731008	130	Do a visual inspection of the P3 filter and drain valve.		
F731015	130	Do a visual inspection of Fuel Pump outlet filter.		
		(CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235-3A</u> P/N ON: <u>AN 6235-3A</u>		
F731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
F732001	130	Do a check of the FCU for installation, linkages and pneumatic tubes.		
F792000	130	Inspect and clean oil filter for debris.		

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
	ENGINEER		9602
Wahyono	Engineer		5702

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : WAHYONO Stamp : 
Signature :  Place/Date : Nlx, 05 Sept 2022

MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 52 – Engine PT6A-140 200 Hours Inspection

Reg. Mark : PK - SNH

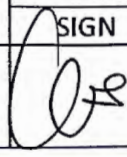
MSN : C208B-5587


TSN / CSN : 5794-03 / 3957

Date : 05 Sept 2022

Station : NBX

WO No. : WO/057-SNH/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				


PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Wahyono	Engineer		5792

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : WAHYONO

Stamp : 

Signature : 

Place/Date : NBX, 05 Sept 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection

Reg. Mark : PK - SNH

MSN : C208B-5587


TSN / CSN : 5794-03/3957

Date : 05 Sept 2022

Station : N6X

WO No. : WO/057-SNH/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A- 140 200 Hours or 6 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Wahyono	Engineer		5792

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : WAHYONO

Stamp :



Signature :



Place/Date :

N6X, 05 Sept 2022



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

**PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023**

DATE : 05 Sept 2022	A/C REG : PK-SNH
A/C TYPE : C208B EX	CHECKER : W. H. Jono SIGN :

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	19092030093	JAN 2029	Good
2	Co-Pilot Life Vest	P01202-201	19080030081	JAN 2029	Good
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	FL220-PAKFAA	1249-1450	Sept 2022	Good
14	Crash Axe Installed	LOCAL	NSN	ON COND.	Good
15	Fire Extinguisher	FIREX C352	F95366618	NOV 2022	Good
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					
	FLASH LIGHT	LOCAL	NSN	ON COND.	Good.



Parts Used Sheet

WO# Nr: WO/057-SNH/VIII/2022

[illegible]



Additional Work Sheet
Inspection Doc. 06 & Add Task


Aircraft Registration: **PK-SNH**

WO# Nr: WO/057/ SNH/VIII/2022

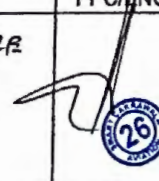
Parts Used Sheet



Part Used

[illegible]

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT				
1. CARD #		2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE				
1C - 001		WO/057-SNH/VIII/22		D121001	08 SEPT 2022				
6. A/C REG/MSN		7. A/C TYPE	8. TRADE	12. VENDOR ORDER #					
PK - SNH		C208B ER	AIRFRAME						
9. ZONE		10. STA	11. MTC TYPE						
LANDING GEAR		NABIRE	REPLACEMENT						
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20					14	15			
					PPC/ENG	DATE			
BRAKE DISC LH SIDE OUT OF LIMIT.					 	08/08/22			
16. CORRECTIVE ACTION				17	18	19			
				MECH	ENG./JC	DATE			
REPLACED BRAKE DISC WITH NEW PART, REF AMCA CH 32-40-00 Performed at A/C TT : A/C TC /LDG :				 	08/08/2022				
20. CORROSION INFORMATION									
LOCATION			CAUSE OF DAMAGE						
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other						
21. If the defect is RII, Please Sign this card finally by RII Inspector					INSP	DATE			
NOTICE OF INSPECTOR									
22. PARTS REQUIRED									
PART DESCRIPTION		PART NO		QTY		SERIAL NO		STATUS	
						ON OFF		CLOSE OPEN	
BRAKE DISC		06A-22201						✓	
23. TOOLS REQUIRED									
DESCRIPTION		PART NO. / MODEL		NEXT CALIBRATION DATE		STATUS			
GENERAL TOOLS		-		N/C		Good			

		INSPECTION CARD (Form: SCA/MTC/048)			TECHNICAL DEPARTMENT						
1. CARD #		2. JO/WO #		3. ORIGINATOR		4. CARD REF		5. DATE			
1C-002		WO/057-SNA/VIII/22						08 SEP 2022			
6. A/C REG/MSN		7. A/C TYPE		8. TRADE		12. VENDOR ORDER #					
PK-SN 14		R208B-EX		AIRFRAME							
9. ZONE		10. STA		11. MTC TYPE							
LANDING GEAR		NABIRE		REPLACEMENT							
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20								14		15	
								PPC/ENG		DATE	
BRAKE LINING LH SIDE AT BACK PLATE OUT OF LIMIT								 		05/08/22	
16. CORRECTIVE ACTION						17		18		19	
						MECH		ENG. LIC		DATE	
REPLACED LINING WITH NEW PARTS REF ATATA CH 32-40-00 Performed at A/C TT : A/C TC /LDG :						 		05/08/22			
20. CORROSION INFORMATION											
LOCATION				CAUSE OF DAMAGE							
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others				☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other							
21. If the defect is RII, Please Sign this card finally by RII Inspector								INSP		DATE	
NOTICE OF INSPECTOR											
22. PARTS REQUIRED											
PART DESCRIPTION		PART NO		QTY		SERIAL NO		STATUS			
						ON	OFF	CLOSE	OPEN		
BRAKE LINING		066-18300		4ea		-	-	✓			
23. TOOLS REQUIRED											
DESCRIPTION		PART NO. / MODEL		NEXT CALIBRATION DATE		STATUS					
GENERAL TOOLS		-		O/C		Good					

		INSPECTION CARD (Form: SCA/MTC/048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE		
LC-003	W0/057-SNA/VIII/2022		D121001	08 SEP 2022		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNA	C2088 EN	ADAPTOR				
9. ZONE	10. STA	11. MTC TYPE				
LANDING GRN	NABIRE	REPLACEMENT				
13. DESCRIPTION/DEFECT-IF FINDING OF CPCR INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
RH SIDE LINING AT BACK PLATE AND PRESSURE PLATE WORN OUT OF LIMIT				  08/08/2022		
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
BRAKE LINING RH SIDE AT BACK & PRESSURE PLATE OUT OF LIMIT REPLACED WITH NEW LINING REF AMM CH 32-40-00 Performed at A/C TT : A/C TC/LDG :			  08/08/2022			
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP		DATE
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BRAKE LINING	066-15300	8ea	☒	☐	☒	☐
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		
GENERAL TOOLS	-	etc		Good		

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT		
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
1C-004	WO/057-SNH/VIII/2022		D121001	05/SEP/2022		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNH	C208B EN	ALP FPMR				
9. ZONE	10. STA	11. MTC TYPE				
LANDING GEAR	NABIRE	REPLACEMENT				
13. DESCRIPTION/DEFECT-IF FINDING OF CPCA INSPECTION, PLEASE COMPLETE SET. 20			14. PPC/ENG	15. DATE		
FOUND LEAKING ON BRAKE CALIPER RH SIDE AT PISTON BRAKE NO. 1, 2, 3				05/08/2022		
16. CORRECTIVE ACTION			17. MECH	18. ENG, LIC	19. DATE	
REPLACED O-RING PISTON BRAKE, AND BLEEDING, CHECK FOUND SATISFY PER ATMM CH. 32-40-00					05/08/2022	
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment				
		☐ Internal Leakage				
CORROSION ☐ Isolated ☐ Widespread		☐ Chemical Spill				
CORROSION LVL ☐ 1 ☐ 2 ☐ 3		☐ LAV/Galley Spill				
PROPOSED ACTION ☐ Doublers		☐ Blocked Drain				
☐ Others		☐ Wet Insulation Blanket				
		☐ Other				
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE	
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	MS20775-224	4ea	-	-	☒	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
General Tools	-	O/C	Good			