



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-Dec-21	REPLACEMENT	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
001	73		
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM FUEL NOZZLE REPLACEMENT			
REFERENCE	☒ AMM Ch. 73-10-05	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR

12. RESULT		MECH	ENG	INSP (*)
PERFORMED FUEL NOZZLE REPLACEMENT & DO FOR CLEANING & INSPECTED FOR THE SPRAY FOUND FUEL NOZZLE ASSY SPRAY TO SATIS NOT SPITTING BURRS & SCRATCH REF. AMM CHAP 73.10.05 Performed at A/C TT : 409:00 A/C TC /LDG : 464 CYC				
FINDING	☐ Y	☒ N	ACT MHR : DATE/TIME (DD/MM/YY)	
INSPECTION CARD (IC) #		12	01	2022

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-Dec-21	INSPECTION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
002	72		
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM BORESCOPE HOT SECTION INSPECTION			
REFERENCE	☒ EMM Ch. 72-00-00	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR

12. RESULT		MECH	ENG	INSP (*)
8 PERFORMED BORESCOPE HOT SECTION INSPECTION FOUND SATIS Performed at A/C TT : 409:00 HOURS A/C TC /LDG : 435 CYC			 SCA 16	
FINDING	☐ Y ☒ N	ACT MHR : DATE/TIME (DD/MM/YY)		
INSPECTION CARD (IC) #		29	12	2021

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	CHECK FOR WEAR	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
003	24		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM CHECK FOR WEAR STARTER GENERATOR BRUSHES

REFERENCE	☒ AMM Ch. 24-31-11, Page block 601	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORM STARTGEN BRUSH CHECK FOUND 60% & REF TO PROJECTED BRUSH LIFE TABLE REMAINING BRUSH LIFE REMAINING ON TO 600 HOURS I.A.W 24-31-11

Performed at A/C TT : 409:00 H A/C TC /LDG : 464 CYC

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				11 02 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
9. ZONE	10. STA	11. MTC TYPE			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
Performed at A/C TT : A/C TC /LDG :			

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE				
	☐ Environment				
	☐ Internal Leakage				
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill				
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill				
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain				
☐ Others	☐ Wet Insulation Blanket				
	☐ Other				

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	CHECK OPERATION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
002	71		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM CHECK OPERATION OF PROPELLER OVERSPEED GOVERNOR

REFERENCE	☒ AMM Ch. 71-00-00	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED CHECK OPERATION OF PROPELLER
OVERSPEED GOVERNOR FOUND 1310 RPM STILL
WITHIN LIMIT REF AMM CHAP: 61-00-00

Performed at A/C TT : 404:00 Hours A/C TC/LDG : 404 CYC

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				12 01 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	CHECK OPERATION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
005	24		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM CHECK OPERATION TEST OF EMERGENCY BATTERY

REFERENCE	☒ AMM Ch. 24	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR

12. RESULT

PERFORMED CHECK & OPERATION TEST OF EMERGENCY BATTERY PUSH & HOLD STDBY POWER APPEAR GREEN LIGHT FOUND EMERGENCY BATT SATIS REF CHAP: 24-00-00

Performed at A/C TT : 9005:00 A/C TC /LDG : 464

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				11 01 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	VISUAL INSPECTION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
006	57		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM VISUAL INSPECTION OF LEFT & RIGHT WING-STRUT FITTING

REFERENCE	☒ AMM Ch. 57-00-02	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED VISUAL INSPECTION OF LEFT & RIGHT WING STRUT FITTING FOUND GOOD

Performed at A/C TT : 4109:00 A/C TC /LDG : 464

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				11 01 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	CHECK OPERATION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
007	28		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM CHECK OPERATION ENGINE DRIVEN FUEL PUMP - DRIVE SHAFT FOR BACKLASH

REFERENCE	☒ AMM Ch. 28-20-03	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR

12. RESULT

PERFORMED CHECK OPERATION ENGINE DRIVEN FUEL PUMP - DRIVE SHAFT FOR BACKLASH FOUND LEAK, REPLACED EDFP AND INSTALLED WITH A NEWLY OVERHAULED ONE. CHECK SATIS

Performed at A/C TT: 409:00 A/C TC/LDG: 464

FINDING	☒ Y	☐ N	ACT MHR:	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				10 01 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
ENGINE DRIVEN FUEL PUMP <Boost Pump>	R915300L1/M	1		

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	96212	Aug 2023	SERVICEABLE

SERVICEABLE TAG			
Part Number: RG15980L1/M		Description: BOOST PUMP	
Serial Number: D2657	Qty: 1 ea	☐ Rem 0230-4 ☒ DAAG From 21-04 ☐ Core	
Order Number: 207080	Receipt Date: 05 JAN 2022	☐ For Class I Product ☒ For Class II/III Product ☐ For Class II Product Only	
Recd. Date: 24 AUG 2021	Vendor / Approved Shop: PILATUS AIRCRAFT LTD	The Part Identified has been:	
TSN: N/A	Shelf Life Expiry Date: N/A	☐ Inspected only ☐ Repaired ☐ New ☒ Other	
Remarks:	TSD: N/A	CERTIFICATE OF RELEASE TO SERVICE I hereby certify that the work recorded above have been carried out in accordance with the requirements of the Indonesia Civil Aviation Safety Regulations applicable thereto and is airworthy.	
	Store Inspector: YANUAR		
	Main Store: JAKARTA		
Condition: NEW		Sign/Stamp:  Authority: CHIEF INSPECTOR Date: 05 JAN 2022	
Form: SCA/MTC-022			



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	INSPECTION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
008	72		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM INSPECTION COMPRESSOR - EXAMINE FOR CORROSION AND EROSION

REFERENCE	☒ EMM Ch. 72-30-05	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR

12. RESULT

PERFORMED INSPECTION COMPRESSOR & EXAMINE
FOUND NO CORROSION AND EROSION

Performed at A/C TT : 409:20 Hours A/C TC /LDG : 435 cyc

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #			29	12 2021

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	INSPECTION	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
009	72		
9. ZONE	10. PANEL	-	

11. DESCRIPTION

PERFORM INSPECTION TURBINE - EXAMINE FOR CORROSION AND EROSION

REFERENCE	☒ EMM Ch. 72-30-05	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR

12. RESULT

PERFORM INSPECTION TURBINE & EXAMINE FOWARD
NO CORROSION AND EROSION

Performed at A/C TT : 409;00 Hours A/C TC /LDG : 485 CYC

FINDING		☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				24	12 21

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	FUNCTIONAL CHECK	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
010	74		
9. ZONE	10. PANEL	-	

11. DESCRIPTION

PERFORM FUNCTIONAL CHECK OF SPARK IGNITORS OR GLOW PLUGS

REFERENCE	☒ AMM Ch. 74-20-00	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

CHECKED FUNCTIONAL TEST ON SPARK
IGNITORS PLUGS FOUND GOOD

Performed at A/C TT : 409:00 H A/C TC /LDG : 464:CYC

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				12 01 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/006-SNB/XII/2021	22-DEC-2021	LUBRICATE	PK-SNB/1015
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
011	61		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM LUBRICATE OF PROPELLER HARTZELL

REFERENCE	☒ AMM Ch. 61-00-49	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED LUBRICATE OF PROPELLER HARTZELL
WITH MATERIAL NO. P04-016 < AEROSHELL GREASE 6 >

Performed at A/C TT : 409:00 A/C TC /LDG : 464

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				12 01 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1 CARD #	2 JO/WO #	3 ORIGINATOR	4 CARD REF	5 DATE	
6 A/C REG/MSN	7 A/C TYPE	8 TRADE	12. VENDOR ORDER #		
9 ZONE	10. STA	11. MTC TYPE			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
Performed at A/C TT : _____ A/C TC /LDG : _____			

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE ☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread					
CORROSION LVL ☐ 1 ☐ 2 ☐ 3					
PROPOSED ACTION ☐ Doublers ☐ Others					

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
9. ZONE	10. STA	11. MTC TYPE			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
Performed at A/C TT : A/C TC /LDG :			

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE ☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread					
CORROSION LVL ☐ 1 ☐ 2 ☐ 3					
PROPOSED ACTION ☐ Doublers ☐ Others					

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1 CARD #	2 JO/WO #	3 ORIGINATOR	4 CARD REF	5 DATE	
6 A/C REG/MSN	7 A/C TYPE	8 TRADE	12 VENDOR ORDER #		
9 ZONE	10 STA	11 MTC TYPE			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
Performed at A/C TT : _____ A/C TC /LDG : _____			

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE				
	☐ Environment				
	☐ Internal Leakage				
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill				
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill				
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain				
☐ Others	☐ Wet Insulation Blanket				
	☐ Other				
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE
NOTICE OF INSPECTOR					

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS



Aircraft Registration: **PK-SNB**



WO # N°:
WO/006-SNB/XII/2021

Additional Work Sheet

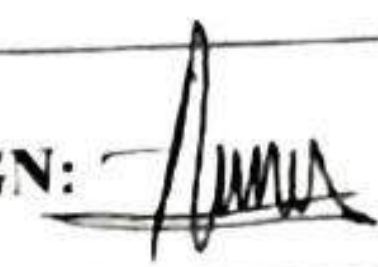
100 Hours / Annual Inspection

Parts Used Sheet

[illegible]

18

 smart aviation	EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR	PT. SMART CAKRAWALA AVIATION DEPARTMENT TEKNIK Form: SCA/MTC/023
--	--	---

DATE : 12/01-2022	A/C REG : PK-SNB
A/C TYPE : PC-6 / B2-H4	CHECKER : Aris Kurniawan SIGN: 

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01074-101	17071100038	JULY 2022	GOOD
2	Co-Pilot Life Vest	P01074-101	12062000066	JULY 2022	GOOD
3	Pax Life Vest	G3600-167	L634366	JUNE 2022	GOOD
4	Pax Life Vest	P0723-105P	L602240	AUG 2022	GOOD
5	Pax Life Vest	4223501	6097-004	AUG 2022	GOOD
6	Pax Life Vest	S41150-6400	11391-1640	AUG 2022	GOOD
7	Pax Life Vest	P0723-105P	L635755	AUG 2022	GOOD
8	Pax Life Vest	S61850-6301	44961-1670	AUG 2022	GOOD
9	Pax Life Vest	L33000-167	L671565	AUG 2022	GOOD
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	Firt Aid Kit	NCO.10E.A.14	L1811194	31 AUG 2023	GOOD
14	Crash Axe Installed	90383.71.112	NSN	0/E	GOOD
15	Fire Extinguisher	BAS1015R-5	118469	AUG 2022	GOOD
16	Life Raft (If Installed)	R0097-101	V08079	OCT 2022	GOOD
17	Survival Kit (If Installed)	G3026-101	177895	DEC 2025	GOOD
OTHERS					



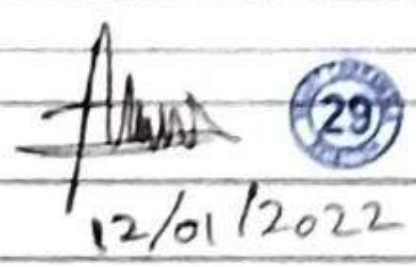
AIRCRAFT FLIGHT MAINTENANCE LOG

DATE: 12/01-2022	A/C REG: PK-SNB	MSN: 1015	TYPE: PC-6/B2-H4	PAGE: SNB-220112-012
------------------	-----------------	-----------	------------------	----------------------

CREWS		
CAPT:		
COPILOT:		
EOB:		
	PREFLIGHT	DAILY
TIME		
STATION		
LIC NO		
Sign & Stamp		
I hereby certify that the aircraft has been maintained law applicable manuals & CASR, and determined to be in airworthy condition and safe for flight		

Check In:		Check Out:		Duty Time:																															
ROUTE		BLOCK		T/O		LDG		FLT		LDG/CYCLE		FUEL		RECEIPT NO		ADDED																			
FROM	TO	OFF	ON	HRS	MIN			HRS	MIN			REM	UPLIFT	TOTAL		OIL	HYD																		
MAINTENANCE																																			
TTL BLOCK TIME						TTL FLT TIME & LDG																													

	A/F Total Hrs	Landing	Eng. #1 Hrs	Eng. #1 Cyc	Prop. #1 Hrs	Eng. #2 Hrs	Eng. #2 Cyc	Prop. #2 Hrs	Hours	Cycles
Brought Fwd	403.00	464	403.00	435	403.00					
This Page										
Total	403.00	464	403.00	435	403.00					
Metric										

No	DISCREPANCIES (Write NIL or A/C OK if Not Defect)	No	CORRECTIVE ACTION	Sign, Stamp & Date
1	100 HOURS / ANNUAL INSPECTION DUE	1	PERFORMED 100 HOURS / ANNUAL INSPECTION LAW PT.	 12/01/2022
	Capt. Signature		SMART CAIRAWALA AVIATION PC6/B2-H4 PIATUS PORTER	
			MP. PIATUS PC-6 RENO ALL TASK PERFORMED DEF TO	
			PC-6 AMMCHAP: 05-22-00 SCHEDULE, REPAIR SC WO/006/ SNB/X11/2021 FOL DETAIL	

No	COMPONENT CHANGE (Description)	POS	P/N On	P/N Off	S/N On	S/N Off	LIC NO. & SIGN
	SEE PART USED ON WO/006/SNB/X11/2021						

Appendix B-Form : SCA/MTC/013

ECTM Manual Entry (if required)	
Time	
Altitude	
IAS	
T/O/EPR	
T/T/LGT	
HQ/H2	
H2/H41	
F/F	
Oil Temp	
Oil Press	
OAT	
Last Compressor Wash C/O	
Date	12/01/2022
PERIODIC INSPECTION	
Last Insp C/O at	403.00
Type Of Insp	100 HRS
Next Inspection	
Type Insp	100 HRS
Due at	500 HRS