



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 08 & Add Task Due at 1200 Hours.	No.	WO/021-SNW/X/2021
	Date	21-Oct-2021
	A/C Reg.	PK-SNW C208B-5579
Reference : MP C208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM

To : Engineer In Charge

Description :





1. Perform Inspection Document 08 & Add Task Due at 1200 Hours.
2. Make an entry in Maintenance Log.
3. Return the Completed Work Order and Form to PPC.

#If any finding, please close the routine card, and transferred to inspection card.

Additional Work :

Compliance Statement	Sign & Date Company Lic. No.: SCA-03 01 NOV 2021 SANDUPASA H. (Engineer In Charge)	Signature (Technical Manager)
----------------------	--	--

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
21-Oct-2021	WO/021-SNW/X/2021	Inspection Doc. 08 & Add Task	01 NOV 2021		
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5587	PK-SNW		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0651	1198:01 / 1798		
	#2	-			
Propeller/Rotor	#1	190815	1198:01 / 1798		
	#2	-			
Landing Gear	NLG		1198:01 / 1798		
	LH MLG		1198:01 / 1798		
	RH MLG		1198:01 / 1798		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	-			
2	Inspection Card	1			
3	Work Order	1			
4	Summary Inspection List	1			
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1			
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
<u>IC-001</u>	D121001	FOUND RH BRAKE SHIM DAMAGE		✓	Danijar Pransa  
<u>IC-002</u>	D121001	FOUND LEAKING AT RH BRAKE PISTON NO. #3 & #4		✓	Danijar Pransa  
<u>IC-003</u>	D121001	INSULATOR AT RH BRAKE PISTON WORN OUT		✓	Danijar Pransa  
<u>IC-004</u>	A322001	FOUND DAMAGE AT BEARING NOSE GEAR SPRING FORK		✓	Danijar Pransa  
<u>IC-005</u>	D121001	RH BRAKE LINING AT BACK PLATE OUT OF LIMIT		✓	Danijar Pransa  
<u>IC-006</u>					



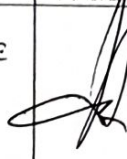
SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)


WO Ref: WO/021-SNW/X/2021

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	29 OCT - 01 NOV 2021	29 OCT &	Sampurna	
2	CHAPTER 12	INSPECTION DOCUMENT 06	29 OCT - 01 NOV 2021		Sampurna	
3	CHAPTER 13	INSPECTION DOCUMENT 07	29 OCT - 01 NOV 2021		Sampurna	
4	CHAPTER 14	INSPECTION DOCUMENT 08	29 OCT - 01 NOV 2021		Sampurna	
5	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	29 OCT - 01 NOV 2021		Sampurna	
6	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	30 OCT 2021		Sampurna	
7	CHAPTER 53	ENGINE PT6A-140 200 HOURS/ 6 MONTHS INSPECTION	31 OCT 2021		Sampurna	
8	CHAPTER 54	ENGINE PT6A-140 400 HOUR INSPECTION	29 OCT - 01 NOV 2021		Sampurna	
9	CHAPTER 55	ENGINE PT6A-140 600 HOUR INSPECTION	31 OCT 2021		Sampurna	
10	NRC-001	REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD	31 OCT 2021		Sampurna	
11	NRC-002	REPLACE VACUUM RELIEF VALVE FILTER DISCARD	31 OCT 2021		Sampurna	
12	SCA/MTC/ 023	EMERGENCY EQUIPMENT CHECK	01 NOV 2021		Sampurna	

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 001	W0/021-SNW/X/2001			29 OCT 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK - SNW	C2038 EX				
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR.					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
FOUND A/C BRAKE SHIM DAMAGE AND NEED TO BE REPLACE	 	29/10/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED WITH A NEW BRAKE SHIM. Performed at A/C TT : 1198: 01 A/C TC /LDG : 1799		 	29/10/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
SHIM BACK PLATE	068-02800	1EA	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	-	O/C	GOOD

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-002	W0/021-SNW/X/2021			29 OCT 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNW	C208 B EX				
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
FOUND LEAKING AT RA BRAKE PISTON NO. 43 & 47		29/10/2021

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED WITH ANEW ORING BRAKE PISTON. Performed at A/C TT : 1198:01 A/C TC /LDG : 1798		 	29/10/2021

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE				
	☐ Environment				
	☐ Internal Leakage				
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill				
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill				
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain				
☐ Others	☐ Wet Insulation Blanket				
	☐ Other				

21. If the defect is RII, Please Sign this card finally by RII Inspector			INSP	DATE
NOTICE OF INSPECTOR				

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
ORING.	MS28775-224	1cc	-	-	✓	-

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	o/c	Good.

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-003	WO/021-SNW/X/2024			29 OCT 2024	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PE-SNW	C208B-FX				
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
INSULATOR AT RA & LH SIDE BRAKE PISTON WORN OUT AND NEED TO BE REPLACE	 	29/10/2024

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED WITH A NEW INSULATOR. Performed at A/C TT: 1198:01 A/C TC /LDG: 1794	 		29/10/2024

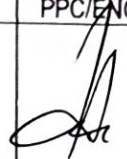
20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
INSULATOR	088-00100	8ea	—	—	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	—	o/c	Good

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-009	NO/021-SNW/x/1021			29 OCT 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
1C-SNW	C208B-EX				
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
FOUND DAMAGE AT BEARING NOSE GEAR SPRING FORK		29/10/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED BEARING NOSE GEAR SPRING FORK WITH NEW PARTS. Performed at A/C TT: 1098:01 A/C TC /LDG: 1798		 	29/10/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BEARING	MS24462-5	2eq	-	-	☒	☐

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	-	O/C	Good



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-005	U30/021 - SNW/x/2021			29 OCTOBER 2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNW/5587	C208B EX			
9. ZONE	10. STA	11. MTC TYPE		
LANDING GEAR				

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
PH BRAKE LINING AT BACK PLATE OUT OF LIMIT.		29/10/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG/LIC	DATE
REPLACED BRAKE LINING WITH NEW		 #12607	29/10/2021
Performed at A/C TT : 1198:01 A/C TC/LDG : 1798.			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
.....	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING.	066-15300	4ea	-	-	☒	-
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		
General tool	-	o/c		☒		



MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix B03 – PT6A-140 Engine Run Performance Sheet

Reg. Mark : PK - SNW

WO/FML No. : WO/021-SNW/X/2021

PRE – INSPECTION	
Location	NBX
Date	29 OCT 2021
Cycle	1798
Filed Barometric	1010 HPA
OAT	30 °C
Altitude	60 ft

POST – INSPECTION	
Location	NBX
Date	01 NOV 2021
Cycle	1798
Filed Barometric	1010 HPA
OAT	29 °C
Altitude	60 ft

PRE – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	841 °C	816 °C
Ng	102.7 %	100.9 %
Wf	578	547
Oil Press		91 °C
Oil Temp		69 °C
Start Temp		730 °C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	839 °C	811 °C
Ng	102.7 %	100.4 %
Wf	578	532
Oil Press		90 °C
Oil Temp		75 °C
Start Temp		696 °C

Engine Run Up Checks													
Inertial	☒	EPL	☒	OVG	☒	Stby Alt	☒	BOV	☒	Brake	☒	Randomn	☐
NOTE:													
1. Brake system at Torque 2000 ft-lbs.				3. EPL check can't exceed 4% Ng per second.				5. Low idle at 55.5 - 57% 40Amps.					
2. Inertial Separator at Torque 400 ft-lbs.				4. Standby Alt at 80% Ng.				6. High idle at 64 - 66% Ng 40Amps					

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

PERFORMED BY			
Name	Sign & Stamp	Date	Location
Sampurna		01 NOV '21	NBX



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06



Reg. Mark : PK - SNW
MSN : 208B5579
TSN / CSN : 1198:01 / 1798




Date : 29 OCT - 01 NOV '21
Station : NBX
WO No. : WO/021-SNW/X/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220		
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06


ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
	ENGINEER		9689
Sampurna H	Engineer		4870
Piter A	Mechanic		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Sampurna H. Stamp : 

Signature :  Place/Date : Nbx / 01 NOV 2021



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07



Reg. Mark : PK- 5NW
MSN : 208B5579
TSN / CSN : 1198:01 / 1798





Date : 29 OCT - 01 NOV '21
Station : NBX
WO No. : WO/021-SNW/X/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610	N/A	
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720		
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221		

MAINTENANCE PROGRAM **CESSNA C208/C208B**


Chapter 13 – Inspection Document 07

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720		
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220		
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220		
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72		
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220	N/A	
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
	Engineer		9687
	Engineer		4870
Peter A.	Mechanic		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 





Signature :  Place/Date : NBx / 01 NOV 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 14 – Inspection Document 08


Reg. Mark : PK - C₁NW Date : 29 OCT - 01 NOV '21
MSN : 20865579 Station : NBX
TSN / CSN : 1198:01 / 1798 WO No. : WO/021-9NW/X/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-720		
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
	ENGINEER		9687
	Engineer		9870
	Mechanic		-

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 
Signature :  Place/Date : NBX / 01 NOV 2021