



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 06 & Add Task Due at 1400 Hours.	No.	WO/027-SNW/XII/2021
	Date	15-Dec-2021
	A/C Reg.	PK-SNW C208B-5579
Reference : MP C208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Document 06 & Add Task Due at 1400 Hours. 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work : - Ref. TO INSPECTION CARD (IC) WORK ^{FOR} ADDITIONAL.		
Compliance Statement	Sign & Date Company Lic. No.:  (Engineer In Charge)	Signature (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
15-Dec-2021	WO/027-SNW/XII/2021	Inspection Doc. 06 & Add Task	25-DEC-2021		
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5579	PK-SNW		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0651	2124 / 2124		
	#2	-			
Propeller/Rotor	#1	190815	1396:06 / 1396:06		
	#2	-			
Landing Gear	NLG		2124		
	LH MLG		2124		
	RH MLG		2124		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	-			
2	Inspection Card	1	✓		
3	Work Order	1	✓		
4	Summary Inspection List	1	✓		
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1	✓		
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
IC-001	C122101	L/H TIRE MLG DEPTH OUT		✓	Budi Hantoro
IC-002	D121001	L/H BRAKE LINING OUTBOARD WORK OUT LIMIT		✓	Budi Hantoro
IC-003	D121001	R/H BRAKE LINING INBOARD AND OUTBOARD WORK OUT LIMIT		✓	Budi Hantoro
IC-004	D121001	R/H SHIM BRAKE WORK		✓	Budi Hantoro
IC-005					
IC-006					

<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager



SUMMARY INSPECTION ITEMS
(Form: SCA/MTC/050)

WO Ref: WO/027-SNW/XII/2021

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	24/12/2021	0.5 MHR	HENDRO	
2	CHAPTER 12	INSPECTION DOCUMENT 06	24/12/2021	12 MHR	Budi HENDRO	
3	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	25/12/21	3 MHR	DEMI SOBACI	
4	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	25/12/21	1 MHR	HENDRO	
5	CHAPTER 53	ENGINE PT6A-140 200 HOURS/ 6 MONTHS INSPECTION	25/12/21	1 MHR	HENDRO	
6	SCA/MTC/023	EMERGENCY EQUIPMENT CHECK	25/12/21	0.5 MHR	HENDRO	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION
(CRS-SMI)

A/C TYPE : CESSNA 208B
A/C REG : PK-SNW
MSN : C208B-5579

TTSN : 1396 : 06
TCSN : 2124
DATE : 25 DEC 2021


TYPE OF INSPECTION : INSPECTION DOC. 06 & ADD TASK
DUE AT : 1400 HOURS
REF : MP C208B REV. 10

EXCEPTION

- NO EXCEPTION -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
HENDRO. T	AIRFRAME & POWER PLANT	5583/28	 	25 DEC 2021
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS INSPECTION
DUE AT : 1500 HOURS

Form: SCA/MTC/049

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-081	027-SNW/X11/21	-	-	24 DEC 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNW	C208B	C208-5579			
9. ZONE	10. STA	11. MTC TYPE			
L/G	-	-			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
L/H TYRE MLG DEEP CUT		24/12/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
Replaced MAIN WHEEL TYRE JAW C208B AMM. 32-40-00 Performed at A/C TT: 1396:06 A/C TC/LDG: 212A			24/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
MAIN WHEEL TYRE	078-446-1	1	1196 T00159	1196 T00136	CLOSE	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	GOR 150	APR 2023	5AT.
MEASURA GAUGE	TTL	MAR 2022	5AT.

	INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-002	027-SNW/X11/2021	-	-	24/12/2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PC-SNW	C208B	C208+5579		
9. ZONE	10. STA	11. MTC TYPE		
L/G				

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
L/H BRAKE LINING OUT BOARD WITHIN OUT LIMIT		24/12/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REMOVED AND REPLACED BRAKE LINING OUTBOARD JAW C208B AMM. 32-40-00 Performed at A/C TT: 1396:06 A/C TC/LDG: 2124			24/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-15300	1	-	-	CLOSE	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
TORQUE WRENCH	000 150	APR 2023	SAT			

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	---------------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-003	027-SHW/X11/2021	-	-	DEC '20 21	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNW	C208B	C208-SS79			
9. ZONE	10. STA	11. MTC TYPE			
46					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCI INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
R/H BRAKE LINING INBOARD AND OUTBOARD WORN OUT LIMIT.		24/12/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REMOVED AND REPLACED BRAKE LINING INBOARD AND OUTBOARD LAW C208B AMM-32-40-00 Performed at A/C TT: 1396:06 A/C TC/LDG: 2124			24/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-15300	8	-	-	Closed	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	QDR 150	APR 2023	SAT.

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-004	027-SNEW/KT1/2021	-	-	24 DEC '2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
	C208B	C208-5579			
9. ZONE	10. STA	11. MTC TYPE			
L/G	-	-			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
R/H SHIM BRAKE WORN OUT		24/12/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED SHIM BRAKE WITH A NEW ONE DAW C208B AMM-32-20-90 Performed at A/C TT: B96:04 A/C TC/LDG: L129			24/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
SHIM		1	-	-	CLOSE	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS



MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix B03 – PT6A-140 Engine Run Performance Sheet

Reg. Mark : PK-SNW

WO/FML No. : WO/027-SNW/X11/2021

PRE – INSPECTION	
Location	TIMIKA
Date	24/12/21
Cycle	2124
Filed Barometric	1020
OAT	32°C
Altitude	120 ft

POST – INSPECTION	
Location	TIMIKA
Date	25/12/21
Cycle	2124
Filed Barometric	1020
OAT	34°
Altitude	120

PRE – INSPECTION		
	Target	Actual
Tq	2307	2397
Np	1900	1880
ITT	841 °C	822 °C
Ng	102.7%	100.8%
Wf	578	522
Oil Press		91 °C
Oil Temp		70 °C
Start Temp		69.5 °C

POST – INSPECTION		
	Target	Actual
Tq	2307	2397
Np	1900	1880
ITT	841 °C	831 °C
Ng	102.6%	101.1%
Wf	570	536
Oil Press		90 °C
Oil Temp		72 °C
Start Temp		68.5 °C

Engine Run Up Checks					
Inertial	☒	EPL	☒	OVG	☒
Stby Alt	☒	BOV	☒	Brake	☒
Randomn	☒				
NOTE: 1. Brake system at Torque 2000 ft-lbs. 3. EPL check can't exceed 4% Ng per second. 5. Low idle at 55.5 - 57% 40Amps. 2. Inertial Separator at Torque 400 ft-lbs. 4. Standby Alt at 80% Ng. 6. High idle at 64 - 66% Ng 40Amps					

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

ENGINE PERFORMANCE
RUN SATISFACTORY

PERFORMED BY

Name	Sign & Stamp	Date	Location
HENDRO		25/12/21	TIMIKA

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06

Reg. Mark : PK - SNW













Date : 24 / 12 / 2021

MSN : 208B-5549

Station : TIMIKA




TSN / CSN : 1396.06/2124





WO No. : WO 624-SNW/XII/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611		
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 12 – Inspection Document 06


ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
	ENGINEER		5583
PURDI HARDO	ENGINEER		9506
DEVI.S	ENGINEER		9632

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.













Name :  Stamp : 

Signature :  Place/Date : TIMIKA /25-DEC-21

MAINTENANCE PROGRAM CESSNA C208/C208B








Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection


Reg. Mark : PK-SNW Date : 25 / DEC / 2021
MSN : C20813-5579 Station : TITIKKA
TSN / CSN : 1396 : 06 WO No. : WO 1027-SNW/X11/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds.		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to- fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING / REPLACEMENT) P/N OFF: <u>AN6235-3A</u> P/N ON: <u>AN6235-3A</u>		

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731006	130	Do a check of the drain valve for installation and leaks		
F731007	130	Do a check of the flow divider for installation and leaks.		
F731008	130	Do a visual inspection of the P3 filter and drain valve		
F731015	130	Do a visual inspection of Fuel Pump outlet filter. (CLEANING/ REPLACEMENT) P/N OFF: <u>AN623T-3A</u> P/N ON: <u>AN623T-3A</u>		
F731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
F732001	130	Do a check of the FCU for installation, linkages and pneumatic tubes.		
F792000	130	Inspect and clean oil filter for debris.		
*** End of Engine PT6A-140 100 Hours Inspection Items ***				

PERSONNEL PRTPICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
DENI SOBACU	ENGINEER		9632

RETURN TO SERVICE

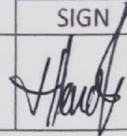
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.




Name : DENI SOBACU Stamp : 
Signature :  Place/Date : 7/11 25 DEC 21

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 52 – Engine PT6A-140 200 Hours Inspection


Reg. Mark : PK - SNW Date : 25 DEC 2021
 MSN : 208B-5549 Station : TIMIKA
 TSN / CSN : 1306:06 WO No. : WO/027-SNW/XII/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
			<u>5583</u>

RETURN TO SERVICE

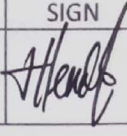
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.


Name :  Stamp : 
 Signature :  Place/Date : TIMIKA / 25-12-2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection



Reg. Mark : PK - SNW Date : 25 DEC 2021
MSN : 208B - 5579 Station : TIMIKA
TSN / CSN : 1396:06/2124 WO No. : WO/027-SNW/XI/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A- 140 200 Hours or 6 Months Inspection Items ***				

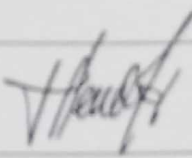
PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRO	ENGINEER		5583

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 
Signature :  Place/Date : TIMIKA / 25-DEC-21

	EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR	PT. SMART CAKRAWALA AVIATION DEPARTMENT TEKNIK Form: SCA/MTC/023
---	--	---

DATE : 25 DECEMBER 21	A/C REG : PK-SNN	
A/C TYPE : C208B-EX	CHECKER : HENDRO	SIGN: 

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	20080480025	DEC 2024	Satisfy
2	Co-Pilot Life Vest	P01202-201	20080480050	DEC 2024	Satisfy
3	Pax Life Vest	-	-	-	
4	Pax Life Vest	-	-		
5	Pax Life Vest	-	-		
6	Pax Life Vest	-	-		
7	Pax Life Vest	-	-		
8	Pax Life Vest	-	-		
9	Pax Life Vest	-	-		
10	Pax Life Vest	-	-		
11	Pax Life Vest	-	-		
12	Pax Life Vest	-	-		
13	First Aid Kit	FIRST AID KIT	0920-1690	SEPT 2022	Satisfy
14	Crash Axe Installed	LOCAL TOSITA	-	O.C	Satisfy
15	Fire Extinguisher	PIRETEX C 352	F-75060951	NOV 2022	Satisfy
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)	LSK-1-5	479287	NOV-2022	Satisfy
OTHERS					
18	FLASH LIGHT	LOCAL LIFE GEAR	-	-	Satisfy



1

Parts Used Sheet

WO# Nr.:[illegible]



2

WO# Nr:

Aircraft Registration:

Parts Used Sheet

[illegible]