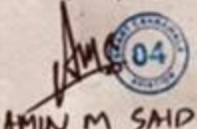
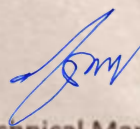







PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection 400 Hrs A/f & 100 Hrs Eng.	No.	WO/032-SNP/XII/2022
	Date	30 December 2022
	A/C Reg.	PK-SNP C208B-5495
Reference : MP C208B ISSUED 01	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection 400 Hrs A/F & 100 Hrs Eng. 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work : NIL		
Compliance Statement	Sign & Date 10-JAN-2023 Company Lic. No.: 8650  AMIN M SAID (Engineer In Charge)	Signature  (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
30 Dec 2022	WO/032-SNP/XII/2022	Inspection 400 Hrs A/F & 100 Hrs Eng.	10 JAN 2023		
A/C Type C208B		Mfg. Serial Number C208B-5495	A/C Registration PK-SNP		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0723	1305:35 / 2107		
	#2	-			
Propeller/Rotor	#1	181158	4385:53 / 1342:26		
	#2	-			
Landing Gear	NLG		4385:53 / 7372		
	LH MLG		4385:53 / 7372		
	RH MLG		4385:53 / 7372		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	2	01, 02		
2	Inspection Card	1			
3	Work Order	1			
4	Summary Inspection List	1			
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1			
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
IC-001	D121001	BRAKE LINING L/H SIDE WORN OUT		✓	DENI 
IC-002	D121001	BRAKE LINING R/H SIDE OUTER WORN OUT		✓	DENI 
IC-003	FINDING DEFECT	IGNITER L/H AND R/H SIDE OUT OF LIMITS		✓	DENI 
IC-004	D121001	BRAKE ONE R/H SIDE WORN OUT		✓	DENI 
IC-005					
IC-006					



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION (CRS-SMI)

A/C TYPE	: CESSNA 208B	TTSN	: 438512
A/C REG	: PK-SNP	TCSN	: 7374
MSN	: C208B-5495	DATE	: 10 JAN 2023


TYPE OF INSPECTION : INSPECTION 400 HRS A/F & 100 HRS ENG.
 DUE AT : 4391.50 HOURS
 REFF : MP C208B ISSUED 01

EXCEPTION

NIL

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
 Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
AMIN MOHAMMAD SAID	AIRFRAME & POWER PLANT	8690	 	10 JAN 2023
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS INSPECTION

DUE AT : 4491.50

Form: SCA/MTC/049



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/032-SNP/XII/2022	9 JAN 2023	REPLACEMENT COMPONENT	PK-SNP
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#01	37		RSBX.
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT P/N: D9-18-1 / C294502-0201			
REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
PERFORMED REPLACED AIR FILTER. REF TO. CH 37-10-00 96. Performed at A/C TT : 4384:53 A/C TC/LDG : 7372				
FINDING	☐ Y ☐ N	ACT MHR :		DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		09	01	2023

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT	D9-18-1 / C294502-0201	1		

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	-	-	Good



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/032-SNP/XII/2022	9 JAN 2023	REPLACEMENT COMPONENT	PK-SNP
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#02	37		NBX
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM VACUUM RELIEF VALVE FILTER REPLACEMENT
P/N: B3-5-1 / C482001-0202

REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR:

12. RESULT

PERFORMED VACUUM RELIEF VALVE.
FILTER REPLACEMENT

Performed at A/C TT: 4384:03 A/C TC/LDG: 7372

FINDING	☐ Y	☐ N	ACT MHR:	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				09 01 2023.

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT	B3-5-1 / C482001-0202	1		

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS			Good.



MAINTENANCE PROGRAM CESSNA 208/208B

Appendix B08 – PT6A-140 Engine Run Performance Sheet

Reg. Mark

: PK-9NP

WO/FML No. : WO/032-SNP/XII/2022

PRE – INSPECTION	
Location	NBX
Date	08-JAN-2023
Cycle	7374
Filed Barometric	1007 HPA
OAT	33
Altitude	SEA LEVEL

POST – INSPECTION	
Location	NBX
Date	10-JAN-2022
Cycle	7374
Filed Barometric	1007 HPA
OAT	35°C
Altitude	SEA LEVEL

PRE – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	841 °C	835 °C
Ng	102.7 %	102.5 %
Wf	578	532
Oil Press		91 °C
Oil Temp		74 °C
Start Temp		°C

POST- INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	841 °C	838 °C
Ng	102.6 %	101.3 %
Wf	565	538
Oil Press		70 °C
Oil Temp		76 °C
Start Temp		688 °C

Engine Run Up Checks					
Inertial ☒	EPL ☒	OVG ☒	Stby Alt ☒	BOV ☒	Brake ☒
NOTE: 1. Brake system at Torque 2000 ft-lbs. 2. Inertial Separator at Torque 400 ft-lbs. 3. EPL check can't exceed 4% Ng per second. 4. Standby Alt at 80% Ng. 5. Low idle at 55.5 - 57% 40Amps. 6. High idle at 64 - 66% Ng 40Amps					

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

- Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
- This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
- Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
- If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

ALL PERFORMANCE ON TARGET

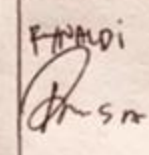
PERFORMED BY

Name	Sign & Stamp	Date	Location
AMIN MOHAMMAD SAID		10/JAN 2023	NBX

	INSPECTION CARD (Form: SCA/MTC/ 048)	TECHNICAL DEPARTMENT
---	--	---------------------------------

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
BIC-001	WO/032-2011/2022		D/21001	8 JAN 2023
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-52P C708B-540J	C208B	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
121	NABIRE	PART REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
BRAKE LINING. 4H SIDE WORN OUT	DENI	8 JAN 2023

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED BRAKE LINING WITH NEW PER. C708B CHAPTER 32-40-00. REV. 38. Performed at A/C TT : 4384:53 A/C TC/LDG : 1342:26	F. NADI 	DENI  	8 JAN 2023

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-03300	4	-	-	☒	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
TORQUE WRENCH	TA-0250	NOV 2023	GOOD			

	INSPECTION CARD (Form: SCA/MTC/ 048)	TECHNICAL DEPARTMENT
---	--	---------------------------------

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-003	401032-SNP/11/2022		FINDING DEFECT	9 JAN 2023
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNP C20813-549R	C208B	POWER PLANE		
9. ZONE	10. STA	11. MTC TYPE		
.	NBA	PART REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
IGNITER L/H AND R/H SIDE WORN OUT	DENT	9 JAN 2023

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED IGNITER WITH NEW REF. TO EMM CHAPTER 74-20-02.			
Performed at A/C TT: 4384-53 A/C TC /LDG: 7372			

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE				
	☐ Environment				
	☐ Internal Leakage				
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill				
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill				
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain				
☐ Others	☐ Wet Insulation Blanket				
	☐ Other				
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE
NOTICE OF INSPECTOR					

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
IGNITER	CH34055	2			☒	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
TOOLQUE WRENCH			GOOD			



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-004	W01032-01/X11/2022		FIN'D 12/001	8 JAN 2023.
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PR-001 C208.3-5495	C208B	AIRFRATE		
9. ZONE	10. STA	11. MTC TYPE		
D-121	NDA	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
BRAKE DISC R/H SIDE WORN OUT.	DENI	8 JAN 23

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED R/H SIDE BRAKE DISC WITH NEW REF TO: C208B CHAPTER 32-41.0.			8 JAN 23
Performed at A/C TT: 4384:53 A/C TC/LDG: 7372.			

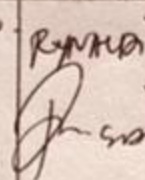
20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3			
PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector			
NOTICE OF INSPECTOR		INSP	DATE

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BRAKE DISC	164-22201	1			✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
TORQUE WRENCH			(GIVEN)			

	INSPECTION CARD (Form: SCA/MTC/ 048)	TECHNICAL DEPARTMENT
---	--	---------------------------------

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-002	401032-SWP/K11/2022		1712/001	8 JAN 2023
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PC-SWP C208B-5495	C208B	ARF PART		
9. ZONE	10. STA	11. MTC TYPE		
121	NABIRE	PART REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
BRAKE LINING RH SIDE BUTTER WORN OUT	DENI	8 JAN 23

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED BRAKE LINING WITH NEW REF TO C208B CHAPTER 32-40.00 Performed at A/C TT: 4384:53 A/C TC/LDG: 7372			8 JAN 23

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
☐ Other			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-03300	4			✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	TA-0250	NOV 2023	GOOD



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

**PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023**

DATE : 10-JAN-2023	A/C REG : PK-SNP	
A/C TYPE : C208B	CHECKER : Amin	SIGN :

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	PD1074-101W	170605 00064	JUN 2024	Good
2	Co-Pilot Life Vest	PD1074-101W	170711 00037	AUG 2023	Good
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	Firt Aid Kit	Local	NSN	DEC 2023	Good
14	Crash Axe Installed	Local	NSN	O/C	Good
15	Fire Extinguisher	C352	NSN	JAN 2024	Good
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					
	FLASH LIGHT	Local	NSN	O/C	Good



Additional Work Sheet
Inspection 400 Hrs A/F &
100 Hrs Eng.

Aircraft Registration:

PK-SNP

WO# Nr:

WO/032-SNP/XII/2022

Part Used

Parts Used Sheet

Date	Part Nr.	Serial Nr.	Description	Quantity	Engineer
8 JAN 2023	066-03300	-	GATE LINING	8 EA	DEM1
8 JAN 2023	CH34055	-	16NITE	2 EA	DEM1
8 JAN 2023	164-22201	-	OSC GATE	1 EA	DEM1
8 JAN 2023	B-3-5-1	-	FILTER	1 EA	DEM1
9 JAN 2023	AG-18-1	-	FILTER	1 EA	DEM1
9 JAN 2023	446235-3A	-	FILTER	2 EA	DEM1
9 JAN 2023	1725980-1-212	-	O-RING	1 EA	DEM1
9 JAN 2023	1725980-1-218	-	O-RING	1 EA	DEM1
9 JAN 2023	1725980-1-216	-	O-RING	1 EA	DEM1
9 JAN 2023	8783485-1-212	-	O-RING	1 EA	DEM1
9 JAN 2023	1783485-1-135	-	O-RING	1 EA	DEM1
9 JAN 2023	1783485-1-904	-	O-RING	1 EA	DEM1
9 JAN 2023	576202-224	-	O-RING	1 EA	DEM1
9 JAN 2023	576202-120	-	O-RING	1 EA	DEM1
9 JAN 2023	576202-011	-	O-RING	2 EA	DEM1
9 JAN 2023	576202-014	-	O-RING	1 EA	DEM1
9 JAN 2023	576202-015	-	O-RING	1 EA	DEM1
9 JAN 2023	576202-124	-	O-RING	1 EA	DEM1
9 JAN 2023	1755385-05	-	O-RING	1 EA	DEM1
9 JAN 2023	3010880	-	GATE	2 EA	DEM1
9 JAN 2023	17524645-362	-	GATE	2 EA	DEM1
9 JAN 2023	17524645-285	-	GATE	1 EA	DEM1
9 JAN 2023	17524645-132	-	GATE	1 EA	DEM1