




PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 08 & Add Task Due at 2000 Hours.	No.	WO/038-SNH/XII/2021
	Date	03-Mar-2021
	A/C Reg.	PK-SNH C208B-5587
Reference : MP C208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Document 08 & Add Task Due at 2000 Hours. 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work : - NIL -		
Compliance Statement CARRIED OUT	Sign & Date Company Lic. No.:  20-12-2021 RIZAL G. (Engineer In Charge)	Signature (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
10-Dec-2021	WO/038-SNH/XII/2021	Inspection Doc. 08 & Add Task	20 DEC 2021		
A/C type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5587	PK-SNH		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0662	1996:08/2891		
	#2	-			
Propeller/Rotor	#1	190837	1996:08/2891		
	#2	-			
Landing Gear	NLG		1996:08/2891		
	LH MLG		1996:08/2891		
	RH MLG		1996:08/2891		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	2	#001; #002		
2	Inspection Card	1			
3	Work Order	1			
4	Summary Inspection List	1			
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1			
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
IC-001	32-40-00	REPLACED LH MAIN TIRE DUE DEEP CUT		✓	RIDZALIG AM
IC-002	D121 001	REPLACED RH BRAKE LINING DUE WORN OUT		✓	RIDZALIG AM
IC-003	32-40-00	REPLACED NOSE TIRE DUE OUT OF LIMITS		✓	RIDZALIG AM
IC-004	32-40-00	LH BEARING WHEEL HUB NEED TO REPLACE		✓	RIDZALIG AM
IC-005	32-20-00	BEARING FORK NEED TO REPLACE		✓	RIDZALIG AM
IC-006	32-20-00	BOLT MPI NEED TO REPLACE		✓	RIDZALIG AM

IC-007	32-40-00	LH INNER TUBE NEED TO REPLACE		✓	REPLACE Hul
IC-008					
IC-009					
IC-010					
IC-011					
IC-012					
IC-013					
IC-014					
IC-015					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager



SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/038-SNH/XII/2021

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	20/12/2021		PIDZAL.G	
2	CHAPTER 12	INSPECTION DOCUMENT 06	20/12/2021		PIDZAL.G	
3	CHAPTER 13	INSPECTION DOCUMENT 07	20/12/2021		PIDZAL.G	
4	CHAPTER 14	INSPECTION DOCUMENT 08	18/12/21		Arja P	
5	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	20/12/2021		PIDZAL.G	
6	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	20/12/21		Arja P.	
7	CHAPTER 53	ENGINE PT6A-140 200 HOUR / 6 MONTHS INSPECTION	17/12/2021		PIDZAL.G	
8	CHAPTER 54	ENGINE PT6A-140 400 HOURS INSPECTION	20/12/2021		PIDZAL.G	
9	CHAPTER 56	ENGINE PT6A-140 1000 HOURS INSPECTION	17/12/2021		PIDZAL.G	
10	NRC-001	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT (AAD9-18-1)	19/12/2021		PIDZAL.G	
11	NRC-002	VACUUM RELIEF VALVE FILTER REPLACEMENT (B3-5-1)	19/12/2021		PIDZAL.G	
12	SCA/MTC/023	EMERGENCY EQUIPMENT CHECK	20/12/2021		PIDZAL.G	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE
SCHEDULED MAINTENANCE INSPECTION
(CRS-SMI)

A/C TYPE : CESSNA 208B
A/C REG : PK-SNH
MSN : C208B-5587

TTSN : 1996-08
TCSN : 7891
DATE : 17 DEC 2021

TYPE OF INSPECTION : INSPECTION DOCUMENT 08 & ADD TASK
DUE AT : 2000 HOURS
REF : MP C208B Rev. 10

EXCEPTION

— NO EXCEPTION —

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
RIDZAL GHAZALI	AIRFRAME & POWER PLANT	9694 SCA021	 	20/12/2021
—	EIRA	—	—	17

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS

DUE AT : 2100 HOURS

Form: SCA/MTC/049

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-001	WO/038-SNH/XII/2021		3940-00	18-12-2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNH/C208-5587	C208B EX				
9. ZONE	10. STA	11. MTC TYPE			
MLG	NBX				

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
L/H MAIN TIRE FOUND DEEP CUT	 	18/2021 12

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED L/H MAIN TIRE WITH THE NEW ONE		 	18/2021 12
Performed at A/C TT : 1996:08 A/C TC /LDG : 2891			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
MAIN TIRE 29x11.0-10	078-446-1	1	1196T00150	1197T00143	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
IC-002	W0/038-SNH / ^{XII} 2021		D121001	18-12-2021		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNH/C2080-558	C2080-EX					
9. ZONE	10. STA	11. MTC TYPE				
ML6	NBX					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET: 20	14	15
	PPC/ENG	DATE
R/H IN BOARD BRAKE LINING FOUND WORN OUT	 	18/12/2021

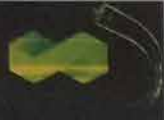
16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED R/H INBOARD BRAKE LINING WITH THE NEW ONE Performed at A/C TT : 1996:08 A/C TC /LDG : 2891		 	18/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-15300	4	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/048)		TECHNICAL DEPARTMENT	
---	--	---	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-003	WO/D38-SNH/XII/2021		32-40-00	18-12-2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PR-SNH/C208B-5587	C208B EX				
9. ZONE	10. STA	11. MTC TYPE			
XLG	N3X				

13. DESCRIPTION/DEFECT-IF FINDING OF CPGP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
NOSE TIRE FOUND OUT OF LIMITS	 	18/12/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED NOSE TIRE ASSY WITH THE NEW ONE Performed at A/C TT: 1996:08 A/C TC/LDG: 2891		 	18/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
NOSE TIRE 22x80-8	228 K61 -1	1	0096970829005	71972371	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO./ MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-004	WO/D38-SNH/X11/2021		32-40-00	18-12-2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNH/C208B-5587	C208B-EX				
9. ZONE	10. STA	11. MTC TYPE			
ML5	N3X				

13. DESCRIPTION/DEFECT-IF FINDING OF CPGP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
L/H MAIN WHEEL BEARING HUB NEED TO REPLACE	 	18/12/2021

18. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED L/H MAIN WHEEL BEARING HUB WITH THE NEW ONE Performed at A/C TT : 1996:08 A/C TC/LDG : 2891	 		18/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BEARING CONE	214-01400	1	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-005	WO/038-SNH / ^{X11} / ₂₀₂₁		32-20-00	18-12-2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PR-SNH / C 208 B -5587	C 208 B EX				
9. ZONE	10. STA	11. MTC TYPE			
NLG	N13X				

13. DESCRIPTION/DEFECT-IF FINDING OF GPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
BEARING FORK NEED TO REPLACED	 	18/12/2021 

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED FORK BEARING WITH THE NEW ONE		 	18/12/2021 
Performed at A/C TT : 1996:08 A/C TC /LDG : 2891			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
	☐ Chemical Spill		
CORROSION ☐ Isolated ☐ Widespread	☐ LAV/Galley Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ Blocked Drain		
PROPOSED ACTION ☐ Doublers	☐ Wet Insulation Blanket		
☐ Others	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BEARING	MS24462-5	2	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
IC - 006	WO / 078-SNH/X11/2011		32-20-00	18-12-2021		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PR-SNH / C208B -5587	C208B-EX					
9. ZONE	10. STA	11. MTC TYPE				
NCG	MTX					
13. DESCRIPTION/DEFECT-IF FINDING OF CPOI INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
MPI BOLT NEED TO REPLACE				 	18/12/2021	
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
REPLACED MPI BOLT WITH THE NEW ONE Performed at A/C TT : 1996:08 A/C TC /LDG : 2891				 	18/12/2021	
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE	
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO.	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
MPI BOLT	\$ 3461-88	2	-	-	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	---------------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-007	WO/030-SNH/ X11/2021		32-40-00	18-12-2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNH	C200B				
9. ZONE	10. STA	11. MTC TYPE			
MLG	MTX				

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
LH MAIN INNER TUBE NEEDS TO REPLACE	 	18/12/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACE LH MAIN INNER TUBE WITH THE NEW ONE Performed at A/C TT: 1916:00 A/C TC/LDG: 2091		 	18/12/2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
INNER TUBE	097 534-0	1	✓	✓	✓	
	62291503					

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS



MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix B03 – PT6A-140 Engine Run Performance Sheet

Reg. Mark

: PK - SNM

WO/FML No. : W0638-SNM/11/2021

PRE - INSPECTION	
Location	<u>NABIRE</u>
Date	<u>16 DEC 2021</u>
Cycle	
Filed Barometric	<u>29.92 IN HG</u>
OAT	<u>34°C</u>
Altitude	<u>60 FT</u>

POST - INSPECTION	
Location	<u>NABIRE</u>
Date	<u>20 Dec 2021</u>
Cycle	
Filed Barometric	<u>29.68 IN HG</u>
OAT	<u>36°C</u>
Altitude	<u>0 FT</u>

PRE - INSPECTION		
	Target	Actual
Tq		<u>2397</u>
Np		<u>1890</u>
ITT	°C	<u>820°C</u>
Ng	%	<u>101.1 %</u>
Wf		<u>555</u>
Oil Press		<u>94 °C</u>
Oil Temp		<u>69 °C</u>
Start Temp		<u>723 °C</u>

POST - INSPECTION		
	Target	Actual
Tq		<u>2397</u>
Np		<u>1890</u>
ITT	°C	<u>832 °C</u>
Ng	%	<u>101.8 %</u>
Wf		<u>552</u>
Oil Press		<u>93 °C</u>
Oil Temp		<u>73 °C</u>
Start Temp		<u>648 °C</u>

Engine Run Up Checks							
Inertial	☒	EPL	☒	OVG	☒	Stby Alt	☒
BOV	☒	Brake	☒	Randomn	☒		
NOTE: 1. Brake system at Torque 2000 ft-lbs. 2. Inertial Separator at Torque 400 ft-lbs. 3. EPL check can't exceed 4% Ng per second. 4. Standby Alt at 80% Ng. 5. Low idle at 55.5 - 57% 40Amps. 6. High idle at 64 - 66% Ng 40Amps							

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

- NIL NOTED -

PERFORMED BY			
Name	Sign & Stamp	Date	Location
<u>RIDZAL G</u>	 	<u>20/12/2021</u>	<u>NABIRE</u>



MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 12 – Inspection Document 06

Reg. Mark : PK- SMH
MSN : C208B - 5587
TSN / CSN : 1996108 / 2891

Date : 17 DEC 2021
Station : NAB120
WO No. : WO 1038-SMH / 11/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	N/A
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	N/A
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 12 – Inspection Document 06

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIZZAL, G	ENGINEER		9694
YOHAN.S. DEPARI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIZZAL GHAZALI Stamp : 

Signature :  Place/Date : MSX, 20-12-2021



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07




Reg. Mark : PK- SNH
MSN : C208 B - 5587
TSN / CSN : 1996 : 08 / 2891


Date : 17 DEC 2021
Station : NABIRE
WO No. : WO 1038-SNH / 20 / 2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610		
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720		
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720		
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220		
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220		
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72		
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220		
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Arya P	Engineer		9505-
PITAN AGIPA	MECHANIC		
YOHAN S. DEPAZI	MECHANIC		
RIDZAL G	ENGINEER		9694

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIDZAL GHAZALI Stamp : 

Signature :  Place/Date : NTX, 20-12-2011

MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 14 – Inspection Document 08

Reg. Mark : PK - SNH
MSN : C208 B - 5587
TSN / CSN : 1996:08 / 2891


Date : 17 Dec. 2021
Station : NABIRE
WO No. : WO/03B-SNH/XII/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-720		
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIZAL, G	ENGINEER		9694
PETER AGAPA	MECHANIC		
YOHANIS DEPAI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Arya Permana Stamp : 
Signature :  Place/Date : NBX / 18 Dec. 2021



MAINTENANCE PROGRAM

CESSNA C208/C208B




Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

Reg. Mark : PK- 3NH
MSN : C208 B-587
TSN / CSN : 1996:08 / 2891

Date : 17 DEC 2021
Station : NABIRE
WO No. : WO 038-3NH / XII / 2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds.		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to- fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING / REPLACEMENT) P/N OFF: AN 6235-3A P/N ON: AN 6235-3A		


Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731006	130	Do a check of the drain valve for installation and leaks		
F731007	130	Do a check of the flow divider for installation and leaks.		
F731008	130	Do a visual inspection of the P3 filter and drain valve.		
F731015	130	Do a visual inspection of Fuel Pump outlet filter. (CLEANING / REPLACEMENT) P/N OFF: <u>AN623K-3A</u> P/N ON: <u>AN6235-3A</u>		
F731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
F732001	130	Do a check of the FCU for installation, linkages and pneumatic tubes.		
F792000	130	Inspect and clean oil filter for debris.		
*** End of Engine PT6A-140 100 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIDZAL . G	ENGINEER		9694
YOHAN . S. DEAPARI	MECHANIC		
D. Anys P	Engineer		9505

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is considered fit for Release to Service.

Name : RIDZAL GHAZALI Stamp : 
 Signature :  Place/Date : NTSX, 20 DEC 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 52 – Engine PT6A-140 200 Hours Inspection


Reg. Mark : PK- SNH Date : 17 Dec. 2021
MSN : 02088 - 5587 Station : HABIRE
TSN / CSN : 1996:08 / 2891 WO No. : WO 038 - SNH / XI / 2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
WIDZALU	ENGINEER		9694
PETER ASARA	MECHANIC		
YOHAN. S. DEPARI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Agus Permana Stamp : 
Signature :  Place/Date : NBX / 20 Dec. 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection

Reg. Mark : PK- SMH Date : 17-12-2021
MSN : C208B-5587 Station : NABIRE
TSN / CSN : 1996-08 / 2801 WO No. : WO1038-SMH / X11 / 2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A- 140 200 Hours or 6 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIZAL G	ENGINEER		9694
YOHAN S. DEPAI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIZAL GUZALI Stamp : 
Signature :  Place/Date : MSX, 17-12-2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 54 – Engine PT6A-140 400 Hours Inspection

Reg. Mark : PK- 5NH



Date : 17 Dec 2021


MSN : C208B - 5587

Station : NABIRE

TSN / CSN : 1996108 / 2891

WO No. : WO 1038-5NH / XI / 2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F724000	130	Do borescope inspection of hot section components.		
F731004	130	Do a leak test and a functional test of the fuel manifold adapter and nozzle assemblies. Note: Engines ON fuel nozzle in-situ cleaning program (Ref. Task 71-00-00- 160-808). Test fuel nozzles and refurbish as necessary.		
F741001	130	Do a visual inspection of the ignition exciter.		
F741011	130	Do a visual inspection of the ignition cables.		
F742001	130	Do a functional check of the ignition cable.		
F742002	130	Do a visual inspection of the spark igniter/glow plugs. Note: Examine initially at 200 Hours.		
*** End of Engine PT6A-140 400 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Agus P.	Engineer		9505
YOHAN S. DEPARI	MECHANIC		
RIZDAL G	ENGINEER		9694

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIZDAL G

Stamp : 

Signature : 

Place/Date : NTB, 20-12-2021

MAINTENANCE PROGRAM **CESSNA C208/C208B**

Chapter 56 – Engine PT6A-140 1000 Hours Inspection

Reg. Mark : PK-SNH Date : 17 DEC 2021
 MSN : 670813-5587 Station : NATIRE
 TSN / CSN : 1996:08/2891 WO No. : W01038-SNH/XI/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731028	130	Replace the P3 filter. P/N OFF: <u>WF336238</u> P/N ON: <u>WF336238</u>		
F792001	130	Remove and discard the oil filter element. Install a new oil filter element. P/N OFF: <u>3034393WFL</u> P/N ON: <u>3034393WFL</u>		
*** End of Engine PT6A-140 1000 Hours Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<u>RIDZAL G</u>	<u>ENGINEER</u>		<u>9604</u>
<u>YOHAN S. DEPAR</u>	<u>MECHANIC</u>		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIDZAL GHAZALI Stamp : 
 Signature :  Place/Date : MTX, 17 DEC 2021



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/038-SNH/XII/2021	10-Dec-2021	REPLACEMENT COMPONENT	PK-SNH
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	37		MT3X
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT P/N: AAD9-18-1 / C294502-0201			
REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
Performed at A/C TT : <u>1936:08</u> A/C TC/LDG : <u>2891</u>				
FINDING	☐ Y ☐ N	ACT MHR :		
INSPECTION CARD (IC) #		19	12	21

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
VACUUM FILTER	AAD9-18 AAD9-18-1	1		

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	Good



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/038-SNH/XII/2021	10-Dec-2021	REPLACEMENT COMPONENT	PK-SNH
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#002	37		MT3X
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM VACUUM RELIEF VALVE FILTER REPLACEMENT
P/N: B3-5-1 / C482001-0202

REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

		MECH	ENG	INSP (*)
Performed at A/C TT : 1996 : 08 A/C TC /LDG : 2891				
FINDING	☐ Y ☐ N	ACT MHR :		DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		11	12	21

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	B3-5-1			

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	Good



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

**PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023**

DATE : 20-12-2021	A/C REG : TK-SNH
A/C TYPE : C200T3	CHECKER : RIDZAL.G SIGN:  

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P010202-201	17060500072	July 2022	SERVICEABLE
2	Co-Pilot Life Vest	P010202-201	17060500033	July 2022	SERVICEABLE
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	FL220-FAKFAA	1249 - 1450	AUGUST 2022	SATISFY
14	Crash Axe Installed	LOCAL	MSN	ON CONDITION	SATISFY
15	Fire Extinguisher	C357	F95366618	NOV 2022	SERVICEABLE
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					



2

[illegible]



Aircraft Registration:

PK-SNH

WO# NT:

WO/038-SNH/XII/2021



Additional Work Sheet
Inspection Doc. 08 & Add Task

Parts Used Sheet

7

[illegible]

SERVICEABLE TAG

Part Number: 3077780-01A		Description: FUEL No22LE ASSY 140	
Serial Number:	Qty: 1 AEA	☐ Form 8130-4 ☐ From 21-18 ☐ C of C	
Order Number:	Receipt Date: 24 NOV 2021	For Class I Product For Class II/III Product For Class II Product Only	
Mfg. Date:	Vendor / Approved Shop:	The Part Identified has been : ☒ Inspected only ☐ Repaired ☐ New ☐ Other	
TSN:	Shelf Life Expiry Date: N/A	CERTIFICATE OF RELEASE TO SERVICE I hereby certify that the work recorded above have been carried out in accordance with the requirements of the Indonesia Civil Aviation Safety Regulations applicable thereto and is airworthy	
Remarks: INSTALLED ON	TSO:	Sign/Stamp  Authority CHIEF INSPECTOR Date: 24 NOV 2021	
PC-SAMH	Store Inspector: P17EP-AGAPPA		
Condition: CLEANING.	Main Store:		

INSTALLATION DATA

Date: 20-12-2021

A/C Reg.: PK-SNH

A/C Total Time : 1996:08

Position on A/C: ENGINE

A/C Total Landing: 2891

Technical Log Sheet Page No.: WO/038-SNH/X11/2021

Engineer Name:

Pudal . G

Lic/Auth. No.:

9694/SCA021

Signature:

[Signature]

Note:

Please return this Tag to Technical Record, for further data processing after Completion and Released by the AME

SERVICEABLE TAG

Part Number: 097-534-0		Description: MICHELIN AIRSTOP TUBE 22X8.0-8	
Serial Number: N/A	Qty: 1ea	☐ Form 8130-4 ☐ DAAG From 21-18 ☒ C of C	
Order Number: 3341716	Receipt Date: 5 Jan 2021	For Class I Product For Class II/III Product For Class II Product Only	
Mfg. Date: 14/03/2019	Vendor / Approved Shop: AIRCRAFT SPRUCE	The Part Identified has been: ☐ Inspected only ☐ Repaired ☒ New ☐ Other	
TSN: N/A	Shelf Life Expiry Date: N/A	CERTIFICATE OF RELEASE TO SERVICE I hereby certify that the work recorded above have been carried out in accordance with the requirements of the Indonesia Civil Aviation Safety Regulations applicable thereto and is airworthy	
Remarks: INSTALLED ON PL-SNH	TSO: N/A	Sign/Stamp   CHIEF INSPECTOR Date: 05 Jan 2021	
Condition: NEW		Main Store: JAKARTA	

INSTALLATION DATA

Date: 107-12-2021

A/C Reg.: PK-SAM

Position on A/C: NLG

Technical Log Sheet Page No.: W06307-SAM/K11/2021

A/C Total Time : 1994:08

A/C Total Landing: 2891

Engineer Name:

Rimal. G

Lic/Auth. No.:

9694/SCA021

Signature:

Atu

Note:

Please return this Tag to Technical Record, for further data processing after Completion and Released by the LAME



SERVICEABLE TAG

Part Number: 078-446-1		Description : MAIN TIRE	
Serial Number: 1196T00190	Qty.: 1EA	☐ Form 8130-4 For Class I Product	☐ DAAO From 21-18 For Class II/III Product
Order Number:	Receipt Date: 14 October 2021	☐ C of C For Class II Product Only	
Mfg. Date:	Vendor / Approved Shop:	The Part Identified has been : ☐ Inspected only ☐ Repaired ☒ New ☐ Other	
TSN: NEW	Shelf Life Expiry Date: N/A	CERTIFICATE OF RELEASE TO SERVICE	
Remarks: INSTALLED ON PK-SMH	TSO: N/A	<i>I hereby certify that the work recorded above have been carried out in accordance with the requirements of the Indonesia Civil Aviation Safety Regulations applicable thereto and is airworthy</i>	
	Store Inspector:		
	Main Store: Out Station Store : Nabire		
Condition: Good		Sign/Stamp:  Authority: INSPECTOR Date : 16 October 2021	

Form: SCA/MTC/022

INSTALLATION DATA

Date: 18-12-2021

A/C Reg.: PLC-SNH

Position on A/C: MLG

Technical Log Sheet Page No.: W06038-SNH/2021

A/C Total Time : 1996:08

A/C Total Landing: 2891

Engineer Name:

Rudra. G

Lic/Auth. No.:

9694/SCA021

Signature:

[Signature]

Note:

Please return this Tag to Technical Record, for further data processing after Completion and Released by the LAMF



MICHELIN

Stabilimento di Cuneo

Piazza Robert Daubr e 12020, Ronchi – Cuneo

CERTIFICATE OF CONFORMANCE
CERTIFICATO DI CONFORMITA'

DIMENSIONE : 8J15

P \ N	Tube size	Production lot
Codice materiale	Dimensione camera	Lotto produzione
097 - 534 - 0	22x8.0-8	11 /2019

Gentleman, we hereby certify that the parts supplied and referenced by the production lot, are manufactured according to applicable specifications. Substantiating documents regarding the subject parts are on file available for inspection upon request.

Signori, con questo documento noi certifichiamo che i materiali forniti ed identificati col riferimento del lotto di fabbricazione, sono realizzati conformemente alle specifiche richieste. I documenti previsti, relativi ai materiali in oggetto, sono archiviati e disponibili per ispezione su richiesta.

Tubes Quality Assurance Manager	Name Nome	Signature \ Firma	Date Data (d/m/y)
Responsabile Garanzia Qualit� camere	M. Ambrogio		14/03/2019

IST_153_PLE_CNO_FOR02

Edizione del 25/06/2015

1. Approving competent Authority/Country
 2. **Direction Générale de l'Aviation Civile**
 FRANCE

AUTHORISED RELEASE CERTIFICATE

Certificat Libérateur Autorisé

EASA FORM 1

Formulaire 1 de l'EASA

4. Organisation Name and Address :
 Nom et Adresse de l'Organisme :



MICHELIN

MANUFACTURE FRANÇAISE DES PNEUMATIQUES MICHELIN
 Place des Carmes Déchaux
 63000 CLERMONT-FERRAND
 FRANCE
 (MICHELIN AIRCRAFT TIRE)

5. Work Order / Contract / Invoice
 Bon de commande / Contrat / Facture
 1196T00150



3. Form Tracking Number
 N° de repère du Formulaire
 21 / 53382 / NKE / N / B

6. Item / Item	7. Description / Description	8. Part No. / N° de pièce	9. Qty / Qté	10. Serial No. / N° série	11. Status / Work / Etat / Travaux
N/A	29X11.0-10	078-446-1 	1	1196T00150 	NEW

12. Remarks
 Remarques
 Norme(s): ETSOC62d, TSOC62e
 ETSOC62d Approval Number: EASA.210.977, TSOC62e LODA Approval Number: TFSn/814/2008-426

13a. Certifies that the items identified above were manufactured in conformity to :
 Certifie que les éléments identifiés ci-dessus ont été fabriqués conformément aux :

- ☒ approved design data and are in a condition for safe operation
 données de conception approuvées et sont en état de fonctionner en toute sécurité
- ☐ non-approved design data specified in block 12
 données de conception non approuvées spécifiées dans la case 12

14a. ☐ Part 145 A.50 Release to Service
 Approbation pour remise en service
 Selon Partie 145.A.50

☐ Other regulation specified in block 12
 Autre réglementation précisée en case 12

13b. Authorised Signature Signature autorisée	13c. Approval/Authorisation Number Numero d'agrément/d'autorisation FR.21G.0100	14b. Authorised Signature Signature autorisée	14c. Certificate/Approval Ref. No N° du Certificat/Agrément
--	---	--	--

13d. Name / Nom UTAI Wised	13e. Date (dd mm yy) / Date (jj mm aa) 19 Jul 2021	14d. Name / Nom	14e. Date (dd mm yy) / Date (jj mm aa)
-------------------------------	---	-----------------	--

USER/INSTALLER RESPONSIBILITIES / Responsabilités de l'utilisateur/installateur

This certificate does not automatically constitute authority to install the item(s)
 Ce document ne constitue pas forcément l'autorisation d'installer l(es) item(s)

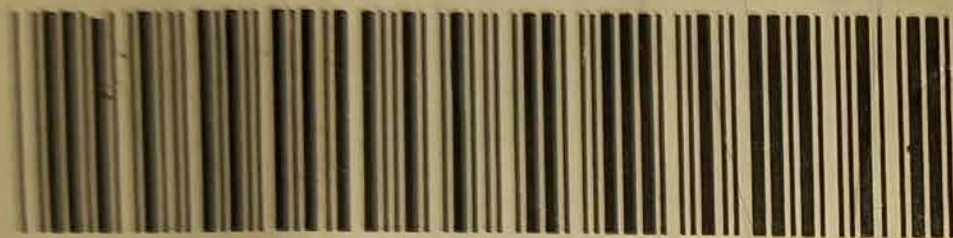
Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1,
 Lorsque l'utilisateur/installateur réalise des travaux en conformité avec les règlements d'une autorité de navigabilité différente de l'autorité de navigabilité mentionnée dans la case 1,

son autorité de navigabilité accepte les items libérés par l'autorité de navigabilité mentionnée dans la case 1.
 son autorité de navigabilité accepte les items libérés par l'autorité de navigabilité mentionnée dans la case 1.

Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before
 Les indications portées en cases 13a et 14a ne constituent pas une certification de montage. Dans tous les cas le dossier d'entretien de l'aéronef doit contenir une certification d'installation délivrée conformément aux

reglements nationaux par l'utilisateur/installateur avant que l'aéronef puisse voler.

29X11.0-10



CAI:844687-101



S/N:1196T00150



P/N:078-446-1



RL:0

DOT: 2921