



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 10 & Add. Task due at 2400 Hours.	No.	WO/040-SNG/VI/2022
	Date	2 June 2022
	A/C Reg.	PK-SNG C208B-5543
Reference : MP C208B REV. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Document 10 & Add Task due at 2400 Hours. 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work : NIL		
Compliance Statement	Sign & Date Company Lic. No.: 17 JUN 2022  AMIN M SAIP (Engineer In Charge)	Signature  (Technical Manager)

SUMMARY INSPECTION ITEMS

(Form: SCA/MTC/050)

WO Ref: WO/040-SNG/VI/2022

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	17 JUN 2022		Amin M SAID	
2	CHAPTER 12	INSPECTION DOCUMENT 06	16/06/2022		Deur Prawa	
3	CHAPTER 13	INSPECTION DOCUMENT 07	16/06/2022		Deur Prawa	
4	CHAPTER 14	INSPECTION DOCUMENT 08	16/06/2022		Deur Prawa	
5	CHAPTER 15	INSPECTION DOCUMENT 09	17 JUN 2022		Amin M SAID	
6	CHAPTER 16	INSPECTION DOCUMENT 10	17 JUN 2022		Amin M SAID	
7	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	17 JUN 2022		Amin M SAID	
8	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	17 JUN 2022		Amin M SAID	
9	CHAPTER 53	ENGINE PT6A-140 200 HOUR / 6 MONTHS INSPECTION	17 JUN 2022		Amin M SAID	
10	CHAPTER 54	ENGINE PT6A-140 400 HOUR INSPECTION	17 JUN 2022		Amin M SAID	
11	CHAPTER 55	ENGINE PT6A-140 600 HOUR INSPECTION	17 JUN 2022		Amin M SAID	
12	SCA/MTC/023	EMERGENCY EQUIPMENT CHECK	17 JUN 2022		Amin M SAID	
13	37-10-00-960	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT (AAD9-18-1)	15/06/2022		Deur Prawa	
14	37-10-00-961	VACUUM RELIEF VALVE FILTER REPLACEMENT (B3-5-1)	15/06/2022		Deur Prawa	
15	CHAPTER 32	BATTERY CAP CHECK	17/06/2022		Wahyono	
16	61-00-06	PROPELLER INSPECTION	17 JUN 2022		Amin M SAID	
17		BOREScope INSPECTION	17 JUN 2022		Amin M SAID	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION

(CRS-SMI)

A/C TYPE	: CESSNA	TTSN	: 2390141
A/C REG	: C208B : PK-SNG	TCSN	: 3757
MSN	: C208B-5543	DATE	: 17-JUN-2022

TYPE OF INSPECTION : INSPECTION DOCUMENT 10 & ADD TASK
 DUE AT : 2400 HOURS
 REFF : MP C208B REV. 10

EXCEPTION

AUTHORIZED PERSON



I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
 Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
AMIN MOHAMMAD SAID	AIRFRAME & POWER PLANT	8629 	 	17-JUN-2022
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS INSPECTION
 DUE AT : 2500 HOURS

Form: SCA/MTC/049

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
2 June 2022	WO/040-SNG/VI/2022	Insp. Doc.10 & Add Task			
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5543	PK-SNG		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0596	2393:06 / 3790		
	#2	-			
Propeller/Rotor	#1	190140	2393:06 / 3790		
	#2	-			
Landing Gear	NLG		2393:06 / 3790		
	LH MLG		2393:06 / 3790		
	RH MLG		2393:06 / 3790		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	2	#001 #002		
2	Inspection Card	1			
3	Work Order	1			
4	Summary Inspection List	1			
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1			
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
IC-001	A322001	FOUND SPOT AT NOSE TIRE		✓	Denyff Prans 
IC-002	D121001	BRAKE DISC OUT OF LIMIT		✓	Denyff Prans 
IC-003	D121001	LH BRAKE FOUND LEAK AT PISTON NO # 4		✓	Denyff Prans 
IC-004	A322001	MPI BOLT NEED TO REPLACE		✓	Denyff Prans 
IC-005	A322001	NOSE BEARING CONE ADLER WEAR & DISTORTION		✓	Denyff Prans 
IC-006	F792002	LH SIDE IGNITER WORN OUT		✓	Denyff Prans 


<u>IC-007</u>	B301001	RELIEF VALVE NEED TO REPLACE		✓	
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager





.....
Dwi M.


.....
Dodit


.....
Yanuar



.....
Istiono


Reg. Mark	: PK - SNG	Date	: 14 JUN 2022
MSN	: C208B-5543	Station	: NBS
TSN / CSN	: 239041	WO No.	: WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	N/A
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 12 – Inspection Document 06

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEPNANA P	MECHANIC		-
Denizar Pramu	ENGINEER		9687
Wahyono	ENGINEER		5702
Amin M SAID	ENGINEER		8620

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Denizar Pramu Stamp : 
Signature :  Place/Date : NABIRE / 16 June 2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07

Reg. Mark : PK - SNG






Date : 14-JUN-2022

MSN : C208B-5543

Station : NBX

TSN / CSN : 2390141

WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610		
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720	N/A	
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221	N/A	

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720	<i>[Signature]</i>	
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220	<i>[Signature]</i>	
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220	<i>[Signature]</i>	
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72	<i>[Signature]</i>	
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220	N/A	N/A
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP NANA P	MECHANIC	<i>[Signature]</i>	
<i>[Signature]</i>	ENGINEER	<i>[Signature]</i>	8657
<i>[Signature]</i>	ENGINEER	<i>[Signature]</i>	8651

RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service			
Name	: <i>[Signature]</i>	Stamp	: 
Signature	: <i>[Signature]</i>	Place/Date	: <i>MAURE / 16 JUNE 2022</i>

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 14 – Inspection Document 08

Reg. Mark : PK - SNG



Date : 14-JUN-2022


MSN : C208B-5543

Station : NBX

TSN / CSN : 2390.41

WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-720		
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP NANH P	MECHANIC		
DEBORAH Prunty	ENGINEER		3687

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : Debor Prunty

Stamp :



Signature :



Place/Date :

NABIR / 15 JUNE 2022

Reg. Mark : PK - SNG




Date : 14-JUN-2022

MSN : C208B-5543

Station : NBX

TSN / CSN : 2390: 41

WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B212401	211 212	Avionics Cooling Fan Operational Check Task 21-24-00-710		
B221201	226 232	Garmin Autopilot (GFC 700) Functional Check Task 22-12-00-720		
B221203	226 232	Garmin Autopilot (GFC 700) Slip Clutch Override Operational Check Task 22-12-00-710		
C273030	213 214	Elevator Bellcrank Lubrication Task 12-21-02-640		
A275001	231 232	Flap Actuator Mount Bracket Detailed Inspection Task 27-50-00-220		
A275003	251 252 511 611 525 625	Flap Bellcrank Detailed Inspection Task 27-50-00-221		
*** End of Inspection Document 09 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
AMIN M SAID	ENGINEER		8690
CEP NANA P Wahyono	MECHANIC ENGINEER		5792

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : AMIN M SAID Stamp : 

Signature :  Place/Date : NBX/ 17-JUN-2022

Reg. Mark : PK - SNG






Date : 14-JUN-2022

MSN : C208B-5543


Station : NBX

TSN / CSN : 2390:41

WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
C221201	226 232	Autopilot Servos Lubrication Task 22-12-00-640		
A245001	121 122	Power Distribution Boxes Detailed Inspection Task 24-50-00-220		
A251001	231 232	Crew Seats Detailed Inspection Task 25-10-00-220		
A251003	231 232	Passenger Seats Detailed Inspection Task 25-21-00-220		
B271001	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Spoiler System Functional Check Task 27-10-00-720		
C271003 RII	551 571 651 671	Aileron Trim Tab Actuator (2660044-1) Lubrication Task 27-10-02-641 NIL		
		RII Sign:  RII Stamp: 		
C273001 RII	371 372 375 376	Elevator Trim Tab Actuator (2660017-1) Lubrication Task 27-30-02-640 NIL		
		RII Sign:  RII Stamp: 		
B284103	AUX	Fuel Quantity and Low Fuel Warning Systems Functional Check Task 28-41-00-720		
B313103	312	Flight Data Recorder Underwater Locator Beacon Functional Check Task 31-31-00-721	N/A	
B324001	ENG	Brakes Operational Check Task 32-40-00-710		

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B332001	AUX	Passenger/Cargo Compartment Lighting Operational Check Task 33-20-00-710		
A520001	801 802	Crew Doors Detailed Inspection Task 52-00-00-220		
A520003	255 256 257 258 803 804	Passenger/Cargo Doors and Door Frames Detailed Inspection Task 52-00-00-221		
A781001	130	Primary and Secondary Exhaust Duct General Visual Inspection Task 78-10-00-211		
*** End of Inspection Document 10 Items ***				


PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Amun M Said	ENGINEER		8690
CEP NANA P	MECHANIC		
Wahyono	ENGINEER		5792


RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name	: <u>Amun M Said</u>	Stamp	: 
Signature	: 	Place/Date	: <u>MSR / 17 Jun - 2022</u>

Reg. Mark	: PK - SNG	Date	: 14-Jun-2022
MSN	: C208B-5543	Station	: NBSX
TSN / CSN	: 2390:41	WO No.	: WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds.		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to- fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235- 3A</u> P/N ON: <u>AN 6235- 3A</u>		

Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIG	STAMP
F731006	130	Do a check of the drain valve for installation and leaks		
F731007	130	Do a check of the flow divider for installation and leaks.		
F731008	130	Do a visual inspection of the P3 filter and drain valve.		
F731015	130	Do a visual inspection of Fuel Pump outlet filter. (CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235-3A</u> P/N ON: <u>AN 6235-3A</u>		
F731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
F732001	130	Do a check of the FCU for installation, linkages and pneumatic tubes.		
F792000	130	Inspect and clean oil filter for debris.		
*** End of Engine PT6A-140 100 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Amin M. Said	ENGINEER		8650
CER NANA P	MECHANIC		
Wahjono	ENGINEER		5792

RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name	: <u>Amin M. Said</u>	Stamp	: 
Signature	: 	Place/Date	: <u>NSR / 17-jun-2022</u>

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 52 – Engine PT6A-140 200 Hours Inspection

Reg. Mark : PK - SNG Date : 14-Jun-2022
MSN : C208B-5543 Station : NBX
TSN / CSN : 2300:41 WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
AMIN M SAID	ENGINEER		8690
CEP NANA P	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : AMIN M SAID Stamp : 
Signature :  Place/Date : NBX / 17-Jun-2022

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection

Reg. Mark : PK - SNG Date : 14-JUN-2022

MSN : C208B-5543 Station : N3X

TSN / CSN : 2380-41 WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGd internal scavenge oil pump inlet screen		
*** End of Engine PT4A- 120 H00 hours or 4 Months Inspection Item s ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
AMIN M SAUD	ENGINEER		880
CEP NANA P	MECHANIC		

RETURN TO SERVICE

The Work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is considered fit for Release to Service.

Name : AMIN M SAUD Station : 

Signature :  Place/Date : N3X / 17-JUN-2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 54 – Engine PT6A-140 400 Hours Inspection

Reg. Mark : PK - SNG Date : 14-Jun-2022
MSN : C208B-5543 Station : NBX
TSN / CSN : 2390.41 WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F724000	130	Do borescope inspection of hot section components.		
F731004	130	Do a leak test and a functional test of the fuel manifold adapter and nozzle assemblies. Note: Engines ON fuel nozzle in-situ cleaning program (Ref. Task 71-00-00- 160-808). Test fuel nozzles and refurbish as necessary.		
F741001	130	Do a visual inspection of the ignition exciter.		
F741011	130	Do a visual inspection of the ignition cables.		
F742001	130	Do a functional check of the ignition cable.		
F742002	130	Do a visual inspection of the spark igniter/glow plugs. Note: Examine initially at 200 Hours.		
*** End of Engine PT6A-140 400 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP NANA P Amin M SAU	MECHANIC ENGINEER		20620

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.


Name : Amin M SAU Stamp : 
Signature :  Place/Date : NBX / 17-JUN-2022

Reg. Mark : PK - SNG
 MSN : C208B-5543
 TSN / CSN : 2390: 41

Date : 14 JUN 2022
 Station : NGX
 WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B243301	122	Concord Sealed Lead Acid Battery Functional Check (Capacity Check) EPV Voltage : <u>20</u> Volt Result : <u>100</u> % NOTE: The inspections schedule may be adjusted after the useful battery life is established, based on operations." Task 24-33-00-720		
*** End of Inspection Document 26 Items ***				



PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP NANA P Wahyono	MECHANIC Engineer		5792


RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name	: Wahyono	Stamp	: 
Signature	: 	Place/Date	: Nabire, 17/06/2022

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 55 – Engine PT6A-140 600 Hours Inspection

Reg. Mark : PK - SNG Date : 14-JUN-2022
MSN : C208B-5543 Station : NBX
TSN / CSN : 23000-41 WO No. : WO/040-SNG/VI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731005		Do a visual inspection of the fuel pump inlet screen.		
F753001		Do a visual inspection of the compressor bleed valve.		
F793002		Do a functional check of the chip detector.		
*** End of Engine PT6A-140 600 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Amir M Said	ENGINEER		8690
CEP NANA P	MECHANIC		

RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name :	Amir M Said	Stamp :	
Signature :		Place/Date :	NBX / 14-JUN-2022

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-007	WO/040-SNG/VI/2022		B301001		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	ENGINE			
9. ZONE	10. STA	11. MTC TYPE			
ENGINE	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
RELIEF VALVE NEED TO REPLACE		

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED RELIEF VALVE WITH NEW ONE. Ref. AMM. 37-10-00. Performed at A/C TT: 2390:41 A/C TC/LDG: 3757			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3			
PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			


22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
RELIEF VALVE	RV05-268	1	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPN	ON CONDITION	GOOD

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-006	WO/040-SNG/VI/2022		F742002		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	ENGINE			
9. ZONE	10. STA	11. MTC TYPE			
ENGINE	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
LH SIDE IGNITER WORN OUT.		

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED LH IGNITER WITH NEW. REF. AMM. 74-20-00 Performed at A/C TT: 2390:41 A/C TC/LDG: 3757			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
IGNITER GENERAL TOOLS	CH3905	1	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE GENERAL TOOLS	TA0250 NPN	NOV 2023 0/1	GOOD GOOD

NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/040-SNG/VI/2022	2022	REPLACEMENT	PK-SNG/208B-5543
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	37		NABIRA
9. ZONE	10. PANEL		
ACCEPT (CABIN)			

11. DESCRIPTION

PERFORM REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD
PN: AAD9-18-1

REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR:

12. RESULT

PERFORMED REPLACE VACUUM SYSTEM CENTRAL FILTER
REF. AMM 37-10-00

Performed at A/C TT: 2393:06 A/C TC/LDG: 3750

FINDING	☐ Y	☐ N	ACT MHR:	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				15 06 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
VACUUM CENTRAL FILTER	AAD9-18-1	1	✓	✓

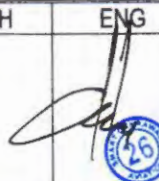
14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPM	O/C	Good

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/040-SNG/VI/2022	2022	REPLACEMENT	PK-SNG/208B-5543
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#002	37		NABIRE
9. ZONE	10. PANEL		
COCKPIT / CABIN			

11. DESCRIPTION			
PERFORM REPLACE VACUUM RELIEF VALVE FILTER DISCARD PN: B3-5-1			
REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR:

12. RESULT		MECH	ENG	INSP (*)
PERFORMED REPLACE VAV FILTER DIFF. ATTA CH-12-15-01 Performed at A/C TT: 2393:06 A/C TC /LDG: 3750				
FINDING	☐ Y	☐ N	ACT MHR:	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		15	06	2022


13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
VACUUM FILTER	B3-5-1	1	✓	✓

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPN	O/C	Good

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-001	WO/040-SNG/VI/2022		A322001	16/06/2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
FOUND SPOT AT NOSE TIRE.	 	16/06/2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED NOSE TIRE WITH NEW ASSY. REF. AMM 32-40-00 Performed at A/C TT : 2393:06 A/C TC /LDG : 3750	 		16/06/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
NOSE TIRE ASSY	228K 61-1	1	03290018	71102159	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE	TA0250	NOV 2023	GOOD
GENERAL TOOLS	NPN	ON CONDITION	GOOD

		INSPECTION CARD (Form: SCA/MTC/048)			TECHNICAL DEPARTMENT	
---	--	---	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-002	WO/040-SNG/VI/2022		D121001	16/06/2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	WABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
BRAKE DISC OUT OF LIMIT AT LH SIDE		16/06/2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED BRAKE DISC WITH NEW. REF. AMM. 32-40-00 Performed at A/C TT: 2393 : 06 A/C TC /LDG: 3750			16/06/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BRAKE DISC	169-22201	1	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE	TA0250	NOV 2023	GOOD
GENERAL TOOLS	NPN	O/N	GOOD

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-003	WO/040-SNG/VI/2022		D121001	16/06/2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
LH BRAKE FOUND LEAK AT PISTON NO. #4	 	16/06/2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED LH BRAKE O-RING WITH NEW REF AMM 32-90-00. Performed at A/C TT : 2393:06 A/C TC/LDG : 3750		 	16/06/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			


22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	MS28775-22A	1	N/A	N/A	✓	
O-RING	MS28775-011	4	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE	TA 0250	NOV 2023	GOOD
GENERAL TOOLS	NPN	O/C	GOOD

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 009	WO/040-SNG/VI/2022		A322001	16/06/2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
MPI BOLT NEED TO REPLACE	 	16/06/2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED MPI BOLT WITH NEW. REF. AMM. 32-20-00 Performed at A/C TT : 2393 : 06 A/C TC /LDG : 3750		 	16/06/2022


20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
MPI BOLT	S3961-88	2	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE	TA 0250	NOV 2023	GOOD
GENERAL TOOLS	NPN	O/C	GOOD

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-005	WO/040-SNG/VI/2022		A322001	16/06/2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNG/5543	C208B EX	AIRFRAMA			
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 RPC/ENG	15 DATE
NOSE BEARING CONE ROLLER WEAR & DISTORTION	 	16/06/2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED WITH NEW REF ATAM CH. 32-40-00 Performed at A/C TT : 2393 : 06 A/C TC /LDG : 3750		 	16/06/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
CONE BEARING	211-00200	2ea	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	NPM	o/c	GOOD

Reg. Mark : PK - SNG

WO/FML No. : WO/040-SNG/VI/2022

PRE – INSPECTION	
Location	
Date	
Cycle	
Filed Barometric	
OAT	
Altitude	

POST – INSPECTION	
Location	NBX
Date	17-JUN-2022
Cycle	3767
Filed Barometric	1010 HP
OAT	32
Altitude	SEA LEVEL

PRE – INSPECTION		
	Target	Actual
Tq		
Np		
ITT	°C	°C
Ng	%	%
Wf		
Oil Press		°C
Oil Temp		°C
Start Temp		°C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1900
ITT	841 °C	813 °C
Ng	102.7 %	101.2 %
Wf	578	538
Oil Press		89 °C
Oil Temp		78 °C
Start Temp		643 °C

Engine Run Up Checks							
Inertial	☒	EPL	☒	OVG	☒	Stby Alt	☒
BOV	☒	Brake	☒	Random	☒		
NOTE: 1. Brake system at Torque 2000 ft-lbs. 2. Inertial Separator at Torque 400 ft-lbs. 3. EPL check can't exceed 4% Ng per second. 4. Standby Alt at 80% Ng. 5. Low idle at 55.5 - 57% 40Amps. 6. High idle at 64 - 66% Ng 40Amps							

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

ENGINE PERFORMANCE ON TARGET

PERFORMED BY

Name	Sign & Stamp	Date	Location
AMIN MUTHOMAR SAID		17-JUN-2022	NBX



Additional Work Sheet

Inspection Doc. 08 & Add Task

Aircraft Registration: **PK-SNG**WO# Nr: **WO/040-SNG/VI/2022**

Parts Used Sheet

Special Tool Used

[illegible]



Additional Work Sheet

Inspection Doc. 08 & Add Task

Aircraft Registration: **PK-SNG**

WO# Nr: WO/040/SNG/VI/2022

Parts Used Sheet

Part Used

[illegible]



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023

DATE : 18 June 2022

A/C REG : PK-SNG

A/C TYPE : C208B EX

CHECKER : CEP NANA

SIGN:

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	PO1202-201	1909230036	JAN 2029	SERVICEABLE
2	Co-Pilot Life Vest	PO1202-201	19092030051	JAN 2029	SERVICEABLE
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	NPN	NSM	JUNE 2022	Good
14	Crash Axe Installed	Local	NIL	O/C	Good
15	Fire Extinguisher	C352	560589352	SEP 2022	SERVICEABLE
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					
18	FLIGHT LIGHT	Local	NIL	O/C	Good

INSTALLATION DATA

Date: 16 JUNE 2022

A/C Reg.: PK-SNG

A/C Total Time: 2393:06

Position on A/C: NOSE GEAR

A/C Total Landing: 3750

Technical Log Sheet Page No.: WD/090/SNG/VI/2022

Engineer Name:

David Prunty

Lic/Auth. No.:



Signature:

[Signature]

Note:

Please return this Tag to Technical Record, for further data processing after Completion and Released by the LAME



MICHELIN

Stabilimento di Cuneo

Piazza Robert Daubrée 12020, Ronchi - Cuneo

CERTIFICATE OF CONFORMANCE

CERTIFICATO DI CONFORMITA'

DIMENSIONE : 8J15

P \ N	097 - 534 - 0	Tube size	22x8.0-8	Production lot	11 /2019
Codice materiale		Dimensione camera		Lotto produzione	

Gentleman, we hereby certify that the parts supplied and referenced by the production lot, are manufactured according to applicable specifications. Substantiating documents regarding the subject parts are on file available for inspection upon request.

Signori, con questo documento noi certifichiamo che i materiali forniti ed identificati col riferimento del lotto di fabbricazione, sono realizzati conformemente alle specifiche richieste. I documenti previsti, relativi ai materiali in oggetto, sono archiviati e disponibili per ispezione su richiesta.

Tubes Quality Assurance Manager	Name Nome	Signature \ Firma	Date Data (d/m/y)
Responsabile Garanzia Qualità camere	M. Ambrogio		14/03/2019

IST_153_PLE_CNO_FOR02

Edizione del 25/06/2015