



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030


Subject : Inspection Document 06 & Add Task Due at 2600 FH	No.	WO/044-SNG/VIII/2022
	Date	16 August 2022
	A/C Reg.	PK-SNG C208B-5543
Reference : MP C208/208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Document 06 & Add Task Due at 2600 FH 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work : —		
Compliance Statement -Carrie Out-	Sign & Date Company Lic. No.: SCA 031 22 Aug 2022 (Engineer In Charge) D. Arya Permana.	Signature (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
16 August 2022	WO/044-SNG/VIII/2022	Inspection Doc. 06 & Add Task	22 Aug 2022		
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5543	PK-SNG		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0596	2593:38/4141		
	#2	-			
Propeller/Rotor	#1	190140	2593:38/4141		
	#2	-			
Landing Gear	NLG		2593:38/4141		
	LH MLG		2593:38/4141		
	RH MLG		2593:38/4141		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	-			
2	Inspection Card	5	✓		
3	Work Order	1	✓		
4	Summary Inspection List	1	✓		
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1	✓		
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status	Name/ Sign & Stamp	
			Open	Close	
IC-001	32-40-00	Replaced R/H Brake Linning Due to worn out	-	✓	Arya [Signature] 31
IC-002	32-40-00	Replaced R/H Brake Shim. Due to worn out.	-	✓	Arya [Signature] 31
IC-003	32-40-00	Replaced L/H Brake Shim.	-	✓	Arya [Signature] 31
IC-004	74-20-00	Replaced R/H Igniter	-	✓	Arya [Signature] 31
IC-005	74-20-00	Replaced L/H Igniter	-	✓	Arya [Signature] 31
IC-006					

<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support



.....

Hani

Checked by :
Chief Maintenance



.....

Dodit

Verified by :
Chief Inspector



.....

Yanuar

Approved by :
Technical Manager



.....

Istiono

SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/044-SNG/VIII/2022

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	22/08 '22		Arya P	
2	CHAPTER 12	INSPECTION DOCUMENT 06	21/08 '22		Arya P	
3	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	22/08 '22		Arya P	
4	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	22/08 '22		Arya P	
5	CHAPTER 53	ENGINE PT6A-140 200 HOUR / 6 MONTHS INSPECTION	22/08 '22		Arya P	
6	SCA/MTC/023	EMERGENCY EQUIPMENT CHECK	22/08 '22		Arya P	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION

(CRS-SMI)

A/C TYPE : CESSNA 208B TTSN : 2593:38
A/C REG : PK-SNG TCSN : 4141
MSN : C208B-5543 DATE : 22-08-2022

TYPE OF INSPECTION : INSPECTION DOCUMENT 06 & ADD TASK
DUE AT : 2600 HOURS
REF : MP C208B REV. 12

EXCEPTION

- No Exception -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
D. Arya Permama	AIRFRAME & POWER PLANT	9505 / SCA031	 	22 Aug 2022
-	EIRA	.	-	

THE NEXT DUE TYPE OF INSPECTION : 100 Hrs.
DUE AT : 2700 FTH

Form: SCA/MTC/049

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
IC - 001	WO/044-SN6/VIII/2022		32-40-00	21-08-2022		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SN6	C208B-EX					
9. ZONE	10. STA	11. MTC TYPE				
MLB	TMH	Replacement				

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
R/H Outboard Brake lining was worn out		21/08/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
Removed and Replaced R/H Brake lining with the New. IAW C208B AMM #32-40-00. Performed at A/C TT: 2593:38 A/C TC/LDG: 4141	out		21/08/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Brake Lining	066-05300	4	—	—	✓	—

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
General Tools	—	—	OK
Torque wrench	10268839	Feb. 2023	OK



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC - 002	WO/041-SN5/VIII/2022		32-40-00	21-08-2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SN5	C208B-EX			
9. ZONE	10. STA	11. MTC TYPE		
WLG	TMH	Replacement		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
R/H Brake Shim. need to replace.	<i>[Signature]</i>	21/08/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
Removed and Replaced R/H Brake Shim. with the New. 1AW C208B AMM # 32-40-00. Performed at A/C TT: 2593.38 A/C TC/LDG: 4141	cut	<i>[Signature]</i>	21/08/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Brake Shim	068-02800	1	-	-	✓	-

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
General tools	-	-	OK.



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-003	WQ/044-SN6/VIII/2022		32-40-00	21-08-2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SN6	C208B-EX			
9. ZONE	10. STA	11. MTC TYPE		
ML6	TMH	Replacement		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
L/H. Brake Shim need to Replace	EP	21/08/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
Removed and Replaced L/H Brake Shim. with the New IAW C208B AMM # 32-40-00. Performed at A/C TT: 2593:38 A/C TC/LDG: 4141	Aut	EP	21/08/2022

20. CORROSION INFORMATION		17	18	19
LOCATION	CAUSE OF DAMAGE			
	☐ Environment			
	☐ Internal Leakage			
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill			
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain			
☐ Others	☐ Wet Insulation Blanket			
		☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE	
NOTICE OF INSPECTOR				

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Brake Shim	068-02800	1	-	-	✓	-

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
General Tools	-	-	OK



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC - 004	WO/044-SMS/VIII/2022		7A-20-00	22-08-2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SMS	C208B-Ex			
9. ZONE	10. STA	11. MTC TYPE		
Engine	TMH	Replacement		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
R/H Igniter was worn out.	<i>[Signature]</i>	22/08/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
Removed and Replaced R/H Igniter with the New. 1AW C208B AMM # 7A-20-00. Performed at A/C TT: 2593:3.8 A/C TC/LDG: 4141	amt	<i>[Signature]</i>	22/08/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Igniter	CH34055	1	-	-	✓	-
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
General tools	-	-	OK			
Torque wrench	10268839	Feb 2023	OK			

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	---------------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 005	WO/041-SN6/VII/2022		74-20-00	22-08-2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SN6	C208B-EX				
9. ZONE	10. STA	11. MTC TYPE			
Engine	TMH	Replacement			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
L/H Igniter was worn out	BP	22/08/2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
Removed and Replaced L/H Igniter. with the New. IAW E208B AMM # 74-20-00 Performed at A/C TT: 2593:38 A/C TC /LDG: 4141	Aut	BP	22/08/2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Igniter	CH 34055	1	-	-	✓	-

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
General tools	-	-	ok
Torque wrench	10268839	Feb 2023	ok.

Appendix B03 – PT6A-140 Engine Run Performance Sheet

Reg. Mark : PK - SNG

WO/FML No. : WO/044-SNG/VIII/2022

PRE – INSPECTION	
Location	TMH
Date	22 Aug 2022
Cycle	
Filed Barometric	34°C 29,92 inHg
OAT	34°C
Altitude	100 Ft

POST – INSPECTION	
Location	TMH
Date	22 Aug 2022
Cycle	
Filed Barometric	29,92 inHg
OAT	35°C
Altitude	140 Ft

PRE – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1880
ITT	841 °C	809 °C
Ng	102,6 %	100,7 %
Wf	570	539
Oil Press		91 °C
Oil Temp		69 °C
Start Temp		740 °C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1890
ITT	841 °C	806 °C
Ng	102,6 %	99,5 %
Wf	565	536
Oil Press		92 °C
Oil Temp		61 °C
Start Temp		741 °C

Engine Run Up Checks					
Inertial ☒	EPL ☒	OVG ☒	Stby Alt ☒	BOV ☒	Brake ☒
Randomown ☒					
NOTE:					
1. Brake system at Torque 2000 ft-lbs.		3. EPL check can't exceed 4% Ng per second.		5. Low idle at 55.5 - 57% 40Amps.	
2. Inertial Separator at Torque 400 ft-lbs.		4. Standby Alt at 80% Ng.		6. High idle at 64 - 66% Ng 40Amps	

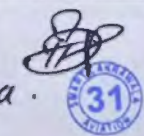
Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

PERFORMED BY			
Name	Sign & Stamp	Date	Location
D. Arya Parnara		22-08-2022	TMH


Reg. Mark : PK - SNG
 MSN : C208B-5543
 TSN / CSN : 2593:38/4141

Date : 21-08-2022
 Station : TMT
 WO No. : WO/044-SNG/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611		
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	N/A
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		


Chapter 12 – Inspection Document 06

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<i>Arya</i>	<i>Engineer</i>		<i>9505</i>
<i>Aditya</i>	<i>OJT / MECHANIC</i>	<i>ant</i>	





RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.








Name : *D. Arya Permana* Stamp : 
 Signature :  Place/Date : *TMH / 22-08-2022*


Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection


Reg. Mark : PK - SNG Date : 22 - 08 - 2022
MSN : C208B-5543 Station : TMH
TSN / CSN : 2593:38/4141 WO No. : WO/044-SNG/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds.		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to- fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING / REPLACEMENT) P/N OFF: AN 6235-3A P/N ON: AN 6235-3A		

Chapter 51 – Engine PT6A-140 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F731006	130	Do a check of the drain valve for installation and leaks		
		NOTE: There is no need to remove the drain valve if there is no leaks.		
F731007	130	Do a check of the flow divider for installation and leaks.		
F731008	130	Do a visual inspection of the P3 filter and drain valve.		
F731015	130	Do a visual inspection of Fuel Pump outlet filter. (CLEANING / REPLACEMENT) P/N OFF: <u>AMP 6235-3A</u> P/N ON: <u>AMP 6235-3A</u>		
F731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
F732001	130	Do a check of the FCU for installation, linkages and pneumatic tubes.		
F792000	130	Inspect and clean oil filter for debris.		

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<u>Arya</u> Adit	<u>Engineer</u> OST/MECHANIC	 Adit	<u>1505</u>

RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name :	<u>D. Arya Rimana</u>	Stamp :	
Signature :		Place/Date :	<u>22 Aug 2022 / TMH</u>


MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 52 – Engine PT6A-140 200 Hours Inspection

Reg. Mark : PK - SNG
MSN : C208B-5543
TSN / CSN : 2593:38 / 9191


Date : 22 Aug 2022
Station : TMH
WO No. : WO/044-SNG/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
D. Bya Bernara	Engineer		9505
ADITYA	ODT / MECHANIC	Aut	

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : D. Bya Bernara. Stamp : 
Signature :  Place/Date : TMH / 22 Aug 2022

Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection

Reg. Mark : PK - SNG Date : 22 Aug 2022
 MSN : C208B-5543 Station : TMH
 TSN / CSN : 2593:38/4191 WO No. : WO/044-SNG/VIII/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A- 140 200 Hours or 6 Months Inspection Items ***				


PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<u>Arya</u>	<u>Engineer</u>		<u>2505</u>
<u>Aditya</u>	<u>OST / MECHANIC</u>	<u>adit</u>	

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : D. Arya Permana Stamp : 
 Signature :  Place/Date : TMH / 22 Aug 2022

	EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR	PT. SMART CAKRAWALA AVIATION
		DEPARTMENT TEKNIK Form: SCA/MTC/023

DATE : 22 Aug 2022	A/C REG : PK-SNG
A/C TYPE : C208B	CHECKER : Arya . SIGN : 

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	19092030036	Jan 2029	Good
2	Co-Pilot Life Vest	P01202-201	19092030051	Jan 2029	Good
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	NPN	NSN	Jun 2023	Good
14	Crash Axe Installed	-	-	-	Good
15	Fire Extinguisher	C352	#60589352	Sept 2022	Good
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					
18	Flash light	NPN	NSN	-	Good



Aircraft Registration: **PK-SNG**

WO# Nr: WO/044-SNG/VIII/2022

Parts Used Sheet

Special Tool Used

[illegible]

