



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 08 & Add Task Due at 3569 Hours.	No.	WO/076-SNK/IV/2022
	Date	10-Apr-2022
	A/C Reg.	PK-SNK C208-00658
Reference : MP C208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM

To : Engineer In Charge

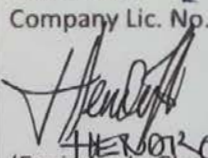

Description :

1. Perform Inspection Inspection Document 08 & Add Task Due at 3569 Hours.
2. Make an entry in Maintenance Log.
3. Return the Completed Work Order and Form to PPC.

#If any finding, please close the routine card, and transferred to inspection card.

Additional Work :

- SEE INSPECTION CARD (IC) LIST FOR COMPLETION ADDITIONAL WORK

Compliance Statement INSPECTION DOCUMENT 08 & ADD TASK CARRIED OUT	Sign & Date Company Lic. No.:  HERNANDO (Engineer In Charge) 	Signature  (Technical Manager)
---	--	---

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JOWO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED	
10-Apr-2022	WO/076-SNK/IV/2022	Inspection Doc. 08 & Add Task	01 MAY 2022	
A/C Type		Mfg. Serial Number	A/C Registration	
C208		C208-00658	PK-SNK	
AIRCRAFT DATA				
Subject	Pos #	Serial Number (SN)	TTSN/TCSN	
Engine	#1	PCE-PC2327	3568:07 / 5171	
	#2	-		
Propeller/Rotor	#1	190345	3568:07 / 3568:07	
	#2	-		
Landing Gear	NLG		5171 / 5171	
	LH MLG		5171 / 5171	
	RH MLG		5171 / 5171	
PACKAGE COVERED				
No	Subject	Qty	Remark	
1	Non-Routine Card	2	#001; #002	
2	Inspection Card	1	✓	
3	Work Order	1	✓	
4	Summary Inspection List	1	✓	
5	Material and Tool List	-		
6	Escalation form	-		
7	CRS (SMI / Unscheduled Maintenance)	1	✓	
INSPECTION CARD (IC) LIST (Finding during maintenance)				
No	Taskcard Ref	Subject	Status	Name/ Sign & Stamp
			Open	Close
IC-001	32-40-00-222	MAIN LANDING GEAR WHEELS AND TIRES DETAINED (NSP)	-	✓
IC-002	D121001	BRAKE SYSTEM SERVICING	-	✓
IC-003				
IC-004				
IC-005				
IC-006				


<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					


Prepared by :
Technical Support


Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager


XXXXXXXXXXXXXXXXXXXXXXXXXXXX


XXXXXXXXXXXXXXXXXXXXXXXXXXXX


XXXXXXXXXXXXXXXXXXXXXXXXXXXX


XXXXXXXXXXXXXXXXXXXXXXXXXXXX



SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/076-SNK/IV/2022

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B02	PT6A-114A ENGINE GROUND RUN PERFORMANCE	01 MAY 22		HENDRO	
2	CHAPTER 06	INSPECTION DOCUMENT 0A	30 APR 22		ROHPININDO	
2	CHAPTER 12	INSPECTION DOCUMENT 06	30 APR 22		ROHPININDO	
3	CHAPTER 13	INSPECTION DOCUMENT 07	30 APR 22		HENDRO	
4	CHAPTER 14	INSPECTION DOCUMENT 08	30 APR 22		HENDRO	
5	CHAPTER 44	ENGINE PT6A-114A 100 HOURS/MINOR INSPECTION	01 MAY 22		HENDRO	
6	CHAPTER 45	ENGINE PT6A-114A 200 HOURS INSPECTION	01 MAY 22		HENDRO	
7	CHAPTER 46	ENGINE PT6A-114A 200 HOURS / 6 MONTHS INSPECTION	01 MAY 22		HENDRO	
8	CHAPTER 47	ENGINE PT6A-114A 400 HOURS INSPECTION	01 MAY 22		HENDRO	
9	OOP34003	CONDUCT VISUAL INSPECTION FOR GSA 80/81 SERVOS	30 APR 22		HENDRO	
10	OOP34004	CONDUCT VISUAL INSPECTION AND CHECK SLIP CLUTCHES OF GSM 85A/86	30 APR 22		HENDRO	
11	NRC 001	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT (AAD9-18-1)	30 APR 22	0.3 HRS	Azi	
12	NRC 002	VACUUM RELIEF VALVE FILTER REPLACEMENT (B3-5-1)	30 APR 22	0.1 HRS	Azi	

13	Form SCA/MTC/023	EMERGENCY EQUIPMENT CHECKLIST	01 MAY 24	05 MAR	HENDR0	
----	---------------------	-------------------------------	-----------	--------	--------	---



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION (CRS-SMI)

A/C TYPE : CESSNA 208	TTSN : 3568:07
A/C REG : PK-SNK	TCSN : 5171
MSN : C208-00658	DATE : 01 MAY 22

TYPE OF INSPECTION : INSPECTION DOCUMENT 08 & ADD TASK
 DUE AT : 3569 HOURS
 REFF : MP C208B REV.10

EXCEPTION
 - REF TO CHAPTER 47 MP C208B - ENGINE PT6A-114A 400 HOURS INSPECTION
 ITEM CODE NO. E 731004 ZONE 130 TASK "DO A LEAK TEST AND A FUNCTIONAL
 TEST OF FUEL MANIFOLD ADAPTER AND NOZZLE ASSEMBLIES" RAISE STE WITH
 APPROVAL NO.001/CI/STE/SNK/SCA/IV/2022 DUE TO PART SHIPMENT IN PROGRESS
 WITH SPECIAL ACTION/ATTENTION/INSTRUCTION INCORPORATED

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
 Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
HENDRO.T	AIRFRAME & POWER PLANT	5583/28		01 MAY 22
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS INSPECTION
 DUE AT : 3669 HOURS

Form: SCA/MTC/049

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 001	WO/076-SNK/W/2022	M. Azil Andika		30-APRIL-2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNK	C208				
9. ZONE	10. STA	11. MTC TYPE			
MLG					

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
LH MAIN TIRE WORN OUT		20/04/22

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED LH MAIN TIRE WITH A NEW 1AW C208AMM CHAP 32-40-00 Performed at A/C TT: 3568:07 A/C TC/LDG: 5171			30/04/22

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
MAIN TIRE	078-446-1	1	1196T00156		✓	
BOLT	AWS-41A	9	NSN	NSN	✓	
INNER TUBE	GL-291506	1	NSN	NSN	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	TA-0250	NOV-2023	SERVICEABLE
TIRE PRESSURE GAUGE	0998/2105	AUG-2023	SERVICEABLE
ANALOG METER CALIPER	CD-6" ACX	NOV-2023	SERVICEABLE

	INSPECTION CARD (Form: SCA/MTC/048)	TECHNICAL DEPARTMENT
---	---	-------------------------

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
1C-002	WO/GT6-SNK/11/2022	M. Azu Andika		30-Apr-2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNK	C208			
9. ZONE	10. STA	11. MTC TYPE		
MLG				

13. DESCRIPTION/DEFECT-IF FINDING OF CPOI INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
RH INBOARD BRAKE LINING WORN OUT		30/24/22

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED LH INBOARD BRAKE LINING WITH A NEW ONE 1AW C208 AMM CHAP 32-40-00 Performed at A/C TT: 3568:07 A/C TC/LDG: 5171			30/04/22

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	ddb-03300	4	NSN	NOV	✓	-

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	TA-0250	NOV-2023	SERVICEABLE
CALIPER	CD-6" ASX	NOV-2023	SERVICEABLE



MAINTENANCE PROGRAM **CESSNA C208/C208B**

Appendix B02 – PT6A-114A Engine Run Performance Sheet

Reg. Mark : PK - SNK

WO/FML No. : WO/076-SNK/W/2022

PRE – INSPECTION	
Location	NABIRE
Date	29 APRIL 2022
Cycle	5171
Filed Barometric	1050
OAT	31°C
Altitude	60ft

POST – INSPECTION	
Location	NABIRE
Date	01 MAY 2022
Cycle	5171
Filed Barometric	1050
OAT	30°C
Altitude	60 ft

PRE – INSPECTION		
	Target	Actual
Tq	1865	1865
Np	1900	1870
ITT	785 °C	750 °C
Ng	99.1 %	98.6 %
Wf	450	448
Oil Press		90 °C
Oil Temp		77 °C
Start Temp		745 °C

POST – INSPECTION		
	Target	Actual
Tq	1865	1865
Np	1900	1870
ITT	780 °C	749 °C
Ng	99 %	98.5 %
Wf	450	443
Oil Press		92 °C
Oil Temp		82 °C
Start Temp		722 °C

Engine Run Up Checks

Inertial ☒ EPL ☒ OVG ☒ Stby Alt ☒ BOV ☒ Brake ☒ Randown ☒

NOTE:

1. Brake system at Torque 1500 ft-lbs.
2. Inertial Separator at Torque 400 ft-lbs.
3. EPL check can't exceed 4% Ng per second.
4. Standby Alt at 80% Ng.
5. Low idle at 52.5 – 53.5% 40Amps.
6. High idle at 64 – 66% Ng 40Amps.

Engine Performance Target Table Cessna C208

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	772	775	778	780	785	790	793	795	797	800	800	800	802	805	810
Ng (%)	98.5	98.5	99	99	99.1	99.2	99.4	99.5	99.5	100	100	100.2	100.5	100.7	100.9
WF (PPH)	450	450	450	450	450	450	450	450	450	450	450	450	448	448	446

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 465 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

- ENGINE PERFORMANCE CHECK
FOUND SATISFACTORY

PERFORMED BY

Name	Sign & Stamp	Date	Location
HENDRO		01 MAY 22	NABIRE

Revision No. : 03
SCA/TEK/1-001
26 September 2019

Page B02.1



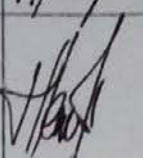


MAINTENANCE PROGRAM CESSNA C208/C208B

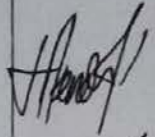
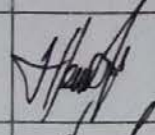
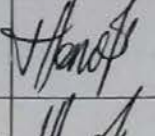
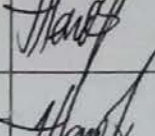
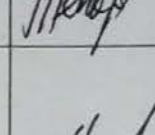
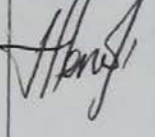
Chapter 6 – Inspection Document 0A




Reg. Mark : PK - SMC
MSN : 208 - 00658
TSN / CSN : 3568:07 / 5171

Date : 20 - April - 2022
Station : NAGUE
WO No. : WO / 076 - SMC / 11 / 2022

TASK NUMBER	TASK	SIGNATURE	
		SIGN	STAMP
05-20-00-280	Aircraft Records Check		
12-10-01-610	Hydraulic Brake System Servicing		
24-33-00-720	Concord Sealed Lead Acid Battery Functional Check (Capacity Check) EPV Voltage : <u>29.00</u> Volt Result : <u>95.2</u> %		
25-10-00-220	Crew Seats Detailed Inspection		
25-10-00-710	Inertia Reel Operational Check		
27-10-00-721	Aileron System Functional Check Aileron Wing Cable Tension 40 ± 5 lbs (178 ± 22 N) @ 21°C (70°F) Ref. 27-10-00 Figure 602 Result : <u>41</u> lbs Aileron Fuselage Cable Tension 20 ± 5 lbs (89 ± 22 N) @ 21°C (70°F) Ref. 27-10-00 Figure 603 Result : <u>22</u> lbs Turn the control wheel so that the stop bolt touches the right bellcrank. Left aileron up travel must be 25 + 4 or 0 degrees. Result : <u>25.1</u> degrees Turn the control wheel so that the stop bolt touches the left bellcrank. Left aileron down travel must be 16 +1 or -0 degrees Result : <u>16</u> degrees		
27-50-00-220	Flap Actuator Mount Bracket Detailed Inspection		

TASK NUMBER	TASK	SIGNATURE	
		SIGN	STAMP
27-50-00-221	Flap Bell Crank Detailed Inspection		
27-50-00-720	Flap System Functional Check Make sure that cable tension is 35 ±5 lbs (156 ±22 N) @ 21°C (70°F) Ref. 27-50-00 Figure 602 Result: <u>35</u> lbs		
32-20-00-220	Nose Landing Gear Detailed Inspection		
32-40-00-220	Brakes Detailed Inspection Brake Disc Thickness (minimum 0.537 inch) LH: <u>0.546</u> inch / RH: <u>0.540</u> inch Brake linings Thickness (minimum 0.100 inch) Outboard LH: <u>0.160</u> inch. Outboard RH: <u>0.189</u> inch Inboard LH: <u>0.155</u> inch. Inboard RH: <u>0.150</u> inch		
32-40-00-222	Main Landing Gear Wheels and Tires Detailed Inspection Tire Pressure (56 ± 5 psi for APE STOL Installed & 45 ± 5 psi for non-APE STOL) Tire Pressure LH: <u>59</u> psi Tire Pressure RH: <u>59</u> psi		
32-40-00-224	Nose Landing Gear Wheel and Tire Detailed Inspection Tire Pressure (36 ± 6 psi) Tire Pressure : <u>40</u> psi		
32-10-00-220	Main Landing Gear Detailed Inspection Free Play Check (maximum 0.014 inch / 0.3556 mm) LH: <u>0.009</u> inch / RH: <u>0.010</u> inch		
53-10-00-214	Empennage and Horizontal Stabilizer Zonal Inspection		
53-10-00-210	External Fuselage Zonal Inspection		
53-10-00-211	Internal Cockpit Zonal Inspection		
53-10-00-212	Internal Cabin Zonal Inspection		

TASK NUMBER	TASK	SIGNATURE	
		SIGN	STAMP
53-10-00-213	Internal Tail Cone Zonal Inspection		
57-10-00-210	Wing Zonal Inspection		
61-11-00-720	McCauley Propeller Functional Check		
71-20-00-220	Engine Mounts and Firewall Detailed Inspection		
71-00-01-210	Engine Compartment Zonal Inspection		
76-10-00-720	Engine Controls Functional Check Low Idle Ng (52% - 55%)		
	Result: <u>53.5</u> %		
	High Idle Ng (64% - 66%) Result: <u>65</u> %		

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
			5583
M. Aziz Andika	ENGINEER		9633
ROHPININDO. N.S.P	ENGINEER		9634

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : ROHPININDO. N.S.P Stamp : 
Signature :  Place/Date : NBX/30-APR-2022



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06



Reg. Mark : PK - SNK
MSN : 208-00658
TSN / CSN : 3568:07/571



Date : 30 APR 2022
Station : NABTZE
WO No. : WO/076-SNK/10/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220		
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06


ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220		
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
			5583
M. ALI ANDIKA	ENGINEER		9633

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : ROHPININDO N.S.P Stamp : 

Signature :  Place/Date : NDX / 30-APR-2022



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07

Reg. Mark : PK - GJK
MSN : 208-00658
TSN / CSN : 3568:07 / 5171

Date : 30 APRIL 2022
Station : NABIME
WO No. : WO/076- GJK/IV/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610		
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720		
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221		

Revision No. : 03
SCA/TEK/1-001
26 September 2019

Page 13.1

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720	<i>[Signature]</i>	
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220	<i>[Signature]</i>	
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220	<i>[Signature]</i>	
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72	<i>[Signature]</i>	
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220	N/A	
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<i>[Signature]</i>	ENGINEER	<i>[Signature]</i>	5583
M. Azil Andika	ENGINEER	<i>[Signature]</i>	9633
ROHPPININDO, N.S.P	ENGINEER	<i>[Signature]</i>	9634

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : *[Signature]* Stamp : 
 Signature : *[Signature]* Place/Date : *[Signature]* / 30-APR-22



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 14 - Inspection Document 08

Reg. Mark : PK-SNK Date : 01 MAY 2022
MSN : 208-00658 Station : NABIRE
TSN / CSN : 3568:07 / 5171 WO No. : W0/076-SNK/N/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-770		
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRO	ENGINEER		5585
Al. Azm. Andika	ENGINEER		9633



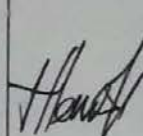
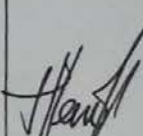
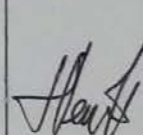
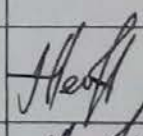



RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : HENDRO Stamp :
Signature : Place/Date : NABIRE / 01 MAY 2022

Chapter 44 – Engine PT6A-114A 100 Hours/Minor Inspection

Reg. Mark : PK - SNK Date : 01 MAY 2022
 MSN : 208-00658 Station : NABIRE
 TSN / CSN : 3568:07/5171 WO No. : WO 1076-SNK/1V/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E710001	130	Do a check of the FCU manual override system for static operation.		
E710003	130	Do a compressor performance recovery wash.		
E710004	130	Inspect all accessible connections, clamps and brackets for attachment. Inspect accessible lockwire and safety cable for security and installation.		
E710005	130	Inspect of wear, chafing, cracks and corrosion for tubing, wiring, control linkage, hose assemblies. NOTE: Visually inspect insulated air tubes for signs of swelling, cracking, bulging of rubber sheath material. Refer to repair section and SB1687. Replace as necessary.		
E710006	130	Examine linkages. Pay particular attention to rear linkage cam box, fuel control unit arm, telescopic rod and rod end fittings. Disconnect rod ends and clean using solvent (PWC11-027) or (PWC11-031). Lubricate with light grease (PWC04-001) after engine external wash. Examine rod end for corrosion, roughness in rotation, side play and radial play. After lubrication reinstall rod ends and torque to specified value (Ref 76-10-00). Check free movement of linkage.		
E710007	130	Inspect attachment and linkages, air, oil and fuel lines (Ref. 73-10-07/-08). NOTE: Visually inspect insulated air tubes for signs of swelling, cracking, bulging of rubber sheath material. Refer to repair section and SB1687. Replace as necessary.		
E710011	130	Performed Deceleration Check		
E720001	130	Do a visual inspection of the engine exhaust duct welds.		
E720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
E720003	130	External surfaces, and fireseal mount ring brackets for cracks, distortion, and corrosion of gas generator case (Ref. 72-30-04).		



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 44 – Engine PT6A-114A 100 Hours/Minor Inspection

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRY	ENGINEER	<i>[Signature]</i>	5583
FORNARO, M.S.P.	ENGINEER	<i>[Signature]</i>	9874

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.


Name : HENDRY Stamp : (28)
Signature : *[Signature]* Place/Date : KABARE / 01-MAY 22

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 45 – Engine PT6A-114A 200 Hours Inspection



Reg. Mark : PK-SNK Date : 01 MAY 2022
 MSN : 208-00658 Station : NABIRE
 TSN / CSN : 3568:07/5171 WO No. : W0/076-SNK/V/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E793001	130	Check magnetic chip detector(s) for continuity, open circuit must exist indicating no contamination at pole tips.		
*** End of Engine PT6A-114A 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HERNANDEZ	ENGINEER		5583

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 
 Signature :  Place/Date : NABIRE / 01 MAY 2022



MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 46 - Engine PT6A-114A 200 Hours or 6 Months Inspection

Reg. Mark : PK - SNK Date : 01 MAY 2022
MSN : 208-00658 Station : NABIRE
TSN / CSN : 3568.07 / 5171 WO No. : WD/076-SNK/IV/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A-114A 200 Hours or 6 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRO	ENGINEER		8583


RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : HENDRO Stamp :
Signature : Place/Date : NABIRE / 01 MAY 2022

Chapter 47 – Engine PT6A-114A 400 Hours Inspection

Reg. Mark : PK-SNK Date : 01 MAY 2022
MSN : 208-00658 Station : NABIRE
TSN / CSN : 3568:07 / 5171 WO No. : WO/076-SNK/IV/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E724000	130	Do borescope inspection of hot section components.		
E731004	130	Do a leak test and a functional test of the fuel manifold adapter and nozzle assemblies. Note: Engines ON fuel nozzle in-situ cleaning program (Ref. Task 71-00-00- 160-808). Test fuel nozzles and refurbish as necessary.		
E741001	130	Do a visual inspection of the ignition exciter.		
E741011	130	Do a visual inspection of the ignition cables.		
E742002	130	Do a visual inspection of the spark igniter/glow plugs.		
*** End of Engine PT6A-114A 400 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRO	ENGINEER		5583
ROH PIANDO. N.S.P	ENGINEER		9834

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name :  Stamp : 
Signature :  Place/Date : NABIRE / 01 MAY 2022

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/076-SNK/IV/2022	10-Apr-2022	COMPONENT REPLACEMENT	PK-SNK
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
001	37		
9. ZONE	10. PANEL		
ENGINE			

11. DESCRIPTION PERFORM VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT DUE TO TIMEX REMOVED P/N: AAD9-18-1			
REFERENCE	☒ AMM Ch. 37-10-00	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
REPLACED WITH A NEW FILTER FOUND SATISFY				
Performed at A/C TT : 3568:07 A/C TC /LDG : 5171				
FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				20/04/22

1. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	AAD9-18-1	1		NEW

1. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS

Distribution : 1. White : PPC/Engineering 2. Red : Quality 3. Yellow : Retain on Log Book

NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/076-SNK/IV/2022	10-Apr-2022	COMPONENT REPLACEMENT	PK-SNK
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
002	37		
9. ZONE	10. PANEL		
ENGINE			

11. DESCRIPTION
 PERFORM VACUUM RELIEF VALVE FILTER REPLACEMENT DUE TO TIMEX
 REMOVED
 P/N: B3-5-1

REFERENCE	☒ AMM Ch. 37-10-00	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT	MECH	ENG	INSP ()
REPLACED WITH A NEW FILTER FOUND SATISFY			
Performed at A/C TT : 3568 : 07 A/C TC /LDG : 5171			
FINDING	☐ Y	☐ N	ACT MHR :
INSPECTION CARD (IC) #			DATE/TIME (DD/MM/YY)
			30/04/22

1. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	B3-5-1	1		NEW

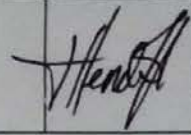
1. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS


Distribution : 1. White : PPC/Engineering 2. Red : Quality 3. Yellow : Retain on Log Book


MAINTENANCE PROGRAM **CESSNA C208/C208B**

Appendix C04 – OOP34004 / GSM 85A/86

Reg. Mark	: PK - SNK	Date	: 30 APRIL 2022
MSN	: 208-00658	Station	: NABIRE
TSN / CSN	: 3568:07/5171	WO No.	: WD/076-SNF/IV/2022

NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
01	211 212	Conduct visual inspection and check slip clutches of GSM 85A/86, refer to G1000 Line Maintenance Manual, Doc. No. 190-00869-00, Rev. G.		
*** End of Appendix C04 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRO	ENGINEER		5583

RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name	: HENDRO	Stamp	: 
Signature	: 	Place/Date	: NABIRE / 30-APR-22

MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix C03 – OOP34003 / GSA 80/81 Servos

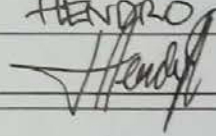
Reg. Mark : PK - SNK Date : 30 APR 2022
MSN : 208-00658 Station : NABRE
TSN / CSN : 3568:07/5171 WO No. : WO/076-SNF/IV/2022

NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
01	211 212	Conduct visual inspection for GSA 80/81 Servos refer to G1000 Line Maintenance Manual, Doc. No. 190-00869-00, Rev. G		
*** End of Appendix C03 Items ***				

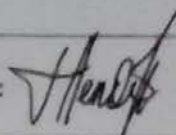
PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
HENDRO	ENGINEER		5583

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : HENDRO Stamp : 
Signature :  Place/Date : NABRE / 30 APR 2022

	EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR	PT. SMART CAKRAWALA AVIATION
		DEPARTMENT TEKNIK Form: SCA/MTC/023

DATE : 01 MAY 2022	A/C REG : PK-SNK
A/C TYPE : C-208	CHECKER : HENDRO SIGN: 

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	19041660002	MAY, 2023	Sat
2	Co-Pilot Life Vest	P01074-101W	17060500076	JULY, 2022	Sat
3	Pax Life Vest	-	-	-	-
4	Pax Life Vest	-	-	-	-
5	Pax Life Vest	-	-	-	-
6	Pax Life Vest	-	-	-	-
7	Pax Life Vest	-	-	-	-
8	Pax Life Vest	-	-	-	-
9	Pax Life Vest	-	-	-	-
10	Pax Life Vest	-	-	-	-
11	Pax Life Vest	-	-	-	-
12	Pax Life Vest	-	-	-	-
13	First Aid Kit	SCA-005/FAK	SCA-005	SEPT. 2022	Sat
14	Crash Axe Installed	CAMEL	NSN	ON COND.	Sat
15	Fire Extinguisher	C-352	F-60580834	APRIL, 2023	Sat
16	Life Raft (If Installed)	-	-	-	-
17	Survival Kit (If Installed)	-	-	-	-
OTHERS					
18	FLASH LIGHT	POLICE 711	NSN	ON CONDITION	Sat



Aircraft Registration: **PK-SNK**

WO# Nr: **WO/076-SNK/IV/2022**

Parts Used Sheet

[illegible]



Aircraft Registration: **PK-SNK**

WO# Nr: **WO/076-SNK/IV/2022**

Parts Used Sheet

[illegible]