

RETURN TO SERVICE

AIRCRAFT TYPE : C 208B - EX REGN NO : PK-SNP

CUSTOMER : SMART CAKRAWALA AVIATION AIRFRAME HRS : 3198:16

AIRFRAME CYCLES : 3198:16 + 5973 ENGINE HRS & CYCLES : 118:57 / 206

TYPE OF WORK : INSPECTION DOCUMENT 12 AND ADDITIONAL TASK DUE AT 3200 HOURS

MANUAL REFERENCE : 11616 REVISION 37, AND PT6A-140 REV 14

NEXT INSPECTION : 3300 HOURS / 100 HOURS INSPECTION

The aircraft airframe, aircraft engine, propeller or appliance identified above was repaired and inspected in accordance with current instructions contained in the operator maintenance manual, the maintenance rules of the DGAC under which the operator is certificated and is determined to be approved for return to service except as specified in deferred defect list. Pertinent details of the repair are on file at this AMO under work.

Order No. : WO/078-SNP/X1/2021

Date : 16 NOV 2021

Signed
and
Stamp:



VANI ANANTA WILKRAMA

(Signature of authorized representative)

PT.SMART CAKRAWALA AVIATION
DGAC 145D/1003

For :

(Approve Maintenance Organization name & certification number)

Gedung Smartdeal Lt.4 Jalan Cideng Timur No.16A, Jakarta Pusat 10130, Indonesia

(Address)



AMO MANUAL

FORMS

SCA-MTC 058 – MAINTENANCE RELEASE AND CUSTOMER ACCEPTANCE

MAINTENANCE RELEASE & CUSTOMER ACCEPTANCE

AIRCRAFT TYPE : C 208B - EX

REGN NO : PK-SNP

MAINTENANCE ORG : SMART CAKRAWALA
AVIATION

AIRFRAME HRS : 3198:16

TYPE OF WORK : INSPECTION DOCUMENT 12 AND ADDITIONAL TASK DUE AT 3200 HOURS

MANUAL REFERENCE : 1 VIEW REVISION 37 AND PT6A-140 REVISION 14

I HEREBY CERTIFY AND ACCEPT THAT THE WORK SPECIFIED IN THE WORK SCOPE ABOVE
HAVE BEEN PERFORMED IN ACCORDANCE WITH THE DGAC AIRWORTHINESS REGULATION
AND MEET TO PT. SMART CAKRAWALA AVIATION REQUIREMENTS IS IN
AIRWORTHY CONDITION AND SAFE FOR FLIGHT .

Order No. : WO 1078 - SNP / X1 / 2021

Date : 16 NOV 2021

Signed : _____

(Signature of authorized representative)

For : _____

(Air operating Certificate holder name & certification number)

(Address)

AIRCRAFT CHECK WORK SUMMARY

(Form: SCA/MTC/051)

DATE OF ISSUED	JOWO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED
01-Nov-2021	WO/078-SNP/XI/2021	Inspection Doc. 12 & Add Task	16 NOV 2021

A/C Type	Mfg. Serial Number	A/C Registration
C208B	C208B-5495	PK-SNP

AIRCRAFT DATA			
Subject	Pos #	Serial Number (SN)	TTSN/TCSN
Engine	#1	PCE-VA0723	113:48/204 118:57/206
	#2	-	
Propeller/Rotor	#1	181158	154:56 155:48
	#2	-	
Landing Gear	NLG		113:48/204 118:57/206
	LH MLG		3195:02/54391 3198:16/5473
	RH MLG		3195:02/54391 3198:16/5473

PACKAGE COVERED			
No	Subject	Qty	Remark
1	Non-Routine Card	4	#001 ; #002 ; #003 ; #004 ; #005
2	Inspection Card	1	
3	Work Order	1	
4	Summary Inspection List	1	
5	Material and Tool List	-	
6	Escalation form	-	
7	CRS (SMI / Unscheduled Maintenance)	1	

INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
<u>IC-001</u>	D121001	BRAKE LINING R/H SIDE WORN OUT		✓	
<u>IC-002</u>	D121001	BRAKE CALIPER R/H SIDE CLEARING		✓	
<u>IC-003</u>	D121001	BRAKE SHIM R/H SIDE WEAR		✓	
<u>IC-004</u>	D121001	BRAKE PIN R/H SIDE WEAR		✓	
<u>IC-005</u>	A 275001	FLAP COUPLING FOUND WEAR		✓	
<u>IC-006</u>					

SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/078-SNP/XI/2021

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	16/Nov/21		VANI ANANTA WIKRAMA	
2	CHAPTER 12	INSPECTION DOCUMENT 06	13/NOV-21		DENI SOBALI	
3	CHAPTER 13	INSPECTION DOCUMENT 07	16/NOV 2021		VANI ANANTA WIKRAMA	
4	CHAPTER 14	INSPECTION DOCUMENT 08	13/NOV-21		DENI SOBALI	
5	CHAPTER 15	INSPECTION DOCUMENT 09	15/NOV 21		VANI ANANTA WIKRAMA	
6	CHAPTER 16	INSPECTION DOCUMENT 10	14 NOV 2021		VANI ANANTA WIKRAMA	
7	CHAPTER 17	INSPECTION DOCUMENT 11	14 NOV 21		DENI SOBALI	
8	CHAPTER 18	INSPECTION DOCUMENT 12	14 NOV 2021		VANI ANANTA WIKRAMA	
9	CHAPTER 32	INSPECTION DOCUMENT 26 (BATTERY CAPACITY CHECK)	15/NOV 21		DENI SOBALI	
10	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	15/NOV 21		DENI SOBALI	
11	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	16 NOV 2021		VANI ANANTA WIKRAMA	
12	CHAPTER 53	ENGINE PT6A-140 200 HOUR / 6 MONTHS INSPECTION	16 NOV 2021		VANI ANANTA WIKRAMA	
13	73-10-00	FUEL NOZZLE REPLACEMENT (INITIALLY 200 HRS)	15 NOV 21		DENI SOBALI	
14	72-00-00	BORESCOPE HOT SECTION INSPECTION (INITIALLY 200 HRS)	POSTPONED DUE TO RETRAINING 81:03 HOUR			

	INSPECTION CARD (Form: SCA/MTC/ 048)	TECHNICAL DEPARTMENT
---	--	---------------------------------

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-001	W01078-SWP(X)/2021	-	D12/001	13 NOV 2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNP-5495	C208B-EX	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
121	BERAH	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
BRAKE LINING R/H SIDE WORN OUT	DEVI FOBALI	13 NOV 21

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REMOVES AND REPLACE BRAKE LINING WITH NEW. 1 AC C208B CHAPTER 32-40-00. 3198:16 Performed at A/C TT: 3199:02+ A/C TC /LDG: 5439 5973	 Yohanes D.	 	13 NOV 21

20. CORROSION INFORMATION					
LOCATION	CAUSE OF DAMAGE				
	☐ Environment	-	-	-	-
	☐ Internal Leakage				
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill				
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill				
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain				
☐ Others	☐ Wet Insulation Blanket				
				☐ Other	
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE
NOTICE OF INSPECTOR				-	-

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BRAKE LINING	066-15300	8	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	PATA 36212	April 2023	Good.
GENERAL TOOLS	-	-	Good

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
--	--	--	--	--	-----------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
K-002	W01078 SNP/X1/202	-	072/001	13 NOV 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
MSNP-5495	C208B EX	ARRPAME	-		
9. ZONE	10. STA	11. MTC TYPE			
121	BERAH	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
BRAKE CALIPER R/H SIDE LEAKING.	DENI 80354	13 NOV 21

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
PERFORMED REPAIRED BRAKE CALIPER ASSY WITH NEW O-RING INSTALLED. PERFORMED BLEEDING THE SYSTEM FOUND STAINY REF. TO. C208B CHAPTER 3198.16 Performed at A/C TT: 3198.16 A/C TC /LDG: 32-40-03. 043015473		DENI CORAL 	13 NOV 21

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other	-	-
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR	-	-

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
CALIPER ASSY	001-16101	1 ASSY	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	SATA 96212	AUG 2023	S
GENERAL TOOLS	-	-	Good



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
1C-003	001078-WT/KIPAN	-	D 12/001	13 NOV 2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-WP-5495	C708B-EX	AIRFRAME	-	
9. ZONE	10. STA	11. MTC TYPE		
121	BE7	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
BRAKE SHIM R/H SIDE WEAR	PCW/GOBAL	13 NOV 2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED SHIM WITH NEW REF. C708B CHAPTER 3240-00 3198:16 5973 Performed at A/C TT: 3199-021 A/C TC /LDG: 5432		 	13 NOV 21

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector			
NOTICE OF INSPECTOR			INSP DATE
			-

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
SHIM	068-02800	/	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	Good



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
1C-004	W01078-SNP/K1/2021	-	D121001	13 NOV 2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PR-SNP-5495	C208B-En	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
121	BEJ	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
BRAKE PIN R/H SIDE WEAR.	PPC/ENG	13 NOV 2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED CARRIER PIN WITH NEW REF TO C208B, CHAPTER 32-40-00 3198:16 5473 Performed at A/C TT: 3199:02 A/C TC/LDG: 5439	MECH	ENG. LIC	DATE
	MECH	ENG. LIC	DATE

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
PIN CARRIER	177-00306	16	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	Good

	INSPECTION CARD (Form: SCA/MTC/ 048)	TECHNICAL DEPARTMENT
---	--	-------------------------

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC - 005	WO/078-SNR/x1/2021	-	A 275001	A 275001 15 NOV 2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNR / 5495	C 208B - EX	AIRFRAME	-	
9. ZONE	10. STA	11. MTC TYPE		
231 232	BES	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
FLAP MOTOR COUPLING FOUND WEAR	VAM ANANTA	15 NOV 2021

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED FLAP COUPLING MOTOR WITH A NEW ONE, OPERATIONAL CHECK FOUND SATISFACTORY. (AW C208B MAINTENANCE MANUAL CHAP 27-30-00 3108:16 5473 Performed at A/C TT : 3109:02 A/C TC /LDG : 5470	-	9659	15 NOV 2021

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment	-	-
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR	-	-

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
COUPLING	B100-06	1	MSU	MSU	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	GOOD.

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 12 – Inspection Document 06

Reg. Mark : PK - SNP





Date : 13/Nov 2021

MSN : C208B-5495

Station : BERAU

TSN / CSN : 3138-02/5495
3138-16 / 5473

WO No. : W01078-SNP/x1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	N/A
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	N/A
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		



3

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 13 – Inspection Document 07

Reg. Mark : PK-SUP
MSN : C 208B 5435
TSN / CSN : ~~3198-02/5435~~
3198-16 / 5473



Date : 18 NOV 2021
Station : BES
WO No. : WO/078-SUP/XI/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610	N/A	N/A
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720		
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221		

Revision No. : 03
SCA/TEK/1-001
26 September 2019

Reg. Mark : PK-SNP
MSN : C 208B 5495
TSN / CSN : ~~3198102 / 54351~~
3198116 / 5473

Date : 14 NOV 2021
Station : BEJ
WO No. : WO/078-SNP/X1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
C221201	226 232	Autopilot Servos Lubrication Task 22-12-00-640		
A245001	121 122	Power Distribution Boxes Detailed Inspection Task 24-50-00-220		
A251001	231 232	Crew Seats Detailed Inspection Task 25-10-00-220		
A251003	231 232	Passenger Seats Detailed Inspection Task 25-21-00-220		
B271001	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Spoiler System Functional Check Task 27-10-00-720		
C271003 RII	551 571 651 671	Aileron Trim Tab Actuator (2660044-1) Lubrication Task 27-10-02-641	 N/A	 N/A
		RII Sign: RII Stamp:		
C273001 RII	371 372 375 376	Elevator Trim Tab Actuator (2660017-1) Lubrication Task 27-30-02-640	 N/A	 N/A
		RII Sign: RII Stamp:		
B284103	AUX	Fuel Quantity and Low Fuel Warning Systems Functional Check Task 28-41-00-720		
B313103	312	Flight Data Recorder Underwater Locator Beacon Functional Check Task 31-31-00-721	N/A	N/A
B324001	ENG	Brakes Operational Check Task 32-40-00-710		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 17 – Inspection Document 11

Reg. Mark : PK- SNP


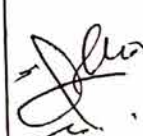

Date : 14/Nov/2021

MSN : C208B-5495

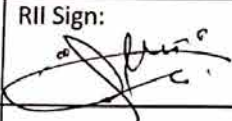

Station : BERAK

TSN / CSN : ~~3198:02/5495~~
3198:16/5473


WO No. : W01078-SNP/X1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B271003	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Aileron System Functional Check Task 27-10-00-721		
C272001	211 212 213 214	Rudder Bar Bearings and Rudder Pedals Lubrication Task 27-20-00-640		
B272001	211 212 213 214 217 218 233 234 253 254 257 258 311 312 320 341	Rudder System Functional Check (Standard Rudder Installation) Task 27-20-00-720		
A273000	373 374	Left and Right Elevator Torque Tube Attach Points (Borescope) Special Detailed Inspection Task 27-30-00-290		
B273001	211 212 213 214 217 218 233 234 253 254 257 258 311 312 320 373 374 375 376	Elevator System Functional Check Task 27-30-00-720		
B275001	251 252 511 611 525 625	Flap System Functional Check Task 27-50-00-720		
B277001	330	Rudder Gust Lock Detailed Inspection (Airplanes 20800237 and On, Airplanes 208B0382 and On and Airplanes equipped with Aero Twin STC SA3649NM) Task 27-70-01-221		
*** End of Inspection Document 11 Items ***				

Reg. Mark	: PK-SNP	Date	: 14 / NOV / 21
MSN	: C208B-5495	Station	: BES
TSN / CSN	: 3199-02-754551 3198:16 / 5473	WO No.	: WD1078-SNP/X1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
C271005 RII	551 571 651 671	Aileron Trim Tab Actuator (2661615-1, 2661615- 9, or 2661615-10) Lubrication Task 27-10-02-642		
		RII Sign: 		
C273003 RII	371 372 375 376	Elevator Trim Tab Actuator (2661215-1 & 2661215-9) Lubrication Task 27-30-02-641		
		RII Sign: 		

*** End of Inspection Document 12 Items ***

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
DENI LOBALI	ENGINEER		9632
VANI ANANTA WIKRAMA	ENGINEER		9650

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name	: VANI ANANTA WIKRAMA	Stamp	: 
Signature	: 	Place/Date	: BES, 14 NOV 2021

Reg. Mark : PK-SNP


Date : 15 NOV 2021


MSN : C208B 5495

Station : BERAU

TSN / CSN : ~~3199-02/54391~~
3198:16/5473

WO No. : WO 1078-SNP/11/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B243301	122	Concord Sealed Lead Acid Battery Functional Check (Capacity Check) EPV Voltage : <u>54</u> Volt Result : <u>50</u> % NOTE: The inspections schedule may be adjusted after the useful battery life is established, based on operations." Task 24-33-00-720		
*** End of Inspection Document 26 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
DENI SOBALI	ENGINEER		9632
YOHAN. S. DEPARA	MECHANIC		

RETURN TO SERVICE


The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : DENI SOBALI

Stamp :








Signature :



Place/Date : BERAU / 15 NOV 2021

Reg. Mark : PK-SNP Date : 15 NOV 2021
MSN : C208B 5935 Station : BES
TSN / CSN : ~~3198:02 / 5439~~ + WO No. : W10/078-SNP/X1/2021
3198:16 / 5973

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F710001	130	Do a check of the FCU manual override system for static operation. For the engines installed with a manual override system only.		
F710003	130	Do a compressor performance recovery wash		
F720000	130	Do a visual inspection of the Control Linkages and wiring.		
F720001	130	Do a visual inspection of the engine exhaust duct welds.		
F720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
F720003	130	Do a visual inspection of the gas generator case and the center fireseal.		
F720004	130	Do a visual inspection of the rear fireseal mounting ring.		
F722001	130	Do a visual inspection of the air inlet screen.		
F723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
F725005	130	Do a detailed inspection of the turbine exhaust duct.		
F731002	130	Do a check for the fuel pump installation and leaks.		
F731003	130	Do a check of the oil-to- fuel heater installation		
F731035	130	Do a visual Inspection of the Fuel - Oil Heat Exchanger Fuel Filter Element (CLEANING/ REPLACEMENT) P/N OFF: <u>AN 6235 - 3A</u> P/N ON: <u>AN 6235 - 3A</u>		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 52 – Engine PT6A-140 200 Hours Inspection

Reg. Mark : PK-SUP Date : 16 Nov 2021
 MSN : C 208B 5935 Station : BES
 TSN / CSN : 3138-02/5433 WO No. : W0/078-SAP/XI/2021
3138-16 / 5473

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793001	130	Do a visual inspection of the chip detector for debris.		
*** End of Engine PT6A-140 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
VANU ANANTA WIKRAMA	ENGINEER		9659

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : VANU ANANTA WIKRAMA Stamp : 
 Signature :  Place/Date : BES / 16 Nov 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 53 – Engine PT6A-140 200 Hours or 6 Months Inspection

Reg. Mark : PK-SNP Date : 16 Nov 2021
MSN : C 208B 5995 Station : BES
TSN / CSN : ~~3198:02 / 5939~~ 1 WO No. : WO/078-SNP/X1/2021
3198:16 / 5973

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
F793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A- 140 200 Hours or 6 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
VANI ANANTA WIKRAMA	ENGINEER		3659

RETURN TO SERVICE

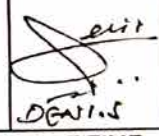
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : VANI ANANTA WIKRAMA Stamp : 
Signature :  Place/Date : BES / 16 NOV 2021

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/078-SNP/XI/2021	01-Nov-2021	REPLACEMENT	PK-SNP
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	73		
9. ZONE	10. PANEL		
ENGINE			

11. DESCRIPTION			
PERFORM FUEL NOZZLE CLEANING/REPLACEMENT (INITIALLY 200 HRS)			
REFERENCE	☒ EMM Ch. 73-10-00	☐	☐ OTHER
RII (*)	☐ Y	☐ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
FOUND FUEL NOZZLE SATISFACTORY AFTER CLEANING AND SPRAY TEST REF TO EMM CHAPTER 73-10-04 3198:16 5973 3198:021 54231 Performed at A/C TT : A/C TC /LDG :				
FINDING	☐ Y ☐ N	ACT MHR :		DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		15	NOV	2021

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
O-RING	AS 3209-009/	58		S
	ST-6202-009			
GASKET	CA 3029566	14		S

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	96212 SATA	Aug 2023	SERVICEABLE
FUEL NOZZLE TEST	SCA FNC-001 KELTRON	-	GOOD

NON ROUTINE CARD (Form: SCA/MTC/047)

15

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/078-SNP/XI/2021	1-Nov-2021	INSPECTION	PK-SNW
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#003	74		
9. ZONE	10. PANEL	-	
ENGINE			

11. DESCRIPTION			
VISUAL INSPECTION OF THE SPARK IGNITER/GLOW PLUGS (INITIALLY 200 HRS)			
REFERENCE	☒ EMM Ch. 74-20-02	☐	☐ OTHER
RII (*)	☐ Y	☐ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
FOUND STATN FACTORY REF TO EMM CHAPTER 74-20-01 3198:16 5973 Performed at A/C TT : 3159:02+ A/C TC /LDG : 5439:1				
FINDING	☐ Y ☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)	
INSPECTION CARD (IC) #		15	NOV	21

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	GOOD

NON ROUTINE CARD (Form: SCA/MTC/047)

16

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/078-SNP/XI/2021	01-Nov-2021	REPLACEMENT	PK-SNP/208B-5495
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#004	37		
9. ZONE	10. PANEL		

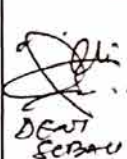
11. DESCRIPTION

PERFORM REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD
PN: AAD9-18-1

REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED REPLACE VACUUM FILTER
WITH NEW IAW C208B AMM 37-10-00
3198:16 5473
Performed at A/C TT : 3199-1021 A/C TC /LDG : 5439-1

MECH	ENG	INSP (*)
		

FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #			15	NOV 2021

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	AAD9-18-1	1 EA		S

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	Good

NON ROUTINE CARD (Form: SCA/MTC/047)

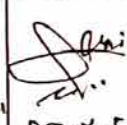
17

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/047-SNP/XI/2021	01-Nov-2021	REPLACEMENT	PK-SNP/208B-5495
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#004	37		
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM REPLACE VACUUM RELIEF VALVE FILTER DISCARD
PN: B3-5-1

REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
PERFORMED REPLACE VACUUM RELIEF VALVE FILTER . REF AMM CH. 37-10-00 Performed at A/C TT : 3199.02 A/C TC /LDG : 5439		 Vacuum - S. Denny	 Denny S.	
FINDING	☐ Y ☐ N	ACT MHR :		DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #		15	nov	2021

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	B-3-5-1	1		S

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	GOOD

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/078-SNP/XI/2021	01-Nov-2021	INSPECTION	PK-SNP
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#002	72		
9. ZONE	10. PANEL		
ENGINE			

11. DESCRIPTION			
PERFORM BORESCOPE HOT SECTION INSPECTION (INITIALLY 200 HRS)			
REFERENCE	☒ EMM Ch. 72-00-00	☐	☐ OTHER
RII (*)	☐ Y	☐ N	MHR :

12. RESULT			MECH	ENG	INSP (*)
POSTPONED DUE TO ENGINE REMAINING 81:03 HOURS Performed at A/C TT : A/C TC /LDG :			-	-	-
FINDING	☐ Y	☐ N	ACT MHR :		
INSPECTION CARD (IC) #			DATE/TIME (DD/MM/YY)		
			-	-	-

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS