



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 10 & Add Task due at 5179 Hours.	No.	WO/087-SNS/XI/2021
	Date	18-Nov-2021
	A/C Reg.	PK-SNS C208B-2341
Reference : MP C208B Rev. 10	Prepared By	TS
	Checked By	CI
	Approved By	TM

To : Engineer In Charge

Description :

1. Perform Inspection Document 10 & Add Task due at **5179 Hours**.
2. Make an entry in Maintenance Log.
3. Return the Completed Work Order and Form to PPC.

#If any finding, please close the routine card, and transferred to **inspection** card.


Additional Work :

Compliance
Statement

CARRIED OUT

Sign & Date

Company Lic. No.:


02/12/2021
Ridwan L. G.
(Engineer In Charge)



Signature

(Technical Manager)

Appendix B02 – PT6A-114A Engine Run Performance Sheet

Reg. Mark : PK-5MS

WO/FML No. : WO/087-5MS/K1/2021

PRE – INSPECTION	
Location	NABIRE
Date	28 NOV 2021
Cycle	
Filed Barometric	1009
OAT	31°C
Altitude	60ft

POST – INSPECTION	
Location	NABIRE
Date	02 DEC 2021
Cycle	
Filed Barometric	1009
OAT	30°C
Altitude	40ft

PRE – INSPECTION		
	Target	Actual
Tq	1865	1865
Np	1900	1890
ITT	785 °C	730 °C
Ng	99.1 %	99.8 %
Wf	450	440
Oil Press		92 °C
Oil Temp		80 °C
Start Temp		752 °C

POST – INSPECTION		
	Target	Actual
Tq	1865	1865
Np	1900	1890
ITT	780 °C	718 °C
Ng	99 %	99.7 %
Wf	450	434
Oil Press		92 °C
Oil Temp		79 °C
Start Temp		748 °C

Engine Run Up Checks

Inertial ☒ EPL ☒ OVG ☒ Stby Alt ☒ BOV ☒ Brake ☒ Random ☐

NOTE:

1. Brake system at Torque 1500 ft-lbs.
2. Inertial Separator at Torque 400 ft-lbs.
3. EPL check can't exceed 4% Ng per second.
4. Standby Alt at 80% Ng.
5. Low idle at 52.5 – 53.5% 40Amps.
6. High idle at 64 – 66% Ng 40Amps.

Engine Performance Target Table Cessna C208

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	772	775	778	780	785	790	793	795	797	800	800	800	802	805	810
Ng (%)	98.5	98.5	99	99	99.1	99.2	99.4	99.5	99.5	100	100	100.2	100.5	100.7	100.9
WF (PPH)	450	450	450	450	450	450	450	450	450	450	450	450	448	448	446

Note:

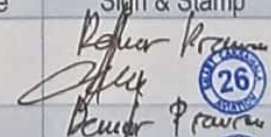
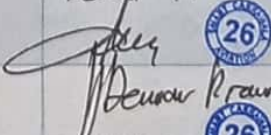
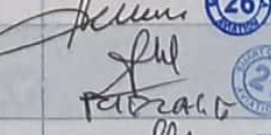
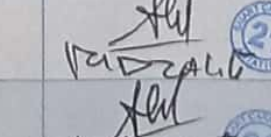
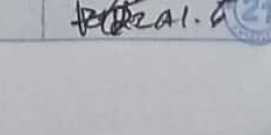
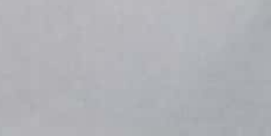
1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 465 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.


REMARKS:

PERFORMED BY

Name	Sign & Stamp	Date	Location
RIDZAL G		12/12/2021	NABIRE

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
18-Nov-2021	WO/087-SNS/XI/2021	Inspection Doc. 10 & Add Task			
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C08B-2341	PK-SNS		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-PC1288	5184:41 / 5486		
	#2	-	2259:37 / 7790		
Propeller/Rotor	#1	111120	1327:18		
	#2	-			
Landing Gear	NLG		5184:41 / 5486		
	LH MLG		5484:41 / 5486		
	RH MLG		5184:41 / 5486		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	2	#001, #002		
2	Inspection Card	1			
3	Work Order	1			
4	Summary Inspection List	1			
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1			
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
IC-001	A322001	YDRE BEARING CORROSION AND DAMAGE			 
IC-002	A322001	TAPE BOLT DAMAGE AND CORROSION.			 
IC-003	C122101	RH SIDE MAIN LANDING GEAR BEARING OUTBOARD ROLLER WEAR			 
IC-004	A322001	NOSE BEARING FOUND CORROSION			 
IC-005	32-40-00	LH BRAKE LINING FOUND WORN OUT			 
IC-006	D121001	LH BRAKE PISTON ON CALIPER FOUND LEAK			 

<u>IC-007</u>	A0247601	COUPLING DRIVE SPLINED ON ALTERNATOR FOUND BROKEN			Ruzal.6  
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager



SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/087-SNS/XI/2021

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B02	PT6A-144A ENGINE GROUND RUN PERFORMANCE	02/2021 12		RIDZALIG	
2	CHAPTER 12	INSPECTION DOCUMENT 06	02/2021 12		RIDZALIG	
3	CHAPTER 13	INSPECTION DOCUMENT 07	02/2021 12		RIDZALIG	
4	CHAPTER 14	INSPECTION DOCUMENT 08	30/2021 11		RIDZALIG	
5	CHAPTER 15	INSPECTION DOCUMENT 09	29/2021 11		RIDZALIG	
6	CHAPTER 16	INSPECTION DOCUMENT 10	30/2021 11		RIDZALIG	
7	CHAPTER 44	ENGINE PT6A-144A 100 HOUR INSPECTION/ MINOR INSPECTION	02/2021 12		RIDZALIG	
8	CHAPTER 45	ENGINE PT6A-144A 200 HOUR INSPECTION	30/2021 11		RIDZALIG	
9	CHAPTER 46	ENGINE PT6A-144A 200 HOUR / 6 MONTHS INSPECTION	30/2021 11		RIDZALIG	
10	CHAPTER 47	ENGINE PT6A-144A 400 HOUR INSPECTION	02/2021 12		RIDZALIG	
11	CHAPTER 48	ENGINE PT6A-144A 600 HOUR INSPECTION	29/2021 11		RIDZALIG	
12	CHAPTER 49	ENGINE PT6A-144A 600 HOUR / 12 MONTHS INSPECTION	01/2021 12		RIDZALIG	
13	NRC-001	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT PART NUMBER: AAD9-18-1	01/2021 12		RIDZALIG	

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
14	NRC-002	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT PART NUMBER: B3-5-1	01/2024 12		RIDZALIT	
16	SCA/MTC/023	EMERGENCY EQUIPMENT CHECK	02/21 17		RIDZALIT	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE
SCHEDULED MAINTENANCE INSPECTION
(CRS-SMI)

A/C TYPE : CESSNA 208B TTSN : 5184141
A/C REG : PK-SNS TCSN : 5486
MSN : C208B-2341 DATE : 29-11-2021

TYPE OF INSPECTION : INSPECTION DOC. 10 & ADD TASK
DUE AT : 5179 HOURS
REF : MP 208/208B REV. 10

EXCEPTION

- NO EXCEPTION -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

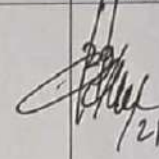
NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
RIDZAL GHAZALI	AIRFRAME & POWER PLANT	9694 SCA 021	 	02/12/2021
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 HOURS
DUE AT : 5289:00 HOURS

Form: SCA/MTC/049

		INSPECTION CARD (Form: SCA/MTC/048)		TECHNICAL DEPARTMENT	
---	--	---	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-001	WO/087-SNS/X1/2021			29 NOVEMBER 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNS	C2083				
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NATS123				

13. DESCRIPTION/DEFECT-IF FINDING OF CPOI INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
NOSE LANDING GEAR YOKE BEARING. CORROSION AND DAMAGE NEED TO BE REPLACE	 21	29/11/21

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED BEARING WITH NEW. Performed at A/C TT: 5189:41 A/C TC/LDG: 5486		 #9637.	29/11/21

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

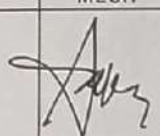
22. PARTS REQUIRED					
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS
			ON	OFF	CLOSE OPEN
BEARING	MS24462-5	2ea	-	-	✓ -

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	OK	Good.

		INSPECTION CARD (Form: SCA/MTC/048)		TECHNICAL DEPARTMENT	
---	--	---	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
1C-002	WO/087-SYS/XI/2021			29 NOVEMBER 2021
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNS	C208B			
9. ZONE	10. STA	11. MTC TYPE		
LANDING GEAR	NAD-102E			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCI INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
FOUND MPI BOLT ON NOSE LANDING GEAR DAMAGE AND CORROSION		29/ 11/21

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED WITH NEW MPI BOLT. Performed at A/C TT : 5184 : 41 A/C TC/LDG : 5486.		 	29/ 11/21

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

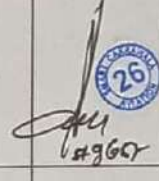
22. PARTS REQUIRED					
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS
			ON	OFF	CLOSE OPEN
MPI BOLT	53461-018	2ea	-	-	☒ ☐

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	o/c	Good

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	---------------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 003	WO/087-SNS/XI/04			29 NOV 2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNS	C20813				
9. ZONE	10. STA	11. MTC TYPE			
LANDING GEAR	NAT-12E				

13. DESCRIPTION/DEFECT-IF FINDING OF CPOI INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
FOUND RH SIDE MAIN LANDING GEAR BEARING. OUTBOARD NEED TO BE REPLACE (ROLLER WEAR AND WATER STAINING).		29/11/2021

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED BEARING WITH NEW Performed at A/C TT : 5184:41 A/C TC/LDG : 5486		 	

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BEARING CONE	21A-09900	1ea	-	-	✓	-

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	a/c	Good

		INSPECTION CARD (Form: SCA/MTC/048)		TECHNICAL DEPARTMENT		
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
12-004	W087-9N5/V/2021			29 NOV 2021		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNS	C208B					
9. ZONE	10. STA	11. MTC TYPE				
NLG	MBX					
13. DESCRIPTION/DEFECT-IF FINDING OF CPOI INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
LH LANDING GEAR BEARING FOUND CORROSION NOSE				 	29/21 11	
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
REPLACED BEARING WITH NEW ONE Performed at A/C TT: 5184:45 A/C TC/LDG: 5486				 	29/21 11	
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE	
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BEARING	214-00200	1	-	-	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		



INSPECTION CARD

(Form: SCA/MTC/048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
1C-005	W01007-SNS x1/2021			29-4-21
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNS	C20813			
9. ZONE	10. STA	11. MTC TYPE		
MLG	MTX			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
LH BRAKE LINING FOUND WORN OUT		29/21 11

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED LH BRAKE LINING WITH NEW ONE			29/21 11
Performed at A/C TT: 5184:41 A/C TC /LDG: 5486			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3			
PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector			
NOTICE OF INSPECTOR		INSP	DATE

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-15300	4			☒	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
TORQUE WRENCH		JAN 2023	SERVICEABLE			

		INSPECTION CARD (Form: SCA/MTC/048)		TECHNICAL DEPARTMENT		
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
1C-006	W0087-SNS/11/2021		D121001	29-11-2021		
6. AC REG/MSN	7. AC TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNS	C200B					
9. ZONE	10. STA	11. MTC TYPE				
MLG	NBx					
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
LH BRAKE PISTON ON CALIPER FOUND LEAK					29/21	
					u	
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
PERFORMED O-RING REPLACEMENT AND DO SERVICING ON BRAKE SYSTEM FOUND GOOD Performed at A/C TT: 5184:41 A/C TC/LDG: 5486					29/21	
				u		
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE	
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	M528775-224	4	-	-	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-007	WO/087-9M9/KY 2021		A0243601	29-11-2021	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PLC-SNS	C20803				
9. ZONE	10. STA	11. MTC TYPE			
ENGINE	MBX				

13. DESCRIPTION/DEFECT-IF FINDING OF CPGP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
ALTERNATOR COUPLING DRIVE FOUND BROKEN	 	02/2021 12

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED COUPLING SPLINED WITH A NEW ONE		 	02/2021 12
Performed at A/C TT: 5184:41 A/C TC/LDG: 5486			

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
COUPLING SPLINED	260266-3	1	-	-	✓	

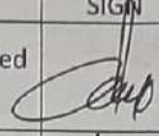

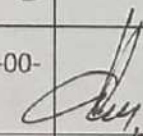


23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 12 – Inspection Document 06

Reg. Mark : PK-SMS
MSN : 020813-2341
TSN / CSN : 5184:41/5484

Date : 29-NOV-2021
Station : NAT312E
WO No. : WO1087-SMS/1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A110001	ALL	Interior and Exterior Placard and Decal Detailed Inspection Task 11-00-00-220		
D121001	121	Brake System Servicing Task 12-10-01-610		
D121003	710	Shimmy Damper Servicing Task 12-10-01-611	N/A	N/A
C122101	700	Landing Gear Lubrication Task 12-21-03-640		
B236001	343 375 376 571 671	Static Discharge System Functional Check Task 23-60-00-720		
A255101	251 252 255 256 257 258	Cargo Nets Detailed Inspection Task 25-51-00-220	N/A	N/A
C270001	215 216 226 373 374 503 525 603 625	Flight Controls Lubrication Task 27-00-00-640		
B273101	211 212 503	Stall Warning System Operational Check Task 27-31-00-710		
C275001	525 527 625 627	Flap Tracks and Rollers Lubrication Task 27-50-00-640		
B281001	575 675	Fuel Vent Line Float Valve Operational Check Task 28-10-03-710		
A281001	521 621	Fuel Filler Assembly Detailed Inspection Task 28-10-01-220		
B301003	122 AUX	Bleed Air Pressure Regulator Functional Check (without TKS and not incorporating CAB93-2) Task 30-10-00-720		
B322001	710	Shimmy Damper Functional Check Task 32-20-02-720		

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B341101	AUX	Pitot Tube Heaters Operational Check Task 34-11-00-710		
A353001	256	Oxygen Mask Detailed Inspection Task 35-30-00-220	N/A	N/A
B761003	AUX	Emergency Power Lever Annunciator Light (EPL) Operational Check Task 76-10-01-710		
*** End of Inspection Document 06 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIDZAL G	ENGINEER		9634
Dennis Pravega	Engineer		9657
PETER ASAPA	MECHANIC		
D. Arjo P	Engineer		9505

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIDZAL GHAZALI Stamp : 

Signature :  Place/Date : NBx, 02-12-2021







MAINTENANCE PROGRAM

CESSNA C208/C208B

Chapter 13 – Inspection Document 07

Reg. Mark : PK-4N4
 MSN : C208B-2341
 TSN / CSN : 5184:41/5486

Date : 29-NOV-2021
 Station : NABIRE
 WO No. : W01087-2021/11/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610		
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720		
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221	N/A	N/A

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720		
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220		
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220		
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72		
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220	N/A	N/A
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIZAL G	ENGINEER		9684
Dawar Praveen	ENGINEER		9657
D. Arja Permana	ENGINEER		9505
PETER AGARA	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is considered fit for Release to Service.

Name : RIZAL GHAZALI Stamp : 


Signature :  Place/Date : NTSX, 02 DEC 2021


MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 14 – Inspection Document 08

Reg. Mark : PK-SNG
MSN : C208B-7341
TSN / CSN : 518441/5486

Date : 29-NOV-2021
Station : NASIRG
WO No. : WO1087-SNG/1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-720		
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIDZAL G	ENGINEER		9634
Dinar Traung	ENGINEER		9657
D. Arya Perdana	Engineer		9505
PETER AGAPA	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIDZAL G Stamp : 
Signature :  Place/Date : MBX, 30 NOV 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 15 – Inspection Document 09

Reg. Mark : PK-GNS
MSN : C208B-2341
TSN / CSN : 518481/5486

Date : 29-NOV-2021
Station : NATFIRE
WO No. : WO/087-GNS/X1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B212401	211 212	Avionics Cooling Fan Operational Check Task 21-24-00-710		
B221201	226 232	Garmin Autopilot (GFC 700) Functional Check Task 22-12-00-720		
B221203	226 232	Garmin Autopilot (GFC 700) Slip Clutch Override Operational Check Task 22-12-00-710		
C273030	213 214	Elevator Bellcrank Lubrication <u>Task 12-21-02-640</u>		
A275001	231 232	Flap Actuator Mount Bracket Detailed Inspection Task 27-50-00-220		
A275003	251 252 511 611 525 625	Flap Bellcrank Detailed Inspection Task 27-50-00-221		
*** End of Inspection Document 09 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
D. Arja Bernad	Engineer		9505
RIDZAL . G	ENGINEER		9694
PETER AGAPA	MECHANIC		
YOHAN.S. DEPAPI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIDZAL GHAFALI Stamp : 
Signature :  Place/Date : NBSX, 29 NOV 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 16 – Inspection Document 10

Reg. Mark : PK- SNG
MSN : C208B-2341
TSN / CSN : 5189:41/5486

Date : 29 Nov - 2021
Station : NATIRE
WO No. : WO/087-SNG/K1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
C221201	226 232	Autopilot Servos Lubrication Task 22-12-00-640		
A245001	121 122	Power Distribution Boxes Detailed Inspection Task 24-50-00-220		
A251001	231 232	Crew Seats Detailed Inspection Task 25-10-00-220		
A251003	231 232	Passenger Seats Detailed Inspection Task 25-21-00-220		
B271001	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Spoiler System Functional Check Task 27-10-00-720		
C271003 RII	551 571 651 671	Aileron Trim Tab Actuator (2660044-1) Lubrication Task 27-10-02-641 <u>AILERON TRIM ACTUATOR 2661615-10</u>	N/A	N/A
		RII Sign: <u>N/A</u> RII Stamp: <u>N/A.</u>		
C273001 RII	371 372 375 376	Elevator Trim Tab Actuator (2660017-1) Lubrication Task 27-30-02-640 <u>ELEVATOR TRIM ACTUATOR 2661215-9</u>	N/A	N/A
		RII Sign: <u>N/A</u> RII Stamp: <u>N/A</u>		
B284103	AUX	Fuel Quantity and Low Fuel Warning Systems Functional Check Task 28-41-00-720		
B313103	312	Flight Data Recorder Underwater Locator Beacon Functional Check Task 31-31-00-721	N/A	N/A
B324001	ENG	Brakes Operational Check Task 32-40-00-710		

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 16 – Inspection Document 10

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B332001	AUX	Passenger/Cargo Compartment Lighting Operational Check Task 33-20-00-710		
A520001	801 802	Crew Doors Detailed Inspection Task 52-00-00-220		
A520003	255 256 257 258 803 804	Passenger/Cargo Doors and Door Frames Detailed Inspection Task 52-00-00-221		
A781001	130	Primary and Secondary Exhaust Duct General Visual Inspection Task 78-10-00-211		
*** End of Inspection Document 10 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIZAL GHAFALI	ENGINEER		9694
Dehur Prana	ENGINEER		9687
PETER AGAPA	MECHANIC		
D. Arya P	Engineer		9505

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIZAL GHAFALI Stamp : 








Signature :  Place/Date : M3X, 30 Nov 2021


Chapter 44 – Engine PT6A-114A 100 Hours/Minor Inspection

Reg. Mark	: PK - <u>SN5</u>	Date	: <u>29 NOV 2021</u>
MSN	: <u>C208B-234</u>	Station	: <u>NATBIRE</u>
TSN / CSN	: <u>5184:41/5486</u>	WO No.	: <u>WO/087-SN5/K1/2021</u>

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E710001	130	Do a check of the FCU manual override system for static operation.		
E710003	130	Do a compressor performance recovery wash.		
E710004	130	Inspect all accessible connections, clamps and brackets for attachment. Inspect accessible lockwire and safety cable for security and installation.		
E710005	130	Inspect of wear, chafing, cracks and corrosion for tubing, wiring, control linkage, hose assemblies. NOTE: Visually inspect insulated air tubes for signs of swelling, cracking, bulging of rubber sheath material. Refer to repair section and SB1687. Replace as necessary.		
E710006	130	Examine linkages. Pay particular attention to rear linkage cam box, fuel control unit arm, telescopic rod and rod end fittings. Disconnect rod ends and clean using solvent (PWC11-027) or (PWC11-031). Lubricate with light grease (PWC04-001) after engine external wash. Examine rod end for corrosion, roughness in rotation, side play and radial play. After lubrication reinstall rod ends and torque to specified value (Ref 76-10-00). Check free movement of linkage.		
E710007	130	Inspect attachment and linkages, air, oil and fuel lines (Ref. 73-10-07/-08). NOTE: Visually inspect insulated air tubes for signs of swelling, cracking, bulging of rubber sheath material. Refer to repair section and SB1687. Replace as necessary.		
E710011	130	Performed Deceleration Check		
E720001	130	Do a visual inspection of the engine exhaust duct welds.		
E720002	130	Do a visual inspection of the engine exhaust duct for cracks.		
E720003	130	External surfaces, and fireseal mount ring brackets for cracks, distortion, and corrosion of gas generator case (Ref. 72-30-04).		

Chapter 44 – Engine PT6A-114A 100 Hours/Minor Inspection

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E722001	130	Do a visual inspection of the air inlet screen.		
E722004	130	Cracks and attachment of brackets and seals of fireseal mount rings. (Ref. 72-30-01/-02)		
E723000	130	Do a visual inspection with a mirror or a borescope inspection of the First-stage Compressor Rotor and the inlet case for corrosion		
E731002	130	Do a visual inspection of the fuel pump (in-situ inspection only) for installation and leakage		
E731003	130	Check oil-to-fuel heater installation		
E731014	130	Check starting flow control/flow divider for installation and leaks.		
E731015	130	Check outlet filter for foreign matter or distortion (Ref. 73-10-02). (CLEANING / REPLACEMENT) P/N OFF: <u>AN 6235-3A</u> P/N ON: <u>AN 6235-3A</u>		
E731006	130	Check drain valve for installation and leaks		
E731008	130	Do a visual inspection of the P3 filter and drain valve.		
E731018	130	Clean or replace the P3 filter based on condition, service experience or environment. Note: If corrossions are found, replace filter.		
E732001	130	Check FCU for installation, linkages and pneumatic tubes.		
E732002	130	Examine the FCU for bearing wash-out, shown by blue dye (grease and fuel mixed) at FCU vent.		
E792002	130	Oil filter elements and secondary screen (coarse hat-type screen attached to the inner end of the filter).		
E792003	130	Examine the forward oil transfer elbow installation on the Flange A. Make sure that the bolts tighten correctly		
*** End of Engine PT6A-114A 100 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIZAL G	ENGINEER		9694
D. Arza Rana	Engineer		9505
PETER AGARA	MECHANIC		
YOHAN. S. DEPARI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIZAL GHAZALI Stamp : 


Signature :  Place/Date : NOEX, 07 DEC 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 45 – Engine PT6A-114A 200 Hours Inspection

Reg. Mark : PK- SNS Date : 29-11-2021
MSN : C208B-2341 Station : NABING
TSN / CSN : 518441/5486 WO No. : WO/087-SNS/K1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E793001	130	Check magnetic chip detector(s) for continuity, open circuit must exist indicating no contamination at pole tips.		
*** End of Engine PT6A-114A 200 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<u>D. Anza Prana</u>	<u>Engineer</u>		<u>9505</u>
<u>PETER AGARA</u>	<u>MECHANIC</u>		
<u>YOHAN. S. DEPARI</u>	<u>MECHANIC</u>		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.


Name : RIYAL GHAZALI Stamp : 
Signature :  Place/Date : NTX, 30 NOV 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 46 – Engine PT6A-114A 200 Hours or 6 Months Inspection

Reg. Mark : PK-GNS Date : 30 NOV 2021
 MSN : C208B-7341 Station : NATZIVE
 TSN / CSN : 5184:41/5486 WO No. : WO1087-GNS/K1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E793000	130	Do a visual inspection of the AGB internal scavenge oil pump inlet screen		
*** End of Engine PT6A-114A 200 Hours or 6 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
<u>RIZAL G</u>	<u>ENGINEER</u>		<u>9694</u>
<u>PETER AGAPA</u>	<u>MECHANIC</u>		
<u>YOHAN S. DEPARH</u>	<u>MECHANIC</u>		

RETURN TO SERVICE

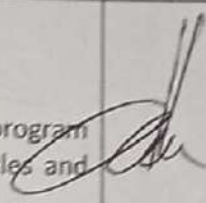
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIZAL GHAFALI Stamp : 
 Signature :  Place/Date : NATZ, 30 NOV 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 47 – Engine PT6A-114A 400 Hours Inspection

Reg. Mark : PK-SNG Date : 29 NOV 2021
MSN : C208B-2341 Station : MATSIRE
TSN / CSN : 5184:41/5486 WO No. : WO/887-SNG/K1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E724000	130	Do borescope inspection of hot section components.		
E731004	130	Do a leak test and a functional test of the fuel manifold adapter and nozzle assemblies. Note: Engines ON fuel nozzle in-situ cleaning program (Ref. Task 71-00-00-160-808). Test fuel nozzles and refurbish as necessary.		
E741001	130	Do a visual inspection of the ignition exciter.		
E741011	130	Do a visual inspection of the ignition cables.		
E742002	130	Do a visual inspection of the spark igniter/glow plugs.		
*** End of Engine PT6A-114A 400 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
RIDZAL GHAZALI	ENGINEER		9694
Dauar Pranny	ENGINEER		9687
D. Angin P.	Engineer		9805
YOHAN S. DEPAH	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.



Name : RIDZAL GHAZALI Stamp : 
Signature :  Place/Date : MATS, 02 DEC 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 48 – Engine PT6A-114A 600 Hours Inspection

Reg. Mark : PK- SNS Date : 29 NOV 2021
 MSN : C208B 2341 Station : NATRURE
 TSN / CSN : 5184:41 / 5986 WO No. : WQ687-SN4/X1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E731005	130	Check inlet screen for foreign matter or distortion, clean and reinstall, or install new screen.		
E753001	130	Do a visual inspection of the compressor bleed valve.		
*** End of Engine PT6A-114A 600 Hours Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
D. Anja Permana	Engineer		9805
YOHAN S. DEPARI	MECHANIC		

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : RIDZAL GHAZALI Stamp : 
 Signature :  Place/Date : NATR, 29 NOV 2021

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 49 – Engine PT6A-114A 600 Hours or 12 Months Inspection

Reg. Mark : PK-CAN Date : 29 NOV 2021
 MSN : C208B 2341 Station : MATRE
 TSN / CSN : 5184:41/5986 WO No. : WO/087-524/1/2021

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
E793002	130	Bridge the chip detector(s) magnetic bar with correct jumper and use an applicable ohmmeter to make sure that continuity between connector pins.		
*** End of Engine PT6A- 114A 600 Hours or 12 Months Inspection Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
YONAN S. DEPAHI	MECHANIC		
PIDZAL-G	ENGINEER		9694

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : PIDZAL GHARALI Stamp : 
 Signature :  Place/Date : MTX, 01-12-2021



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/087-SNS/XI/2021	18-Nov-2021	REPLACEMENT	PK-SNS/208B-2341
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	37		NACBIRE
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD PN: AAD9-18-1			
REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR:

12. RESULT		MECH	ENG	INSP (*)
PERFORMED REPLACE VACUUM SYSTEM CENTRAL AIR FILTER WITH NEW ONE				
Performed at A/C TT: 5184:41 A/C TC/LDG: 5486				
FINDING	☐ Y ☒ N	ACT MHR:		
INSPECTION CARD (IC) #		DATE/TIME (DD/MM/YY)		
		01	12	21

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
VACUUM SYSTEM AIR FILTER	AAD9-18-1	1		CLOSED

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/087-SNS/XI/2021	18-Nov-2021	REPLACEMENT	PK-SNS/208B-2341
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#002	37		NATIVE
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM REPLACE VACUUM RELIEF VALVE FILTER DISCARD
PN: B3-5-1

REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR:

12. RESULT

PERFORMED REPLACE VACUUM RELIEF VALVE
FILTER

Performed at A/C TT: 5184:41 A/C TC/LDG: 5486

FINDING	☐ Y	☒ N	ACT MHR:	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				01 12 21

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
VACUUM RELIEF VALVE FILTER	B3-5-1	1		CLOSED

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023

DATE : 02 DEC 2021	A/C REG : PK-SAG
A/C TYPE : C208B	CHECKER : RIDZAL.G SIGN:  

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	19041660004	APRIL 2022	SERVICEABLE
2	Co-Pilot Life Vest	P01074-101W	17071100010	July 2022	SERVICEABLE
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	NPN	NPN	-	GOOD
14	Crash Axe Installed	NPN	NPN	-	GOOD
15	Fire Extinguisher	C352	X690527	OCT 2022	GOOD
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					




WO/087-SNS/XL/2021

Additional Work Sheet

Inspection Doc. 10 & Add Task

[illegible]



SERVICEABLE TAG

Part Number: 5106547-01		Description: FUEL NOZZLE 114A		
Serial Number:	Qty.:	Form 8130-4	DAAO From 21-18	C of C
Order Number:	Receipt Date: 14-OCT-2021	For Class 1 Product	For Class II/III Product	For Class II Product Only
Mfg. Date:	Vendor / Approved Shop:	The Part Identified has been : ☒ Inspected only ☐ Repaired ☐ New ☐ Other		
TSN:	Shelf Life Expiry Date:			
Remarks: CLEANING	TSO: DIC	CERTIFICATE OF RELEASE TO SERVICE <i>I hereby certify that the work recorded above have been carried out in accordance with the requirements of the Indonesia Civil Aviation Safety Regulations applicable thereto and is airworthy</i>		
	Store Inspector:			
		Main Store: Outstation Store	Sign/Stamp Authority Date : [Signature] [Stamp] 14-OCT-2021	
Condition				

Form: SCA/MTC/022