
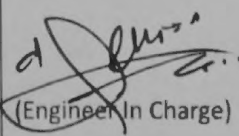


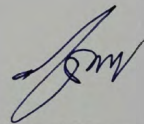

PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 06 & Add Task Due at 3969 Hours.	No.	WO/092-SNK/XI/2022
	Date	3 Nov 2022
	A/C Reg.	PK-SNK C208-00658
Reference : MP C208B Rev. 12	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Inspection Document 06 & Add Task Due at 3969 Hours. 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work : - NIL -		
Compliance Statement CARRIED OUT	Sign & Date Company Lic. No.:  (Engineer In Charge)  9632	Signature  (Technical Manager)

Appendix B - Form: SCA/MTC/030



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION
(CRS-SMI)

A/C TYPE : CESSNA 208
A/C REG : PK-SNK
MSN : C208-00658

TTSN : 3966:16
TCSN : 5536
DATE : 9 NOV 2022

TYPE OF INSPECTION : INSPECTION DOCUMENT 06 & ADD TASK
DUE AT : 2969 HOURS
REF : MP C208B REV. 12

EXCEPTION

- NO EXCEPTION -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
DENI SOBALI	AIRFRAME & POWER PLANT	9632 SCA20		9 NOV 2022
/	EIRA	/	/	

THE NEXT DUE TYPE OF INSPECTION : 100 HRS
DUE AT : 4069:00 FH.

Form: SCA/MTC/049



MAINTENANCE PROGRAM CESSNA C208/C208B

Appendix B02 – PT6A-114A Engine Run Performance Sheet

Reg. Mark : PK - SNK

WO/FML No. : WO/092-SNK/XI/2022

PRE – INSPECTION	
Location	TRK
Date	8 NOV 2022
Cycle	
Filed Barometric	1010 HPA.
OAT	28.27
Altitude	20

POST – INSPECTION	
Location	TRK
Date	9 NOV 2022
Cycle	
Filed Barometric	1010 HPA
OAT	32
Altitude	20

PRE – INSPECTION		
	Target	Actual
Tq	1865	1865
Np	1900	1880
ITT	772 °C	699 °C
Ng	98.5 %	98.8 %
Wf	450	453
Oil Press		90 °C
Oil Temp		73 °C
Start Temp		675 °C

POST – INSPECTION		
	Target	Actual
Tq	1865	1865
Np	1900	1880
ITT	770 °C	698 °C
Ng	99.2 %	98.5 %
Wf	450	452
Oil Press		88 °C
Oil Temp		74 °C
Start Temp		690 °C

Engine Run Up Checks

Inertial ☒ EPL ☒ OVG ☒ Stby Alt ☒ BOV ☒ Brake ☒ Randomn ☒

NOTE:

1. Brake system at Torque 1500 ft-lbs.
2. Inertial Separator at Torque 400 ft-lbs.
3. EPL check can't exceed 4% Ng per second.
4. Standby Alt at 80% Ng.
5. Low idle at 52.5 – 53.5% 40Amps.
6. High idle at 64 – 66% Ng 40Amps.

Engine Performance Target Table Cessna C208

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	772	775	778	780	785	790	793	795	797	800	800	800	802	805	810
Ng (%)	98.5	98.5	99	99	99.1	99.2	99.4	99.5	99.5	100	100	100.2	100.5	100.7	100.9
WF (PPH)	450	450	450	450	450	450	450	450	450	450	450	450	448	448	446

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 465 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

PERFORMED BY

Name	Sign & Stamp	Date	Location
DENI SOTBALI		9 NOV 2022	TRK

Revision No. : 03
SCA/TEK/1-001
26 September 2019

Page B02.1



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023

DATE : 8 NOV 2011	A/C REG : PK-SNK
A/C TYPE : C208	CHECKER : <i>DEW</i> <i>51</i> SIGN: <i>[Signature]</i>


No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	19041660002	1 May 2023	GOOD
2	Co-Pilot Life Vest	P01074-10110	17060500076	JULY 2023	GOOD
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	SCA-005/FAK	SCA-005	SEPT 2023	GOOD
14	Crash Axe Installed	-	-	-	GOOD
15	Fire Extinguisher	C352	F60589834	APRIL 2023	GOOD
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					
	FLASH LIGHT	-	-	-	GOOD

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED	
3 Nov 2022	WO/092-SNK/XI/2022	Inspection Doc. 06 & Add Task	9 Nov 2022	
A/C Type		Mfg. Serial Number	A/C Registration	
C208		C208-00658	PK-SNK	
AIRCRAFT DATA				
Subject	Pos #	Serial Number (SN)	TTSN/TCSN	
Engine	#1	PCE-PC1988	6802:41/10189	
	#2	-		
Propeller/Rotor	#1	190345	3966:16/5536	
	#2	-		
Landing Gear	NLG		3966:16/5536	
	LH MLG		3966:16/5536	
	RH MLG		3966:16/5536	
PACKAGE COVERED				
No	Subject	Qty	Remark	
1	Non-Routine Card	2	#001; #002	
2	Inspection Card	1		
3	Work Order	1		
4	Summary Inspection List	1		
5	Material and Tool List	-		
6	Escalation form	-		
7	CRS (SMI / Unscheduled Maintenance)	1		
INSPECTION CARD (IC) LIST (Finding during maintenance)				
No	Taskcard Ref	Subject	Status Open Close	Name/ Sign & Stamp
IC-001	C122101	BEARING CONE YH SIDE OUTER WORN	✓	DEW
IC-002	C122101	NODE BEARING CONE OVER HEAT	✓	DEW
IC-003	DEBELT	LEANTER LH SIDE WORN OUT	✓	DEW
IC-004			✓	
IC-005				
IC-006				

<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support




Hani

Checked by :
Chief Maintenance



Dodit

Verified by :
Chief Inspector



Yanuar

Approved by :
Technical Manager



Istiono

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-003	C208 40/092-500/1/2011		-	9 NOV 2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PR-208 C208-00658	C208	POWER PLAN			
9. ZONE	10. STA	11. MTC TYPE			
	JNK	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
IGNITER L/H SIDE WORN OUT	DEW1	9 NOV 2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED IGNITER WITH NEW REF TO MMCHAPTER 74-20-04 Performed at A/C TT: 3064-16 A/C TC/LDG: 5536			9 NOV 2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
IGNITER	CH34015	1	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
TORQUE WRENCH	86212	AUG 2023	Good

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-002	W0/092-SNK/KI/2022		C/22/01	8 NOV 2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNK C208-00658	C208	AIRPRATIC			
9. ZONE	10. STA	11. MTC TYPE			
700	TRK	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
NOISE BEARING GONE OVER HEAT	DGWT	8 NOV 2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED BEARING WITH NEW 1AW C208 M74 CHAPTER 32-40-00 REV. 3P Performed at A/C TT : 3566-14 A/C TC /LDG : 5536			8 NOV 2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
	☐ Chemical Spill		
CORROSION ☐ Isolated ☐ Widespread	☐ LAV/Galley Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ Blocked Drain		
PROPOSED ACTION ☐ Doublers	☐ Wet Insulation Blanket		
☐ Others	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BEARING	214-00200	1	-	-	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	-	GOOD

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC-001	W0/092-SWK/X/2022		C/22/01	8 NOV 2022	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PE-SWK C208-00658	C208	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
700	TRK	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCR INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
BEARING CONE L/H SIDE OUTER WORN OUT AND OVERHEAT	DENI	08/NOV 22

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED BEARING WITH NEW REF. TO LHM C208 CHAPTER 32-40-00. REV. 38. Performed at AC TT: 3966:14 AC TC/LDG: 5536			8 NOV 22

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED							
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS		
			ON	OFF	CLOSE	OPEN	
BEARING CONE	244-0140	1	-	-	✓		

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	-	-	GOOD



Additional Work Sheet Inspection Doc. 06 & Add Task

Aircraft Registration: **PK-SNK**

WO# Nr: **WO/092-SNK/XI/2022**

Parts Used Sheet

Part Used

Date	Part Nr.	Serial Nr.	Description	Quantity	Engineer
7 NOV 2022	AN 6235-34	-	FUEL FILTER	1 EA	DENI
7 NOV 2022	MS 22513-237		O-RING	1 EA	DENI
7 NOV 2022	MS 28778-6		O-RING	1 EA	DENI
7 NOV 2022	MS 22513-013		O-RING	1 EA	DENI
7 NOV 2022	AS 3209-015		O-RING	1 EA	DENI
7 NOV 2022	AS 3209-126		O-RING	1 EA	DENI
7 NOV 2022	AS 3209-143		O-RING	1 EA	DENI
7 NOV 2022	AS 3209-224		O-RING	1 EA	DENI
7 NOV 2022	AS 3209-120		O-RING	1 EA	DENI
7 NOV 2022	M 25588/1-928		O-RING	1 EA	DENI
7 NOV 2022	M 25588/1-212		O-RING	1 EA	DENI
7 NOV 2022	M 25588/1-916		O-RING	1 EA	DENI
6 NOV 2022	MS 24665-362		COTTER PIN	2 EA	BATZI
6 NOV 2022	MS 24665-285		COTTER PIN	1 EA	BATZI
6 NOV 2022	214-01400		BEARING CONE	1 EA	DENI
6 NOV 2022	214-00200		BEARING CONE	1 EA	DENI
7 NOV 2022	IGNITION COIL 34055		IGNITION	2 EA	DENI
7 NOV 2022	3010880		GASKET	2 EA	DENI
7 NOV 2022	MS 22513-338		O-RING	2 EA	DENI



Additional Work Sheet
Inspection Doc. 06 & Add Task

WO# Nr: WO/092-SNK/XI/2022

Parts Used Sheet

[illegible]

