



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection 400 Hours A/F&Add.Task Due at 2000 FH.	No.	WO/035-SNA/II/2023
	Date	26 February 2023
	A/C Reg.	PK-SNA C208B-5634
Reference : MP C208B ISSUED 01	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection 400 Hrs A/F&Add.Task @2000Hrs 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work :		
Compliance Statement 400 HRS INSP & ADD TASK C/O	Sign & Date Company Lic. No.:  11-MARCH-2023 (Engineer In Charge)	Signature  (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED		JOWO #		TYPE OF MAINTENANCE		DATE OF ACCOMPLISHED	
26 Feb 2023		WO/035-SNA/II/2023		Inspection 400Hrs&Add.		11 - MARCH - 2023	
A/C Type				Mfg. Serial Number		A/C Registration	
C208B				C208B-5634		PK-SNA	
AIRCRAFT DATA							
Subject		Pos #		Serial Number (SN)		TTSN/TCSN	
Engine		#1		PCE-VA0730		2005: 21 / 3122	
		#2		-			
Propeller/Rotor		#1		200483		2005: 21	
		#2		-			
Landing Gear		NLG				2005: 21 / 3122	
		LH MLG				2005: 21 / 3122	
		RH MLG				2005: 21 / 3122	
PACKAGE COVERED							
No	Subject			Qty	Remark		
1	Non-Routine Card			3			
2	Inspection Card			-			
3	Work Order			1			
4	Summary Inspection List			1			
5	Material and Tool List			-			
6	Escalation form			-			
7	CRS (SMI / Unscheduled Maintenance)			1			
INSPECTION CARD (IC) LIST (Finding during maintenance)							
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp		
			Open	Close			
<u>IC-001</u>	D121 001	LH AND RH BACK PLATE BRAKE LINING WORN OUT		✓	M. AZIL ANDHIA  		
<u>IC-002</u>	D121 001	RH BRAKE SHIM WORN OUT		✓	M. AZIL ANDHIA  		
<u>IC-003</u>	D121 001	RH BACK PLATE SHIM PIN WORN OUT (4EA)		✓	M. AZIL ANDHIA  		
<u>IC-004</u>	D121 001	RH BRAKE INSULATOR WORN OUT (4EA)		✓	M. AZIL ANDHIA  		
<u>IC-005</u>	D121 001	RH BRAKE CALIPER FOUND LEAK		✓	M. AZIL ANDHIA  		
<u>IC-006</u>	3610 00	RELIEF VALVE FOUND DAMAGE		✓	 		

<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support

Checked by :
Chief Maintenance

Verified by :
Chief Inspector

Approved by :
Technical Manager


.....
Dwi M.


.....
Dodit


.....
Yanuar


.....
Istiono



SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/035-SNA/11/2023

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	APPENDIX B08	PT6A-140 ENGINE GROUND RUN	11/03/23		Azn	
2	APPENDIX C03	200 HRS/12 MTHS INSPECTION	09/03-2023		DENI.5	
3	APPENDIX C04	400 HRS/24 MTHS INSPECTION	11/03/23		Azn	
4	APPENDIX C05	400 HRS/12 MTHS INDPECTION	10/03/23		Azn	
5	NRC001	REPLACEMENT VACUUM CENTRAL AIR FILTER	09/03-2023		DENI	
6	NRC002	REPLACEMENT VACUUM RELIEF VALVE FILTER	09/03-2023		DENI	
7	NRC004	VISUAL INSP. FOR GSA 80/81 SERVOS	09/03-23		Azn	
8	NRC005	VISUAL INSP. & CHECK SLIP CLUTCHS OF GSM 85A/86	09/03-2023		DENI Samm	
9	SCA/MTC/023	EMERGENCY EQUIPMENT CHECK	10/03-23		Azn	
10	NRC003	HOT SECTION INSPECTION	11/03-23		Azn	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION

(CRS-SMI)

A/C TYPE : CESSNA 208B

TTSN : 2005-21

A/C REG : PK-SNA

TCSN : 3122

MSN : C208B-5634

DATE : 11- MAR- 2023

TYPE OF INSPECTION : INSPECTION 400 HOURS A/F & Add.Task

DUE AT : 2000 HOURS

REFF : MP C208B ISSUED 01

EXCEPTION

- NO EXCEPTION -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
M. AZIL ANDIKA	AIRFRAME & POWER PLANT	9633 / SCA 23	 	11- MAR- 2023
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 HRS INSP

DUE AT : 2100:00 HRS

Form: SCA/MTC/049



MAINTENANCE PROGRAM **CESSNA 208/208B**

Appendix B08 – PT6A-140 Engine Run Performance Sheet

Reg. Mark : PK - SNA

WO/FML No. : WO/035-SNA 111/ 2023

PRE – INSPECTION	
Location	NABIRE
Date	08-03-2023
Cycle	-
Filed Barometric	1011
OAT	33 °C
Altitude	120 FT

POST – INSPECTION	
Location	NABIRE
Date	11-MAR-2023
Cycle	-
Filed Barometric	1011
OAT	36 °C
Altitude	160 FT

PRE – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1880
ITT	841 °C	833 °C
Ng	102.7 %	100.8 %
Wf	578	542
Oil Press		89 °C
Oil Temp		77 °C
Start Temp		725 °C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1880
ITT	842 °C	809 °C
Ng	102.6 %	100.9 %
Wf	565	537
Oil Press		91 °C
Oil Temp		72 °C
Start Temp		642 °C

Engine Run Up Checks							
Inertial ☒	EPL ☒	OVG ☒	Stby Alt ☒	BOV ☒	Brake ☒	Random ☒	
NOTE: 1. Brake system at Torque 2000 ft-lbs. 3. EPL check can't exceed 4% Ng per second. 5. Low idle at 55.5 - 57% 40Amps. 2. Inertial Separator at Torque 400 ft-lbs. 4. Standby Alt at 80% Ng. 6. High idle at 64 - 66% Ng 40Amps							

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	(33)	34	35	(36)	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS: ENGINE PARAMETER WITHIN LIMIT
--

PERFORMED BY			
Name	Sign & Stamp	Date	Location
M. AMZ A		11-MAR-23	NABIRE



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/035-SNA/II/2023	10- MAR- 2023	REPLACEMENT COMPONENT	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	37		NABIRE
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT P/N: D9-18-1 / C294502-0201			
REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
REPLACED WITH A NEW FILTER Performed at A/C TT : 2005: 21 A/C TC/LDG : 3122				
FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #			09	03 23

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT	D9-18-1 / C294502-0201	1		new

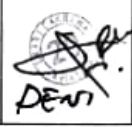
14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	NPW	07C	SERVICEABLE



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/035-SNA/II/2023	10- MAR 2023	REPLACEMENT COMPONENT	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#002	37		NABIRE
9. ZONE	10. PANEL		

11. DESCRIPTION			
PERFORM VACUUM RELIEF VALVE FILTER REPLACEMENT P/N: B3-5-1 / C482001-0202			
REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
Replaced with a new filter				
Performed at A/C TT : 2005:21 A/C TC/LDG : 3122				
FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #			09	03 23

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT	B3-5-1 / C482001-0202	1		new

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	NPN	O/C	SERVICEABLE

NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/035-SNA/II/2023	08 - MAR - 2023	HSI	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#003	72		NAB16
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM HOT SECTION INSPECTION
ENGINE PT6A-140 S/N PCE-VA0730

REFERENCE	☒ AMM Ch. 72-00-00	☐ EMM Ch	☐ OTHER
RII (*)	☒ Y	☐ N	MHR :

12. RESULT

PERFORMED HOT SECTION INSPECTION ENGINE
PT6A-140 S/N PCE-VA0730

Performed at A/C TT : 2005: 21 A/C TC/LDG : 3122

FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				11 03 23

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT ²	B351/G482001-0202 ²	1 ²		

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS



NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/035-SNA/II/2023	09-MAR-2023	VISUAL INSPECTION	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#004	22		NASIRE
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM VISUAL INSP. FOR GSA 80/81 SERVOS

REFERENCE	☒ AMM Ch. 22-12-00	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT	MECH	ENG	INSP (*)
N/A			
Performed at A/C TT : 2005-21 A/C TC /LDG : 3122			
FINDING	☐ Y	☐ N	ACT MHR :
INSPECTION CARD (IC) #		09	03 23

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT 2	B3511/C482001-0202 2	1-2		

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS

NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JOWO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/035-SNA/II/2023	09 - MAR - 2023	VISUAL INSPECTION	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#005	22		NASIRE
9. ZONE	10. PANEL		

11. DESCRIPTION

PERFORM VISUAL INSP. & CHECK SLIP CLUTCHS OF GSM
85A/86

REFERENCE	☒ AMM Ch. 22-12-00	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED VISUAL INSP & CHECK SLIP CLUTCHS OF
GSM 85A/86 FOUND SATISFY

Performed at A/C TT : 2005: 21 A/C TC/LDG : 3122

FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				10 03 23

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER ELEMENT ²	B3-5-1 / C482001-0202 ²	+2		

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
---	--	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 001	WO/035-SNA/11/2023	ALIZ ANDREA	D121 001	08 - MAR - 2023	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PF-SNA	C208R EX	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
LH AND RH BACK PLATE BRAKE LINING WORN OUT		08/05/23

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED LH AND RH BACK PLATE BRAKE LINING WITH A NEW ONE IAW C208B AMM CHAP 32-40-00 Performed at A/C TT : 200C: 21 A/C TC/LDG : 3122			08/05/23

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
LINING	066-09300	8	NEW	NEW	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
Torque wrench	TA 0250	NOV 2023	SERVICEABLE
MEKO METER	NDC - 1 PF	APRIL 2023	SERVICEABLE

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC - 002	W0/035-SNA/11/2023	ALN ANDREA	D121 001	08 - MAR - 2023	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNA	C208B EX	AIRFRAME			
9. ZONE	10. STA	11. MTC TYPE			
	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCI INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
RH BRAKE SHIM WORN OUT		08/03/23

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED RH BRAKE SHIM WITH A NEW ONE IAW C208B AMM CHAP 32-40-00 Performed at A/C TT : 2005:21 A/C TC /LDG : 3122		 	08/03/23

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE ☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3			
PROPOSED ACTION ☐ Doublers ☐ Others			

21. If the defect is RII, Please Sign this card finally by RII Inspector	INSP	DATE
NOTICE OF INSPECTOR		

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
SHIM	068-028 00	1	NSN	NSN	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
1C-003	WO/035-SNA/11/2023	Ann Andika	D121001	08-MAR-2023	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PF-SNA	C208B EX	AIR FRAME			
9. ZONE	10. STA	11. MTC TYPE			
	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
RH RACE PLATE PIN WORN OUT (4EA)		08/03/23

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED RH RACE PLATE PIN (4EA) WITH A NEW ONE 1AW C208B AMM CHAP 32-40-CO Performed at A/C TT: 2005:21 A/C TC/LDG: 3122			08/03/23

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
		☐ Other	

21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
PIN	177-00300	4EA	NSN	NSN	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
SPACE PIVET TOOL	PA 828	o/c	SERVICEABLE

		INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	--	-------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE	
IC- 004	WO/035-SNA/H/2023		D121001	08-MAR-2023	
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #		
PK-SNA	C208B EX	AIR FRAME REPLACEMENT 2			
9. ZONE	10. STA	11. MTC TYPE			
	NABIRE	REPLACEMENT			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
PH BRAKE INSULATOR WORN OUT (4EA)		08/03/23

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED PH BRAKE INSULATOR (4EA) WITH A NEW ONE 1AW C208B AMM CHAF 32-40-00 Performed at A/C TT: 2005: 21 A/C TC /LDG: 2122			08/03/23

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
INSULATOR	08B-00100	4EA	N/A	N/A	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOL	N/A	0%	SERVICEABLE

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
IC - 005	WO/035 - SNA/11/2023	Aziz Andika	D 121001	08 - MAR - 2023		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNA	C208 R EX	AIR FRAME				
9. ZONE	10. STA	11. MTC TYPE				
	NASIRE					
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
RH BRAKE CALIPER FOUND LEAK					08/03/23	
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
PERFORMED REPACKING RH BRAKE CALIPER WITH A NEW O-RING IAW C208B AMM CHAP 32-40-00 Performed at A/C TT : 2005 : 21 A/C TC/LDG : 3122				08/03/23		
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP		DATE
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	MC28 775- 224	4 EA	NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
GENERAL TOOL	NPN	0%	SERVICEABLE			

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
K-006	WO/035-24/11/2023		361000	11-MAR-2023		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNA	C208B EX	ENGINE				
9. ZONE	10. STA	11. MTC TYPE				
	NATURE	REPLACEMENT				
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
RELIEF VALVE FOUND DAMAGE				DEVI	11/03/23	
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
T/S FOUND PRESSURE REGULATOR HAD PRESSURE MORE THAN 30 PSI, REPLACED PRESSURE REGULATOR WITH OVERHAULED ONE IAW C208B AMM CHAP 36-10-00 GROUNDWORK CHECK FOUND SATISFY Performed at A/C TT : 2005: 21 A/C TC/LDG : 3122			 KRIS	 DEVI	11/03/23	
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP		DATE
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
PRESSURE REGULATOR	1H7C21	1	3B357	1BV9	✓	
RELIEF VALVE	KVOS-268	1	NSN	NSN	✓	
ORING	MS9385-12	2	NSN	NSN	✓	
O-RING	MS9385-10	1	NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		
GENERAL TOOL	NSN	O/C		SERVICEABLE		



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

**PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023**

DATE : 10 - MAR - 2023	A/C REG : PK-SNA
A/C TYPE : C208B	CHECKER : Azmi Andika SIGN:

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202-201	21031090020	MARCH 2030	SERVICEABLE
2	Co-Pilot Life Vest	P01202-201	21031090008	MARCH 2030	SERVICEABLE
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	Firt Aid Kit	FL 220	0221 1898	FEB 2024	SERVICEABLE
14	Crash Axe Installed	NPN	NSN	o/c	SERVICEABLE
15	Fire Extinguisher	C 352	G-40531481	JULY 2024	SERVICEABLE
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)	FL220	105755	JAN 2024	SERVICEABLE
OTHERS					
18.	FLASH UGHT	NPN	NSN	o/c	SERVICEABLE



Additional Work Sheet
400 Hrs A/F Insp. & Add. Task

Aircraft Registration: PK-SNA

WO# Nr: WO/035-SNA/II/2023

Parts Used Sheet

Part Used

[illegible]



Aircraft Registration: PK-SNA

WO# Nr.:—WO/035-SNA/II/2023

Additional Work Sheet
400 Hrs A/F Insp. & Add. Task

Tools Used Sheet

[illegible]