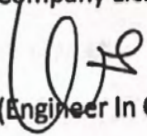
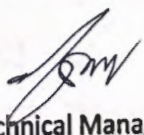









PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Doc. 12 & Add.Task	No.	WO/037-SNA/XI/2022
	Date	9 Nov 2022
	A/C Reg.	PK-SNA C208B-5634
Reference : MP C208B REV. 12	Prepared By	TS
	Checked By	CI
	Approved By	TM
To : Engineer In Charge		
Description : 1. Perform Inspection Doc. 12 & Add.Task 2. Make an entry in Maintenance Log. 3. Return the Completed Work Order and Form to PPC. #If any finding, please close the routine card, and transferred to inspection card.		
Additional Work :		
Compliance Statement	Sign & Date Company Lic. No.: SCA27  (Engineer In Charge) wahono.	Signature  (Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JOWO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
9 Nov 2022	WO/037-SNA/XI/2022	Inspection Doc. 12 & Add. Task	20 November 2022		
A/C Type		Mfg. Serial Number	A/C Registration		
C208B		C208B-5634	PK-SNA		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-VA0730	1603:11 / 2614		
	#2	-			
Propeller/Rotor	#1	200483	1603:11 / 2614		
	#2	-			
Landing Gear	NLG		2614		
	LH MLG		2614		
	RH MLG		2614		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	2	#001 ; #002		
2	Inspection Card	-			
3	Work Order	1	✓		
4	Summary Inspection List	1	✓		
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1	✓		
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
<u>IC-001</u>	B324001	FOUND LH BRAKE DISC WORN OUT.		✓	
<u>IC-002</u>	A322001	FOUND MPI BOLT WORN OUT.		✓	
<u>IC-003</u>	B611101	WASHER SPINNER BROKEN		✓	
<u>IC-004</u>	B611101	CARBON BLOCK OUT OF LIMIT. (MINIMUM 0.010")		✓	
<u>IC-005</u>	B284103	O-RING FILLER CAP NEED TO BE REPLACE		✓	
<u>IC-006</u>	F742002	FOUND LH IGNITER WORN OUT.		✓	

SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/037-SNA/IX/2022

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B03	PT6A-140 ENGINE GROUND RUN PERFORMANCE	20/2022 11	-	Wahyono	
2	CHAPTER 12	INSPECTION DOCUMENT 06	20/2022 11	-	Wahyono	
3	CHAPTER 13	INSPECTION DOCUMENT 07	20/2022 11	-	Wahyono	
4	CHAPTER 14	INSPECTION DOCUMENT 08	20/2022 11	-	Wahyono	
5	CHAPTER 15	INSPECTION DOCUMENT 09	20/2022 11	-	Wahyono	
6	CHAPTER 16	INSPECTION DOCUMENT 10	20/2022 11	-	Wahyono	
7	CHAPTER 17	INSPECTION DOCUMENT 11	20/2022 11	-	Wahyono	
8	CHAPTER 18	INSPECTION DOCUMENT 12	20/2022 11	-	Wahyono	
9	CHAPTER 32	INSPECTION DOCUMENT 26 (BATTERY CAPACITY CHECK)	20/2022 11	-	Wahyono	
10	CHAPTER 51	ENGINE PT6A-140 100 HOUR INSPECTION/ MINOR INSPECTION	20/2022 11	-	Wahyono	
11	CHAPTER 52	ENGINE PT6A-140 200 HOUR INSPECTION	20/2022 11	-	Wahyono	
12	CHAPTER 53	ENGINE PT6A-140 200 HOUR / 6 MONTHS INSPECTION	20/2022 11	-	Wahyono	
13	CHAPTER 54	ENGINE PT6A-140 400 HOUR INSPECTION	20/2022 11	-	Wahyono	
14	NRC-001	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT PART NUMBER: AAD9-18-1	20/2022 11	-	Wahyono	
15	NRC-002	VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT PART NUMBER: B3-5-1	20/2022 11	-	Wahyono	
16	SCA/MTC/ 023	EMERGENCY EQUIPMENT CHECK	20/2022 11	-	Wahyono	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION (CRS-SMI)

A/C TYPE : CESSNA 208B

TTSN : 1603-11

A/C REG : PK-SNA

TCSN : 2614

MSN : C208B-5634

DATE : 20 Nov 2022

TYPE OF INSPECTION : INSPECTION DOC. 12 & ADD. TASK

DUE AT : 1600 HOURS


REF : MP C208B REV. 12

EXCEPTION

-NO EXCEPTION-

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
WAHYONO	AIRFRAME & POWER PLANT	5792/SCA27		20 / 2022
	EIRA			NOV

THE NEXT DUE TYPE OF INSPECTION : 100 hrs Insp.

DUE AT : 1700 hrs.

Form: SCA/MTC/049

Reg. Mark : PK - SNA

WO/FML No. : WO/037-SNA/XI/2022

PRE – INSPECTION	
Location	NBX
Date	17 Nov 2022
Cycle	1
Filed Barometric	1013 HPA
OAT	31°C
Altitude	210 ft

POST – INSPECTION	
Location	NBX
Date	20 NOV 22
Cycle	2
Filed Barometric	1013 HPA
OAT	31°C
Altitude	210 FT.

PRE – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1880
ITT	841 °C	830 °C
Ng	102.7 %	100.7 %
Wf	578	538
Oil Press		92 PSI
Oil Temp		68 °C
Start Temp		681 °C

POST – INSPECTION		
	Target	Actual
Tq	2397	2397
Np	1900	1880
ITT	841 °C	817 °C
Ng	102.7 %	100.7 %
Wf	578	538
Oil Press		90 PSI
Oil Temp		74 °C
Start Temp		683 °C

Engine Run Up Checks						
Inertial ☒	EPL ☒	OVG ☒	Stby Alt ☒	BOV ☒	Brake ☒	Randomn ☒
NOTE: 1. Brake system at Torque 2000 ft-lbs. 2. Inertial Separator at Torque 400 ft-lbs. 3. EPL check can't exceed 4% Ng per second. 4. Standby Alt at 80% Ng. 5. Low idle at 55.5 - 57% 40Amps. 6. High idle at 64 - 66% Ng 40Amps.						

Engine Performance Target Table (Cessna C208B EX)

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft.lbs)	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397	2397
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	835	837	839	841	841	841	841	841	841	842	843	844	846	846	846
Ng (%)	102.7	102.7	102.7	102.7	102.7	102.7	102.7	102.6	102.6	102.6	102.6	102.6	102.6	102.6	102.5
WF (PPH)	578	578	578	578	578	578	578	570	565	565	560	560	555	548	548

Note:

1. Make sure that Inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 580 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.


REMARKS: Satisfy

PERFORMED BY			
Name	Sign & Stamp	Date	Location
Wahyono		20/2022 Nov	Nabire

	INSPECTION CARD (Form: SCA/MTC/ 048)		TECHNICAL DEPARTMENT	
---	--	--	---------------------------------	--

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC - 001	WO/037-SNA/X1/2022		B324001	19 NOVEMBER 2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK - SNA	C208B EX	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
LANDING GEAR	NABIRE	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
FOUND LH BRAKE DISC WORN OUT.		19 Nov 2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED LH BRAKE DISC WITH A NEW ONE. REF. C208B AMM CHAPTER 32-40-00 Performed at A/C TT : 1603:11 A/C TC/LDG : 2614			19 NOV 2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BRAKE DISC	16A-22201	1	NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		
TORQUE WRENCH	TA-0250	Nov 2023		OK		
GENERAL TOOLS	-	OK		OK		



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD#	2. JO/WO#	3. ORIGINATOR	4. CARD REF	5. DATE
IC-002	WO/037-SNA/X1/2022		A322001	18 NOVEMBER 2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER#	
PK-SNA	C208B EX	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
NOSE LANDING GEAR	NABIRE	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCR INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
FOUND MPI BOLT WORN OUT.		18/NOV 2022

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED MPI BOLT WITH A NEW. REF C208B AMM CHAPTER 32-20-00 Performed at A/C TT: 1603:11 A/C TC/LDG: 2614	AP	CE	18/NOV 2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3			
PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector			
NOTICE OF INSPECTOR		INSP	DATE

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
BOLT	53461-88	2	8NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE		STATUS		
TORQUE WRENCH	TA-0250	NOV 2023		OK		
GENERAL TOOLS	-	OK		OK		



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
1C-003	WO/037-SNA/X1/2022		B611101	18 NOVEMBER 2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNA	C208B EX	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
PROPELLER	NABIRE	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
WASHER SPINNER BROKEN.		

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED WASHER SPINNER WITH A NEW. REF. C208B AMM CHAPTER 61-10-00. Performed at A/C TT : 1603:11 A/C TC /LDG : 2614	As	Ge	18/NOV 2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
WASHER	A1020 A1638-5	10	NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
GENERAL TOOLS	-	OK	OK			



INSPECTION CARD

(Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-004	WO/C37-SNA/21/2022		B611101	19 NOVEMBER 2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNA	C208B EX	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
PROPELLER	NABIRE	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPOI INSPECTION, PLEASE COMPLETE SET, 20	14	15
	PPC/ENG	DATE
CARBON BLOCK OUT OF LIMIT. (MINIMUM 0.010").		

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED CARBON BLOCK WITH A NEW. REF. C208B AMM CHAPTER 61-10-00 Performed at A/C TT: 1603:11 A/C TC/LDG: 2614	AK	CE	19/NOV 2022

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill		
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill		
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain		
☐ Others	☐ Wet Insulation Blanket		
☐ Other			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
CARBON BLOCK	A 3044	1	NSN	NSN	✓	

23. TOOLS REQUIRED			
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	OK	OK



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JOWO #	3. ORIGINATOR	4. CARD REF	5. DATE
LC-005	W0/037-SNA/x1/2022		B284103	19 NOVEMBER 2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNA	C208B EX	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
WING	NABIRE	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
O-RING FILLER CAP NEED TO BE REPLACE.		

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED O-RING FILLER CAP WITH A NEW. REF. C208B AMM CHAPTER 28-10-01. Performed at A/C TT: 1603:11 A/C TC/LDG: 2014	Am	Cof	
20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other		
CORROSION ☐ Isolated ☐ Widespread CORROSION LVL ☐ 1 ☐ 2 ☐ 3 PROPOSED ACTION ☐ Doublers ☐ Others			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	MS29513-338	2	NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
GENERAL TOOLS	-	OK	OK			

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/037-SNA/XI/2022	18 Nov 2022	REPLACEMENT	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
001	37	Air frame	NOX
9. ZONE	10. PANEL		
Cockpit			

11. DESCRIPTION

PERFORM VACUUM SYSTEM CENTRAL AIR FILTER REPLACEMENT
P/N: D9-18-1 / C294502-0201

REFERENCE	☒ AMM Ch. 37-10-00-960	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED REPLACED VACUUM SYSTEM CENTRAL AIR
FILTER.

REF. AMM C2088 CHAPTER 37-10-00

Performed at A/C TT : 1603:11 A/C TC /LDG : 2614

FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER VACUUM	D9-18-1	1 EA	✓	GOOD

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	OF	GOOD

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/037-SNA/XI/2022	18 Nov 2022	REPLACEMENT	PK-SNA
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
002	37	Airframe	NBx
9. ZONE	10. PANEL		
Cockpit			

11. DESCRIPTION			
PERFORM VACUUM RELIEF VALVE FILTER REPLACEMENT P/N: B3-5-1 / C482001-0202			
REFERENCE	☒ AMM Ch. 37-10-00-961	☐	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT		MECH	ENG	INSP (*)
PERFORMED REPLACED VACUUM RELIEF VALVE FILTER. REF. AMM C2000 CHAPTER 37-10-00 Performed at A/C TT : A/C TC /LDG :		Am	CE	
FINDING	☐ Y	☐ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				

13. PARTS REQUIRED				
DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER VACUUM RELIEF VALVE	B3-5-1	1	✓	Good

14. TOOLS REQUIRED			
DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	OK	Good



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

**PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023**

DATE : 20 NOV 2022



A/C REG : PK-SNA

A/C TYPE : C208B

CHECKER : Wahyono

SIGN: [Signature]

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	P01202 - 201	21031090020	March 2030	Serviceable
2	Co-Pilot Life Vest	P01202 - 201	21031090008	March 2030	Serviceable
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	FL 220	0221 1898	FEB 2023	Serviceable
14	Crash Axe Installed	NPN	NSN	-	Secured
15	Fire Extinguisher	C352	G-40531481	JULY 2023	Serviceable
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)	FL 220	105755	JAN 2023	Serviceable
OTHERS					



Parts Used Sheet

[illegible]



Additional Work Sheet
Inspection Doc. 12 & Add Task

Parts Used Sheet

[illegible]