



PT. SMART CAKRAWALA AVIATION

WORK ORDER

Form: SCA/MTC/030

Subject : Inspection Document 10 & Add Task	No.	WO/108-SNM/XI/2022
	Date	17 Nov 2022
	A/C Reg.	PK-SNM C208-00655
Reference : MP C208B Rev. 12	Prepared By	TS
	Checked By	CI
	Approved By	TM

To : Engineer In Charge

Description :

1. Perform Inspection Document 10 & Add Task
2. Make an entry in Maintenance Log.
3. Return the Completed Work Order and Form to PPC.

#If any finding, please close the routine card, and transferred to inspection card.

Additional Work :

NIL

Compliance
Statement

Carried Out

Sign & Date
Company Lic. No.:

[Signature] 10 Jan 2023.
SCA 031





(Engineer In Charge)

A. Arju Permana

Signature


[Signature]
(Technical Manager)

AIRCRAFT CHECK WORK SUMMARY
(Form: SCA/MTC/051)

DATE OF ISSUED	JO/WO #	TYPE OF MAINTENANCE	DATE OF ACCOMPLISHED		
17 Nov 2022	WO/108-SNM/XI/2022	Inspection Doc. 10 & Add Task	10 / JAN / 2023		
A/C Type		Mfg. Serial Number	A/C Registration		
C208		C208-00655	PK-SNM		
AIRCRAFT DATA					
Subject	Pos #	Serial Number (SN)	TTSN/TCSN		
Engine	#1	PCE-PC2316	3998 : 13 / 5474		
	#2	-			
Propeller/Rotor	#1	190085	3998 : 13 / 5474		
	#2	-			
Landing Gear	NLG		3998 : 13 / 5474		
	LH MLG		3998 : 13 / 5474		
	RH MLG		3998 : 13 / 5474		
PACKAGE COVERED					
No	Subject	Qty	Remark		
1	Non-Routine Card	2	#001, #002		
2	Inspection Card	1			
3	Work Order	1			
4	Summary Inspection List	1			
5	Material and Tool List	-			
6	Escalation form	-			
7	CRS (SMI / Unscheduled Maintenance)	1			
INSPECTION CARD (IC) LIST (Finding during maintenance)					
No	Taskcard Ref	Subject	Status		Name/ Sign & Stamp
			Open	Close	
IC-001	A322001	MPI BOLT NEED TO BE REPLACED	-	✓	CEP NANA  
IC-002	B324001	O-RING BRAKE CALPER FOUND LEAK	-	✓	ARIS  
IC-003		L/H LAMTER LEAD CABLE FOUND WORN OUT	-	✓	Agus  
IC-004		R/H LAMTER LEAD CABLE NEED TO REPLACE	-	✓	Agus  
IC-005					
IC-006					

<u>IC-007</u>					
<u>IC-008</u>					
<u>IC-009</u>					
<u>IC-010</u>					
<u>IC-011</u>					
<u>IC-012</u>					
<u>IC-013</u>					
<u>IC-014</u>					
<u>IC-015</u>					

Prepared by :
Technical Support



Hani

Checked by :
Chief Maintenance



Dodit

Verified by :
Chief Inspector



Yanuar

Approved by :
Technical Manager



Istiono



SUMMARY INSPECTION ITEMS (Form: SCA/MTC/050)

WO Ref: WO/108-SNM/XI/2022

NO.	TASK CARD NO.	DESCRIPTION	DATE	EST MHR	NAME	STAMP
1	B02	PT6A-114A ENGINE GROUND RUN PERFORMANCE	10 Jan 2023		Arjo P.	
2	CHAPTER 13	INSPECTION DOCUMENT 07	07 Jan 2023		Arjo P.	
3	CHAPTER 14	INSPECTION DOCUMENT 08	23 Dec 2022	3 MHR	Arjo P.	
4	CHAPTER 15	INSPECTION DOCUMENT 09	23 DEC 2022	7 MHR	AGUS SULAEMAN	
5	CHAPTER 16	INSPECTION DOCUMENT 10	23 Dec 2022	8 MHR	Arjo P.	
6	NRC-001	REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD P/N: C294502-0201 OR AAD9-1B-1	23 DEC 2022	0.5 MHR	AGUS SULAEMAN	
7	NRC-002	REPLACE VACUUM RELIEF VALVE FILTER DISCARD P/N: C482001-0202 OR B3-5-1	23 DEC 2022	0.5 MHR	AGUS SULAEMAN	
8	SCA/MTC/023	EMERGENCY EQUIPMENT CHECKLIST	23 Dec 2022	0.5 MHR	Arjo P.	



PT. SMART CAKRAWALA AVIATION

CERTIFICATE RETURN TO SERVICE

SCHEDULED MAINTENANCE INSPECTION
(CRS-SMI)

A/C TYPE : CESSNA 208
A/C REG : PK-SNM
MSN : C208-00655
TTSN : 3998:13
TCSN : 5974.
DATE : 10 Jan 2023

TYPE OF INSPECTION : INSPECTION DOCUMENT 10 & ADD TASK
DUE AT : 3954 HOURS
REF : MP C208/C208B REV. 12

EXCEPTION

- NIL -

AUTHORIZED PERSON

I hereby certify that this aircraft has been maintained accordance with CASR and Maintenance Program.
Aircraft safe and airworthy for flight

NAME	CAT	AMEL/OTR NO	SIGN&STAMP	DATE
D. Arya Permanto.	AIRFRAME & POWER PLANT	9505/SLA 031	 	10 Jan 2023.
	EIRA			

THE NEXT DUE TYPE OF INSPECTION : 100 Hrs.

DUE AT : 4054:00 - FH.

Form: SCA/MTC/049



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-001	WO/108-SNM/K1/2022	CEP HANA	A322001	21-DEC-2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNM-00655	C208	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
NOSE LANDING GEAR	MALINAW			

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14	15
	PPC/ENG	DATE
MPI BOLT NEED TO REPLACE		21/12 2022

16. CORRECTIVE ACTION	17	18	19
	MECH	ENG. LIC	DATE
REPLACED MPI BOLT WITH NEW PARTS.			21/12 2022

Performed at A/C TT : A/C TC /LDG :

20. CORROSION INFORMATION		17	18	19
LOCATION	CAUSE OF DAMAGE			
	☐ Environment			
	☐ Internal Leakage			
CORROSION ☐ Isolated ☐ Widespread	☐ Chemical Spill			
CORROSION LVL ☐ 1 ☐ 2 ☐ 3	☐ LAV/Galley Spill			
PROPOSED ACTION ☐ Doublers	☐ Blocked Drain			
☐ Others	☐ Wet Insulation Blanket			
	☐ Other			
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP		DATE
NOTICE OF INSPECTOR				

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
MPI BOLT	S3461-88	2	NSN	NSN	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
TORQUE WRENCH	96212	AUG 2023	SERVICEABLE			
GENERAL TOOLS	NPN	O/C	ON CONDITION			



INSPECTION CARD (Form: SCA/MTC/ 048)

TECHNICAL
DEPARTMENT

1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE
IC-002	WO/108-SNM/xi/x	ARIS K	B324001	22/DEC-2022
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #	
PK-SNM/00655	C208	AIRFRAME		
9. ZONE	10. STA	11. MTC TYPE		
MAIN LANDING G	MALINAV	REPLACEMENT		

13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20	14 PPC/ENG	15 DATE
BRAKE CALLIPER ON R/H SIDE FOUND LEAKING	FA	22/12-22

16. CORRECTIVE ACTION	17 MECH	18 ENG. LIC	19 DATE
REPLACED O-RING ON R/H BRAKE CALLIPER REF: I.A.W ONE VIEW C208 SERIES, CHAP: 32-40-00 DO THE BLEEDING ON BRAKE CALLIPER FOUND SATIS Performed at A/C TT: 3958:13 A/C TC/LDG: 5479		3523	

20. CORROSION INFORMATION			
LOCATION	CAUSE OF DAMAGE		
	☐ Environment		
	☐ Internal Leakage		
	☐ Chemical Spill		
	☐ LAV/Galley Soil		
	☐ Blocked Drain		
	☐ Wet Insulation Blanket		
	☐ Other		
21. If the defect is RII, Please Sign this card finally by RII Inspector		INSP	DATE
NOTICE OF INSPECTOR			

22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
O-RING	MS28775-224	4			✓	
O-RING	MS28775-011	2			✓	
PISTON BRAKE INSULATION	088-00100	1			✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
BLEEDING PUMP	MPN	O/C	GOOD			
TORQUE WRENCH	96212	AUG 2023	SERVICEABLE			

		INSPECTION CARD (Form: SCA/MTC/048)		TECHNICAL DEPARTMENT		
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
IC-003.	WO/108-SNH/12/2022	Arjo.		10 Jan 2023.		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SNH-00655	C208.	Air Frame.				
9. ZONE	10. STA	11. MTC TYPE				
Engine.	LNU					
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20				14 PPC/ENG	15 DATE	
L/H Igniter lead Cable. was worn out.					10/01/2023	
16. CORRECTIVE ACTION			17 MECH	18 ENG. LIC	19 DATE	
Removed and Replaced. L/H Igniter lead Cable with the New. Part C208 B, MM # 74-20-00. Performed at A/C TT: 3998:13 A/C TC/IDG: 5479.					10/01/2023	
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE	
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Lead Cable.	CH-5399-02	1	-	-	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
General Tools.			OK.			
Torque wrench.	96212	AUG 2023	Serviceable.			

		INSPECTION CARD (Form: SCA/MTC/ 048)			TECHNICAL DEPARTMENT	
1. CARD #	2. JO/WO #	3. ORIGINATOR	4. CARD REF	5. DATE		
1C-009.	NO/108-SMM/1/2022	Argo.		10 Jan 2023.		
6. A/C REG/MSN	7. A/C TYPE	8. TRADE	12. VENDOR ORDER #			
PK-SMM/00655	C208.	AsFrame.				
9. ZONE	10. STA	11. MTC TYPE				
Engine.	LNU					
13. DESCRIPTION/DEFECT-IF FINDING OF CPCP INSPECTION, PLEASE COMPLETE SET. 20				14	15	
				PPC/ENG	DATE	
R/H Igniter lead Cable was worn out.					10/01/2023	
16. CORRECTIVE ACTION			17	18	19	
			MECH	ENG. LIC	DATE	
Removal and Replaced R/H Igniter lead Cable with the New. IAW C208 B MM #74-20-00. Performed at A/C TT: 3998:13 A/C TC ALDG: 5479				10/01/2023		
20. CORROSION INFORMATION						
LOCATION		CAUSE OF DAMAGE				
		☐ Environment ☐ Internal Leakage ☐ Chemical Spill ☐ LAV/Galley Spill ☐ Blocked Drain ☐ Wet Insulation Blanket ☐ Other				
CORROSION ☐ Isolated ☐ Widespread						
CORROSION LVL ☐ 1 ☐ 2 ☐ 3						
PROPOSED ACTION ☐ Doublers ☐ Others						
21. If the defect is RII, Please Sign this card finally by RII Inspector				INSP	DATE	
NOTICE OF INSPECTOR						
22. PARTS REQUIRED						
PART DESCRIPTION	PART NO	QTY	SERIAL NO		STATUS	
			ON	OFF	CLOSE	OPEN
Lead Cable	CH 5399-02	1	-	-	✓	
23. TOOLS REQUIRED						
DESCRIPTION	PART NO. / MODEL	NEXT CALIBRATION DATE	STATUS			
General Tools			OK			
Torque wrench	76212	AUG 2023	Serviceable			

Appendix B02 – PT6A-114A Engine Run Performance Sheet

Reg. Mark : PK - SNM

WO/FML No. : WO/108-SNM/XI/2022

PRE – INSPECTION	
Location	
Date	
Cycle	
Filled Barometric	weather
OAT	
Altitude	

POST – INSPECTION	
Location	LNU
Date	10 Jan 2023
Cycle	
Filled Barometric	29,92 IN/Hg.
OAT	32 °C
Altitude	60 FT.

PRE – INSPECTION		
	Target	Actual
Tq		
Np		
ITT	°C	°C
Ng	%	%
Wf		
Oil Press		°C
Oil Temp		°C
Start Temp		°C

POST – INSPECTION		
	Target	Actual
Tq	1865	1865.
Np	1900	1880
ITT	790 °C	735 °C
Ng	99,2 %	97,7 %
Wf	450.	430
Oil Press		89 °C
Oil Temp		75 °C
Start Temp		650 °C

Engine Run Up Checks

Inertial ☒ EPL ☒ OVG ☒ Stby Alt ☒ BOV ☒ Brake ☒ Random ☒

NOTE:

1. Brake system at Torque 1500 ft-lbs.
2. Inertial Separator at Torque 400 ft-lbs.
3. EPL check can't exceed 4% Ng per second.
4. Standby Alt at 80% Ng.
5. Low idle at 52.5 – 53.5% 40Amps.
6. High idle at 64 – 66% Ng 40Amps.

Engine Performance Target Table Cessna C208

OAT (°C)	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
Tq (ft-lbs)	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865	1865
Np	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900	1900
ITT (°C)	772	775	778	780	785	790	793	795	797	800	800	800	802	805	810
Ng (%)	98.5	98.5	99	99	99.1	99.2	99.4	99.5	99.5	100	100	100.2	100.5	100.7	100.9
WF (PPH)	450	450	450	450	450	450	450	450	450	450	450	450	448	448	446

Note:

1. Make sure that Inertial separator in normal condition, no bleed air extracted from the engine and air condition OFF.
2. This table only applies to altitude 0-500 feet MSL. For higher altitude, refer to EMM 72-00-00.
3. Max fuel flow is 465 lb/hr fuel flow is not more than 15 lbs/hr higher than the value shown in table.
4. If parameters are outside the target performance table to EMM chapter 71-00-00.

REMARKS:

Carried Out.

PERFORMED BY

Name	Sign & Stamp	Date	Location
Arya P.		10 Jan 2023	LNU

NON ROUTINE CARD (Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WD/108-SNM/XI/2022	23 DEC 22	REPLACEMENT	PK-SNM/208-00655
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
#001	37	AIRFRAME	215 FS
9. ZONE	10. PANEL		
COCKPIT			

11. DESCRIPTION

PERFORM REPLACE VACUUM SYSTEM CENTRAL AIR FILTER DISCARD
PN: AAD9-18-1

REFERENCE	☒ AMM Ch. 37-10-00-960	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED VACUUM SYSTEM CENTRAL AIR
FILTER REPLACEMENT. CHECK GOOD.

Performed at A/C TT : 3998:13 A/C TC /LDG : 5474

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				23 12 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	AD9-18-1	1		OK

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	OC	OK.

NON ROUTINE CARD
(Form: SCA/MTC/047)

1. JO/WO #	2. DATE	3. MTC TYPE	4. A/C REG/MSN
WO/108-SNM/XI/2022	23 DEC 2022	REPLACEMENT	PK-SNM/208-00655
5. CARD #	6. ATA SPEC	7. TRADE	8. STA
4002	37	AIRFRAME	215 FS
9. ZONE	10. PANEL		
COCKPIT			

11. DESCRIPTION

PERFORM REPLACE VACUUM RELIEF VALVE FILTER DISCARD
PN: B3-5-1

REFERENCE	☒ AMM Ch. 37-10-00-961	☐ EMM Ch	☐ OTHER
RII (*)	☐ Y	☒ N	MHR :

12. RESULT

PERFORMED VACUUM RELIEF VALVE FILTER
REPLACEMENT. RESULT GOOD & SECURE.

Performed at A/C TT : 3998:13 A/C TC/LDG : 5474

FINDING	☐ Y	☒ N	ACT MHR :	DATE/TIME (DD/MM/YY)
INSPECTION CARD (IC) #				23 12 2022

13. PARTS REQUIRED

DESCRIPTION	PART NO	QTY	REMARK	
			STOCK	STATUS
FILTER	B3-5-1	1		OK

14. TOOLS REQUIRED

DESCRIPTION	PART NO / MODEL	NEXT CALIBRATION DATE	STATUS
GENERAL TOOLS	-	OC	OK

VACUUM DISTRIBUTION - INSPECTION/CHECK**1. General**

A. This section has the inspections and checks necessary to keep the vacuum distribution system in a serviceable condition.

TASK 37-10-00-960**2. Vacuum System Central Air Filter Discard**

CAUTION: Do not operate the vacuum system with the filter removed or a vacuum line disconnected. Dust and other foreign objects can enter the system and damage the vacuum operated instruments.

A. General

(1) This task gives the instructions to discard the vacuum system central air filter.

B. Special Tools

(1) None

C. Access

(1) None

D. Discard the Vacuum System Central Air Filter.

(1) Remove the vacuum system central air filter. Refer to Chapter 12, Vacuum System Central Air Filter - Servicing.

(a) Discard the filter.

(2) Install a new vacuum system central air filter. Refer to Chapter 12, Vacuum System Central Air Filter - Servicing.

E. Restore Access

(1) None

END OF TASK**TASK 37-10-00-961****3. Vacuum Relief Valve Filter Discard**

CAUTION: Do not operate the vacuum system with the filter removed or a vacuum line disconnected. Dust and other foreign objects can enter the system and damage the vacuum operated instruments.

A. General

(1) This task gives the instructions to discard the vacuum relief valve filter.

B. Special Tools

(1) None

C. Access

(1) None

D. Discard the Vacuum Relief Valve Filter.

(1) Get access to the relief valve behind the attitude gyro.

(2) Carefully stretch the foam element filter over the top of the retaining bezel.

(3) Remove the filter from the relief valve and discard it.

(4) Stretch a new relief valve filter over the top of the retaining bezel.

(5) Make sure that the filter is secure on the relief valve.

E. Restore Access

(1) None

END OF TASK

VACUUM SYSTEM CENTRAL AIR FILTER - SERVICING

1. General

- A. The vacuum system central air filter keeps dust and dirt from entering the vacuum operated instruments.

CAUTION: Do not operate vacuum system with filter removed or vacuum line disconnected, as dust and other foreign matter may enter the system and damage the vacuum operated instruments.

- B. Refer to Chapter 5, *Inspection Time Limits* for filter inspection intervals. Replace filter element when damaged and whenever it becomes sufficiently clogged to cause suction gage reading to drop below 4.5 inches Hg (mercury).

CAUTION: Smoking during system operation will cause premature filter clogging.

2. Servicing

- A. Remove Air Filter (Refer to Figure 301).

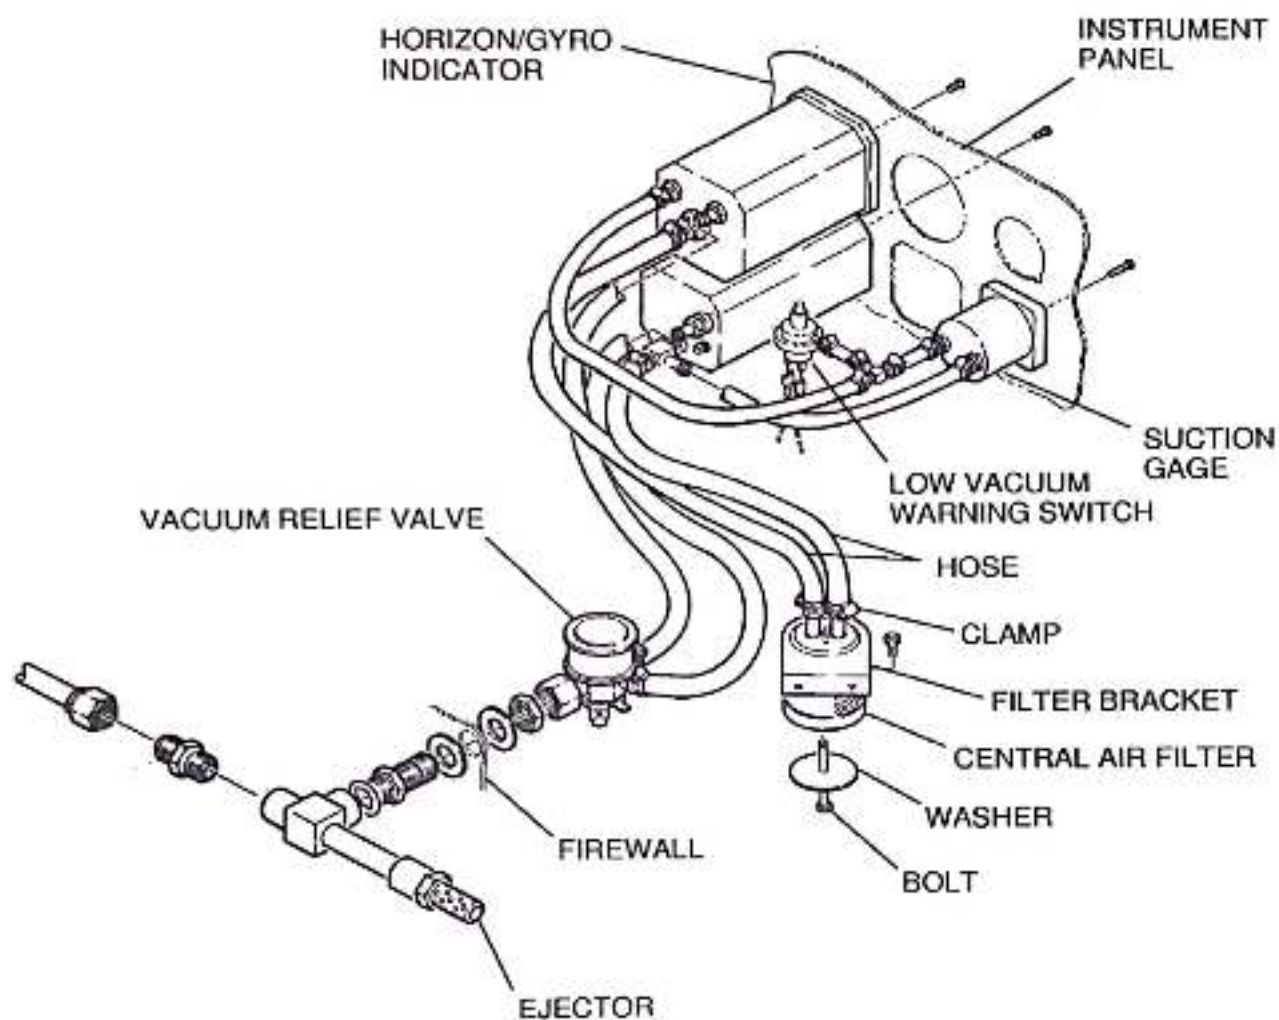
- (1) Unscrew bolt and washer from bottom of central air filter.
- (2) Remove central air filter from filter bracket.
- (3) Inspect for damage, deterioration and contamination. Clean or replace as required.

- B. Install Air Filter (Refer to Figure 301).

- (1) Seat central air filter up and into filter bracket.
- (2) Secure central air filter to filter bracket using bolt and washer.
- (3) Check central air filter for unobstructed flow. A properly functioning filter should allow a reading of at least 4.5 inches Hg (mercury) on the instrument panel suction gage.

Figure 301 : Sheet 1 : Vacuum System Central Air Filter Servicing

A22B53



26141069



EMERGENCY EQUIPMENT LIST INSPECTION & MONITOR

PT. SMART CAKRAWALA
AVIATION
DEPARTMENT TEKNIK
Form: SCA/MTC/023

DATE : 23 Dec 2022	A/C REG : PK-SNM
A/C TYPE : C 208	CHECKER : Arjn SIGN:

No.	Description	P/N	S/N	Next Insp.	Remarks
1	Pilot Life Vest	Life Vest	21071600007	March 2030	Good
2	Co-Pilot Life Vest	Life Vest.	21071600099	March 2030	Good
3	Pax Life Vest				
4	Pax Life Vest				
5	Pax Life Vest				
6	Pax Life Vest				
7	Pax Life Vest				
8	Pax Life Vest				
9	Pax Life Vest				
10	Pax Life Vest				
11	Pax Life Vest				
12	Pax Life Vest				
13	First Aid Kit	FAK	-	April 2023	Good.
14	Crash Axe Installed	-	-	-	Good.
15	Fire Extinguisher	C 352	F60588684	Nov 2023	Good.
16	Life Raft (If Installed)				
17	Survival Kit (If Installed)				
OTHERS					
18	Flash light	-	-	-	Good.
.					



Additional Work Sheet
Inspection Doc. 10 & Add Task

WO/108-SNM/XI/2022

Parts Used Sheet

[illegible]



Additional Work Sheet
Inspection Doc. 10 & Add Task

PK-SNM

WO # NR

WO/108-SNM/XI/2022

Parts Used Sheet

2

Part Used

[illegible]

Reg. Mark : PK - SNM







Date : ~~07/11/2023~~ 23 Dec 2022

MSN : C208 - 00655


Station : Malinau.

TSN / CSN : 3998:13 / 5474

WO No. : WO/108-SNM/XI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
A243601	121	Standby Alternator Detailed Inspection Task 24-36-00-220		
B251001	221 232	Inertia Reel Operational Check Task 25-10-00-710		
B255201	901 902 903 904 905 906	Cargo Pod Drains Operational Check Task 25-52-00-710		
A261001	121 122	Engine Fire Detection System General Visual Inspection Task 26-10-00-210		
C271001	211 212 217 218 233 234 253 254 251 252 551 571 651 671	Aileron Trim System Lubrication Task 27-10-02-640		
B271005	551 571 651 671	Aileron Trim Tab (Free Play) Functional Check Task 27-10-02-720		
B273003	371 372 375 376	Elevator Trim Tab (Free Play) Functional Check Task 27-30-02-720		
D282101	130	Firewall Mounted Fuel Filter Servicing Task 28-21-00-610		
B282103	213 214 220	Firewall Fuel Shutoff Valve Control Operational Check Task 28-21-00-711		
C282301	231 232 511 611	Wing Shutoff Valve Linkage Lubrication Task 28-23-00-640		
B284101	ENG	Fuel Reservoir Warning System Operational Check Task 28-41-00-710		
B301001	122 AUX	Bleed Air Pressure Regulator Functional Check (Airplanes with de-ice boots installed) Task 30-10-00-720		
A353003	256	Portable Oxygen Cylinder Detailed Inspection Task 35-30-00-221		

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B611101	110	McCauley Propeller Functional Check Task 61-11-00-720		
A712001	130	Engine Mounts and Firewall Detailed Inspection Task 71-20-00-220		
A716001	130	Inertial Air Separator Detailed Inspection Task 71-60-00-220		
B761001	130 211 212 ENG	Engine Controls Functional Check Task 76-10-00-72		
A801001	130	Starter-Generator (Part Number 23081 Series only) Detailed Inspection Task 80-10-00-220	N/A	
*** End of Inspection Document 07 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
Agus Kurniawan	ENGINEER		3523
AGUS SULAE MAN	ENGINEER		6444
D. Arga P.	Engineer		9105

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.


Name : D. Arga Permana . Stamp : 
Signature :  Place/Date : LUK/07 Jan 2023

MAINTENANCE PROGRAM CESSNA C208/C208B

Chapter 14 – Inspection Document 08

Reg. Mark : PK-SNM Date : 23 Dec. 2022
 MSN : C208-00655 Station : Malinau.
 TSN / CSN : 3998:13 / 5474 WO No. : WO/108-SNM/XI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B215001	121 122	Compressor Drive Belt Functional Check Task 21-50-00-720	N/A	
A322001	710	Nose Landing Gear Detailed Inspection Task 32-20-00-220		
*** End of Inspection Document 08 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP NANA	ENGINEER		1809
D. Arya P.	Engineer		9505.
ARIS KURNIAWAN	ENGINEER		9523




RETURN TO SERVICE



The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.

Name : D. Arya Bermana Stamp : 
 Signature :  Place/Date : LNU / 23-12-2022

Reg. Mark : PK - SNM
MSN : C208 - 00655
TSN / CSN : 3998:13/5979


Date : 22 Dec. 2022
Station : Malinau.
WO No. : WO/108-SNM/XI/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B212401	211 212	Avionics Cooling Fan Operational Check Task 21-24-00-710		
B221201	226 232	Garmin Autopilot (GFC 700) Functional Check Task 22-12-00-720		
B221203	226 232	Garmin Autopilot (GFC 700) Slip Clutch Override Operational Check Task 22-12-00-710		
C273030	213 214	Elevator Belcrank Lubrication Task 12-21-02-640		
A275001	231 232	Flap Actuator Mount Bracket Detailed Inspection Task 27-50-00-220		
A275003	251 252 511 611 525 625	Flap Belcrank Detailed Inspection Task 27-50-00-221		
*** End of Inspection Document 09 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP NANA	ENGINEER		1819
AGUS SULAEMAN	ENGINEER		6444
ARIS KURNIAWAN	ENGINEER		5523

RETURN TO SERVICE

The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.


Name : AGUS SULAEMAN Stamp : 
Signature :  Place/Date : LNU / 23 DEC 2022

MAINTENANCE PROGRAM CESSNA C208/C208B


Chapter 16 – Inspection Document 10


Reg. Mark : PK - SNM
MSN : C208 - 00655
TSN / CSN : 3998-13/5974

Date : 22 Dec. 2022
Station : Malinau.
WO No. : 40/108-SNM/x1/2022

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
C221201	226 232	Autopilot Servos Lubrication Task 22-12-00-640		
A245001	121 122	Power Distribution Boxes Detailed Inspection Task 24-50-00-220		
A251001	231 232	Crew Seats Detailed Inspection Task 25-10-00-220		
A251003	231 232	Passenger Seats Detailed Inspection Task 25-21-00-220		
B271001	211 212 217 218 233 234 253 254 251 252 503 525 603 625	Spoiler System Functional Check Task 27-10-00-720		
C271003 RIL	551 571 651 671	Aileron Trim Tab Actuator (2660044-1) Lubrication Task 27-10-02-641	N/A	
		RIL Sign: RIL Stamp:		
C273001 RIL	371 372 375 376	Elevator Trim Tab Actuator (2660017-1) Lubrication Task 27-30-02-640	N/A	
		RIL Sign: RIL Stamp:		
B284103	AUX	Fuel Quantity and Low Fuel Warning Systems Functional Check Task 28-41-00-720		
B313103	312	Flight Data Recorder Underwater Locator Beacon Functional Check Task 31-31-00-721		
B324001	ENG	Brakes Operational Check Task 32-40-00-710		

ITEM CODE NO.	ZONE	TASK	SIGNATURE	
			SIGN	STAMP
B332001	AUX	Passenger/Cargo Compartment Lighting Operational Check Task 33-20-00-710		
A520001	801 802	Crew Doors Detailed Inspection Task 52-00-00-220		
A520003	255 256 257 258 803 804	Passenger/Cargo Doors and Door Frames Detailed Inspection Task 52-00-00-221		
A781001	130	Primary and Secondary Exhaust Duct General Visual Inspection Task 78-10-00-211		
*** End of Inspection Document 10 Items ***				

PERSONNEL PARTICIPATING IN THIS INSPECTION			
NAME	POSITION	SIGNATURE	LICENSE NUMBER
CEP MANA	ENGINEER		15119
AGUS SULAEMAN	ENGINEER		6444
Anya P.	Engineer		2505

RETURN TO SERVICE			
The work recorded above has been carried out in accordance with the requirements of the Civil Aviation Safety Regulation for the time being in force and in that respect the aircraft is consider fit for Release to Service.			
Name	: <u>D. Anya Permana.</u>	Stamp	: 
Signature	: 	Place/Date	: <u>WLP/23 Dec. 2022</u>